


Appendix B: Heritage Assets Gazetteer

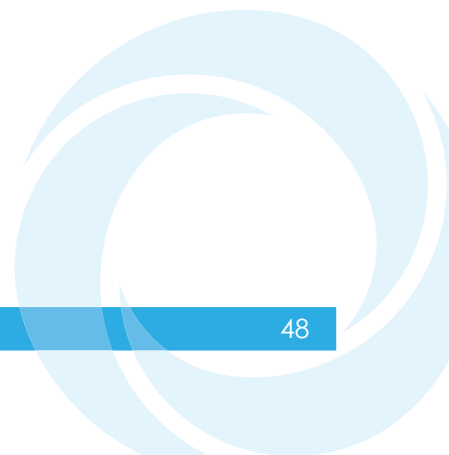

Asset/Event Number	1
Asset/Event Name	4, SOUTH STREET
Type of Site	House
Listing No./NRHE Number	1116899
HER Number	
Status	Grade II Listed Building
Easting	492821
Northing	418347
Parish	Winterton
Council	North Lincolnshire
Description	<p>SE 9218 WINTERTON SOUTH STREET (west side) 9/71 No 4</p> <p>27.6.78 II</p> <p>House. C18 with C17 origins; C19 rear outshut and alterations. Coursed limestone rubble with brick dressings, colourwashed to front. brick stack. Pantile roof. Lobby entry plan. 2 storeys, 3 bays; symmetrical. Quoins. Early C19 doorcase with pilasters supporting plain entablature, cornice and hood; 6 fielded-panel door, top two panels glazed. 4-pane sashes beneath stucco flat arches. Central stack, end stack to right, lateral stack to outshut. Left return has part glazed door in reveal, first floor 12-pane A E B sliding sash and datestone inscribed 1 6 5 9 , probably re-set. H I H Pointed first floor windows with glazing bars to left and right returns of outshut. Interior: beamed ceilings.</p> <p>Listing NGR: SE9282118347</p>

Asset/Event Number	2
Asset/Event Name	TWO TOMB STONES 2-3 METRES SOUTH OF TOWER OF ST MARYS CHURCH, NORTH STREET
Type of Site	Tomb Stones
Listing No./NRHE Number	1242489
HER Number	10842 - MLS10842
Status	Grade II Listed Building
Easting	492059
Northing	417005
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	<p>SE 91 NW ROXBY CUM RISBY NORTH STREET</p> <p>(north side) 5/10 Two tombstones 2-3 metres south of tower of Saint Mary's Church</p> <p>GV II</p> <p>Tomb effigies. C14, re-set on C19-20 brick plinths. Limestone. Both coffin-shaped, with feet and pillowed head protruding from coped canopy. Much weathered and cracked.</p> <p>Listing NGR: SE9205917005</p>

Asset/Event Number	3
Asset/Event Name	ROXBY HALL FARMHOUSE, SOUTH STREET
Type of Site	Farmhouse
Listing No./NRHE Number	1242495
HER Number	5139 - MLS5139
Status	Grade II Listed Building
Easting	491918
Northing	416763
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	SE 91 NW ROXBY CUM RISBY SOUTH STREET (south side) 5/14 Roxby Hall Farmhouse (formerly listed as Roxby Hall)

6.11.67 II

Farmhouse. Late C18 with early-mid C19 alterations. Red and yellow brick with front in contrasting Flemish bond; right return rendered. Pantile roof. Double pile plan with central entrance hall front. 2 storeys with attic, 3 irregular bays. Entrance to right of centre: doorcase with architrave, pulvinated frieze and carved consoles supporting a moulded pediment; part-glazed C20 door beneath Gothick radial fanlight in architrave and plain reveal. One pane in fanlight is inscribed "John Bealby August 4 1794". One late C19 - early C20 3-light casement to right under keyed stucco cambered arch; one 4-pane sash in flush wood surround to left under keyed stucco flat arch. Similar sashes to first floor under keyed stucco cambered arches, with narrower window over entrance. Dentilled brick eaves cornice. Stone-coped gables with shaped kneelers. End stacks. Pointed- arch attic sash with glazing bars to left gable. Interior: entrance hall has open well staircase with ramped and wreathed handrail and column-on-vase balusters with square knobs, moulded ceiling rose and cornice; moulded cornices to ground floor right front and rear rooms; fielded-panel doors and architraves.

Listing NGR: SE9191816763

Asset/Event Number	4
Asset/Event Name	HIGH RISBY FARMHOUSE, RISBY ROAD
Type of Site	Farmhouse
Listing No./NRHE Number	1241767
HER Number	MLS5138
Status	Grade II Listed Building
Easting	492001
Northing	414714
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	SE 91 SW ROXBY CUM RISBY RISBY ROAD (north side) 7/11 High Risby Farmhouse (formerly listed as High 6.11.67 Risby House)

GV II

Farmhouse. Mid C18, probably with earlier origins; C19-20 alterations. Coursed limestone rubble with brick dressings, colourwashed. Brick stacks. Pantile roof. Rectangular on plan: 4 rooms wide with rear outshut and contemporary L-shaped wing to left with later outshut to front. 2 storeys, 3-bay symmetrical front with wide fourth bay to left. Single storey and attic extension to left. Entrance in third bay: part-glazed 6-panelled door and radial fanlight in Doric surround with pilasters supporting an open dentilled pediment. C19 flat-roofed projecting canted bay windows to either side with 12-pane sashes. Single 12-pane sash in flush wood surround to left end with projecting cill and segmental brick arch. Similar sashes to first floor. Dentilled brick eaves cornice. Axial stack to left, end stack to right. Tumbled-in brick to gables with stone coping and shaped kneelers. Interior: open well main staircase with ramped and wreathed handrail and column-on-vase balusters with square knobs; back staircase with moulded handrail and wavy splat balustrade; Dining Room ground floor left has fielded panel dado with moulded dado rail and arched alcove in architrave with moulded ornament; Drawing Room ground floor right has early C19 moulded cornice and beaded door architrave with floral decoration; similar architraves to bay windows. Other original features include 3-fielded-panel doors and window shutters. Timber board found in house inscribed Willm Roberts Roxby Carpenter March 17 George Ramsey Mason Roxby 1768 probably refers to original building or major re-building work.

Listing NGR: SE9200114714

Asset/Event Number	5
Asset/Event Name	LOW RISBY FARMHOUSE, RISBY ROAD
Type of Site	Farmhouse
Listing No./NRHE Number	1259995
HER Number	
Status	Grade II Listed Building
Easting	493041
Northing	414868
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	SE 91 SW ROXBY CUM RISBY RISBY ROAD (north side)

7/12 Low Risby Farmhouse

II

Farmhouse. C18 or earlier origins with 1813 south front by William Fowler of Winterton for Robert Holgate. Later C19 and C20 alterations, including rear entrance porch. Front in squared limestone rubble with brick dressings. Pantile roof. T-shaped on plan: central entrance hall front with rear wing incorporating former cottage. 2 storeys, 3 bays; symmetrical. Doric doorcase with pilasters supporting open dentilled pediment; C20 2-leaf glazed doors under original radial fanlight in reveal. Ogee-headed ashlar niches for bootscrapers to either side. 12-pane ground floor sashes, C19 4-pane sashes to first floor, all with stucco cambered arches and projecting sills. Hipped roof. Central stack to rear. Right return: rear wing has C17 - early C18 2-light ovolo-mullioned ashlar cellar window in chamfered reveal. Interior: open well closed-string staircase with moulded handrail, column-on-vase balusters with square knobs and moulded dado; cornices and beaded-panel doors and window shutters to front rooms. J.T. Fowler, *The Correspondence of William Fowler*, 1907, 182.

Listing NGR: SE9304114868

Sources

Books and journals

Fowler, J T , The Correspondence of William Fowler of Winterton, (1907), 182

Asset/Event Number	6
Asset/Event Name	CHURCH OF ST MARY, NORTH STREET
Type of Site	Church
Listing No./NRHE Number	1260342
HER Number	MLS1987
Status	Grade I Listed Building
Easting	492065
Northing	417019
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	SE 91 NW ROXBY CUM RISBY NORTH STREET (north side) 5/9 Church of Saint Mary 6.11.67 GV I

Church. 12 tower with C14 west window, C14 nave arcades, aisles and chancel. Tower repaired and top stage rebuilt 1704-7. Restorations of 1875, by James Fowler of Louth, included rebuilding north arcade, north aisle and tower arch, new porch, organ chamber, floors, roofs and font. Coursed limestone rubble with limestone ashlar dressings. Slate roof. West tower, 3-bay aisled nave with south porch and 2-bay chancel with organ chamber/vestry adjoining north side. 2-stage tower: chamfered plinth, quoins. Tall first stage has square headed 2-light trefoiled west window with stone above inscribed ROBERT RAMSEY, CHURCH WARDEN 1704. South side has keyhole window below plain string course. Top stage has square-headed twin round-arched belfry openings with ovolo mullions in chamfered reveals beneath a low embattled ashlar parapet dated 1707 on south west corner. North aisle and organ chamber have chamfered plinth and gabled buttresses with finials. South aisle and chancel have moulded plinth and buttresses with trefoiled gables, those to chancel with pinnacled gablets to the set-offs. Aisles have square-headed windows of 2 trefoiled lights (one in south aisle with sub-cusping and 2 in north aisle C19 replacements) and pointed 3-light east windows with Curvilinear tracery, hoodmoulds and headstops; north aisle east window now open to organ chamber. Chancel has 2-light north and south windows similar to aisles, and a pointed 3-light east window with Curvilinear tracery. Pointed chamfered priest's doorway on south side has ogee-headed hoodmould with foliate finial and plank door with ornate iron strap-hinges. Porch has chamfered plinth, angle buttresses, a pointed moulded outer door and circular trefoiled side windows. Moulded pointed inner door under ogee hoodmould with carved finial and head stops. Interior. Tall pointed tower arch on shafted responds. Arcades have double-chamfered pointed arches supported on octagonal piers with moulded capitals and bases, those on north C19 replacements. South arcade capitals have plain corbels projecting on south side. South aisle has a trefoiled piscina and a C14 tall double-chamfered pointed-trefoiled tomb recess containing a mutilated priest's effigy. Above is an empty niche with a moulded corbelled base and a cusped and pinnacled ogee-arched head beneath a pyramidal crocketed and pinnacled canopy flanked by buttress shafts. Pointed moulded chancel arch of 2 orders on narrow octagonal responds with plain moulded capitals and bases. Chancel has triangular-headed aumbry on north side, and on south side a trefoiled piscina and ornate C13-14 double sedilia with octagonal shafts with moulded capitals and bases supporting sub-cusped, crocketed and finialed ogee arches flanked by octagonal shafts with finials. C19 pointed arches to organ chamber. Polychrome encaustic tiles in chancel. Two late C18-early C19 marble wall tablets in tower. N. Pevsner and J. Harris, *The Buildings of England: Lincolnshire*, 1978, p 345; Drawing by C. Nattes, 1794, Banks Collection, Lincoln City Library.

Listing NGR: SE9206817017

Sources

Books and journals

Pevsner, N, Harris, J, Antram, N, The Buildings of England: Lincolnshire, (1989), 345

Asset/Event Number	7
Asset/Event Name	SAWCLIFFE FARMHOUSE, RISBY ROAD
Type of Site	Farmhouse
Listing No./NRHE Number	1260343
HER Number	MLS8506
Status	Grade II Listed Building
Easting	491184
Northing	414556
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	SE 91 SW ROXBY CUM RISBY Risby Road (north side) Sawcliffe Farmhouse

7/13 II GV

Farmhouse. Late C18 north front probably for Robert Holgate, with rear wing of C17 or earlier origins raised to 2 storeys in C19. Early section in roughly-coursed limestone rubble, faced on east side in red brick in Flemish Bond with limestone ashlar dressings. Later sections in squared limestone with ashlar and red brick dressings. Brick stacks. Pantile roofs. T-shaped on plan: central entrance hall front with rear wing. 2 storeys, 3 bays; symmetrical. Ashlar quoins. Doorcase with architrave, fluted frieze and carved consoles supporting a dentilled pediment. 6 fielded-panel door beneath moulded cornice and 3-pane overlight in panelled reveal. Phoenix Insurance Company plaque above. C19 4-pane sashes in flush wood frames with projecting sills and segmental rubbed brick arches; first floor central window has margin lights. Brick eaves. Hipped roof. Twin stacks. Left return: rear wing probably formed part of earlier east front: brick quoins to first floor, rubble plinth with brick and tile string course. Stone steps to plank door; blocked 4-light ashlar double-chamfered mullioned cellar window to right with a 16-pane sash above, 3-light ashlar ovolo-mullioned window in chamfered reveal to left with an 8-pane sliding sash above. Cyma-moulded ashlar string course and 2 first floor 16-pane sashes in segmental-arched brick surrounds. Stone-coped gable with shaped kneelers to C18 build to right, brick-edged stone-coped gable to left. Axial stack. Right return: rear wing has scattered fenestration: three 2-light and one large 3-light ashlar ovolo-mullioned windows in chamfered reveals, and one smaller 3-light with mullions missing. Interior: C18 section contains open well main staircase with ramped and wreathed handrail, and open well closed-string back stairs with moulded handrail, both with column-on-vase balusters with square knobs; moulded stairhall ceiling with central fan design; carved wood chimneypiece with contemporary decorated iron grate to ground floor right. Rear wing contains ovolo-moulded ceiling beam with cyma stops in former back kitchen; fragmentary leaded casement in blocked cellar window. Adjoining range to rear of no special interest.

Listing NGR: SE9118414556

Asset/Event Number	8
Asset/Event Name	28 AND 30, LOW STREET
Type of Site	Farmhouse
Listing No./NRHE Number	1116933

HER Number

Status	Grade II Listed Building
Easting	492542
Northing	418422
Parish	Winterton
Council	North Lincolnshire
Description	SE 9218-9318 WINTERTON LOW STREET (north side) 9/61 Nos 28 and 30

II

Farmhouse, now divided into 2 houses. C17-18, altered and raised in mid C18, with later rear outshut and extension to right. Earlier section in coursed limestone rubble with brick gables; later build in brick. Pantile roof. Central entrance hall plan. 2 storeys with attic, 3 bays; symmetrical. Brick plinth. Part-glazed panelled door with plain overlight beneath stucco flat arch. 12-pane flush sashes with stucco flat arches and cills. Two C20 dormers. End stacks. Interior: good mid C18 open well staircase with closed string, moulded handrail and column-on-vase balusters with square knops; rougilly-chamfered spine beams to ground floor, that to left with cyma stops; fielded-panel doors.

Listing NGR: SE9254218421

Asset/Event Number	9
Asset/Event Name	BEECH HOUSE, 1, LOW STREET
Type of Site	House
Listing No./NRHE Number	1319691
HER Number	
Status	Grade II Listed Building
Easting	492768
Northing	418419
Parish	Winterton
Council	North Lincolnshire
Description	SE 9218-918 WINTERTON LOW STREET (south side) 9/62 No 1 (Beech House)

GV II

House. Late C18, altered late C19. Coursed limestone rubble with brick dressings to early section; later red brick additions, stacks and slate roof. Central entrance hall plan. 2 storeys with attic, 3 bays; symmetrical. Quoins. 2-course brick cill bands to each floor. Flight of stone steps to entrance. C18 doorcase with architrave, frieze with raised central panel bearing moulded festoon, dentilled cornice and hood on carved consoles; 6-fielded-panel door beneath moulded cornice and 3-pane overlight in panelled reveal. Full-height C19 projecting bays to either side with single cellar windows and pairs of sashes to ground and first floors, all under segmental brick arches with drip moulds and raised keys. Single C19 sash window with margin lights over entrance in enlarged original opening with brick surround. C19 dentilled brick eaves cornice. Central dormer with margin lights. Hipped roof to bays and dormer. End stacks. C18 pointed attic windows to gable ends with Gothick glazing bars. Interior. Original details include: good open well staircase with ramped and wreathed handrail and column-on-vase balusters with square knops; moulded stairhall ceiling with cornice; arched alcove with architrave to ground floor right; moulded cornices and chimneypieces with composition ornament to first floor rooms; panelled doors.

Listing NGR: SE9276818419

Asset/Event Number	10
Asset/Event Name	BLANKNEY HOUSE FRONT RAILINGS AND STEPS, LOW STREET
Type of Site	House
Listing No./NRHE Number	1116948
HER Number	
Status	Grade II Listed Building
Easting	492759
Northing	418440
Parish	Winterton
Council	North Lincolnshire
Description	SE 9218-9318 WINTERTON LOW STREET (north side) 9/60 No 2 (Blankney House), front railings and steps

6.11.67 II GV

House, including front railings and steps. Late C18 with some C19 internal alterations to rear. Squared limestone rubble. Brick stacks. Pantile roof. Cast-iron railings on ashlar dwarf wall. Central entrance hall plan. 2 storeys, 3 bays; symmetrical. Central pedimented bay breaks forward. Two opposed flights of 4 stone steps to entrance, with railings and ornamental iron grille to cellar window below. Doric doorcase with pilasters supporting fluted entablature and dentilled open pediment; 6-panelled door and radial fanlight in arched beaded-panel reveal. 12-pane sashes with keyed stucco flat arches and cills. Stucco first floor band. Similar first floor sashes with plain stucco flat arches. Hipped roof. Twin axial stacks. Right return, facing Market Street, has 2 windows to each floor similar to front. Railings extend approximately one metre from front, with pair of gates flanking steps to entrance: chamfered ashlar plinth, fluted column posts with pineapple finials and vertical bars with fleur-de-lys finials linked by mid- and top-rails. Interior. Original details include: open-well staircase with ramped and wreathed handrail and column-on-vase balusters with square knops, moulded stairhall ceiling with cornice and central fan design; moulded ceiling cornices, composition chimneypieces and beaded-panel doors and window shutters in architraves to main rooms on ground and first floors. A fine and largely intact example of a modest late Georgian townhouse, probably one of those built for William Marris from his £10,000 lottery winnings. W Andrews, *The History of Winterton*, 1836, 17.

Listing NGR: SE9275918440

Sources

Books and journals

Andrews, W , *The History of Winterton*, (1836), 17

Asset/Event Number	11
Asset/Event Name	MONEY FIELD ROMAN SITE, DRAGONBY
Type of Site	Roman Site
Listing No./NRHE Number	1005224
HER Number	1851 - MLS1851

Status	Scheduled Monument
Easting	490598
Northing	413891
Parish	Non Civil Parish
Council	North Lincolnshire
Description	<p>IA-RB site, centred on "Money Field" S of Dragonby village. Money Field scheduled. (DOE AM List). Field has long been known for surface finds, excavations 1927-28 revealed rectangular stone building at SE 9062 1390, and sections of roads and building debris at SE 906 140 (centre) (Dudley 1931, ch. VII; Dudley 1949, ch. XIV). Herringbone masonry footings of a rectangular building with probable hypocaust excavated by SM at SE 9047 1387, site subsequently destroyed by ironstone mining. Excavation of an IA ditch by R H Arrand and an RB kiln by I M Stead in 1963 (EMAS 6, 1963, 5, 9, fig. 1). Excavations 1964-1972 in advance of ironstone mining directed by J May for Dragonby Excavation Committee. Geophysical survey over Money Field indicated a complex of enclosures, buildings, roads, etc. Excavations, largely on W side of field SE 905 138 (centre), revealed a complex of intersecting enclosure ditches, gullies, pits, hut circles, etc. representing IA occupation from late 2nd - early 1st cent. During Roman period site was characterized by rectangular stone and timber buildings, wells, ovens, pottery kilns, etc. within enclosed plots of land, and metalled roads flanked with ditches. A small Neolithic site containing undecorated Early Neolithic sherds was also excavated. Finds in SM, Nottingham University, (May 1970, 222-45; May 1976). Many further finds from Dragonby, particularly coins and metalwork, in pp. Cropmarks on aerial photos confirm many of the features revealed by geophysical survey, and in addition show further rectangular buildings, enclosure ditches, roads in the S and E parts of the field not covered by the ground survey. Cropmarks also show the continuation of the settlement to the E, into the area where 2 RB pottery kilns were excavated 1940, (Roxby parish). (DNR obl. 1971, 1974; SM, CS/01). [1] The excavation provided important stratigraphical evidence for establishing a cultural sequence, which in the Iron Age was related to continental La Tene II and III. The settlement, together with other recent evidence from the region, suggests the existence of an advanced and flourishing Iron Age society centred in Lindsey, which has implications for the British Iron Age as a whole. There was slighter evidence for activity at the site in the Mesolithic and Neolithic periods, the Bronze Age, the Anglo-Saxon and later Medieval periods.</p>

Asset/Event Number	12
Asset/Event Name	SAWCLIFFE MEDIEVAL VILLAGE AND MOATED SITE
Type of Site	Medieval Village and Moated Site
Listing No./NRHE Number	1017554
HER Number	MLS1705; MLS1996
Status	Scheduled Monument
Easting	491099
Northing	414442
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	<p>Medieval rural settlements in England were marked by great regional diversity in form, size and type, and the protection of their archaeological remains needs to take these differences into account. To do this, England has been divided into three broad Provinces on the basis of each area's distinctive mixture of nucleated and dispersed settlements. These can be further divided into sub-Provinces and local regions, possessing characteristics which have gradually evolved during the last 1500 years or more. This monument lies in the Lincolnshire Scarp and Vale sub-Province of the Central Province, which comprises a succession of scarps and vales in which clay vales with alluvial deposits and a chalk ridge, together with associated glacial deposits,</p>

form the structural framework of the landscape. There is a very dense scatter of nucleated settlements, many of which are situated in lines along favoured scarp-foot and dip-slope locations. Large numbers of medieval village sites now lie wholly or partially deserted. Densities of dispersed farmsteads are very low. The Scarp and Vale Country local region is divided by the Lincoln Edge from the broad Vale of Trent to the west. Chains of ancient village settlements, some now deserted, are characteristic of the region. They occur where soils change and springs appear. Densities of dispersed farmsteads are uniformly low.

Medieval villages were organised agricultural communities, generally sited at the centre of a parish or township, that shared resources such as arable land, meadow and woodland. Village plans varied enormously, but where they survive as earthworks, their most distinguishing features include roads and minor tracks, platforms on which stood houses and other buildings such as barns, enclosed crofts and paddocks. They frequently included the parish church within their boundaries, and as part of the manorial system, most villages included one or more manorial centres which may also survive as visible remains as well as below ground deposits. In the central province of England, villages were the most distinctive aspect of medieval life, and their archaeological remains are one of the most important sources of understanding about rural life in the five or more centuries following the Norman Conquest. Around 6,000 moated sites are known in England. They consist of wide ditches, often or seasonally water-filled, partly or completely enclosing one or more islands of dry ground on which stood domestic or religious buildings. In some cases moated islands were used for horticulture. The majority of moated sites served as prestigious aristocratic or seigniorial residences with the provision of a moat primarily as a status symbol rather than as a means of defence. The peak period of moat building was between about 1250 and 1350 and by far the greatest concentration lies in central and eastern England. However moated sites were built throughout the medieval period and are widely scattered throughout England, demonstrating a wide diversity of forms and sizes. They are a significant class of medieval monument and are important for the understanding of the distribution of wealth and status in the countryside. Many examples provide conditions favourable to the survival of organic remains. Sawcliffe retains well preserved earthworks of a small medieval settlement together with evidence of early post-medieval activity. The canal and moat ditches, still being seasonally water-filled, will retain waterlogged deposits with well preserved organic remains. The settlement remains include complete ground plans of small houses as well as earthwork evidence for the overall layout of the village. Additional buried remains such as rubbish pits, yard surfaces, and spreads of deposits such as smithing wastes will add to the understanding of medieval village life.

Details

The monument includes the buried and earthwork remains of the medieval village of Sawcliffe and the earthworks of a moated site and later house and garden features, all located to the south and west of Sawcliffe Farm. The settlement of Sawcliffe is thought to date from at least the Saxon period, as the construction of a water pipeline laid along the western boundary of the monument in 1994 revealed a quantity of Saxon pottery. Sawcliffe was named in the Domesday Book as Saleclif and was split between three absentee landlords: the Abbot of Peterborough, Roger de Bully and Gilbert de Ghent. These three men also held Risby (now the hamlets of High and Low Risby) and Appleby to the east. Sawcliffe appears to have been badly affected by the Black Death as it was one of those villages granted over 50 per cent relief from taxation in 1354. Sawcliffe is believed to have been reduced to a single farm by 1600. The monument includes two main groups of earthworks. Firstly, there are the remains of the medieval village of Sawcliffe with its main street with house platforms and building remains. Secondly, there is a moated site with other features related to a higher status residence that is thought to have survived the abandonment of the village. The monument includes a number of additional earthwork remains. Towards the centre of the monument there is a rectangular moated island. This measures approximately 80m east-west and 20m north-south and is surrounded by a seasonally water-filled moat with a dry causeway across the east end of the northern moat ditch. The ditch is typically 10m wide with its eastern arm broadened into a pond. Continuing the line of the western moat arm northwards there is a 40m long 'U' shaped depression about 10m wide and 0.5m deep. From the north end of this depression there is an 8m wide ditch running eastwards. These two ditches are interpreted as the unfinished remains of a second larger moated island to the north of the first. North east of the moated island, adjacent to and west of one of the buildings of the modern farm, there is a large 40m by 30m level platform which is identified as the building platform of the high status house that survived

the abandonment of the settlement. To the south east and slightly downhill from the moated island there is a slightly curving 140m long ditch running eastwards. This is identified as an ornamental canal typical of late Tudor and Jacobean gardens. It is also seasonally water-filled and is about 15m wide and 1.5m deep, with a 10m wide flat bottom. Most of the upcast of this ditch appears to form a broad bank running along the south side. This bank overlies, and thus post-dates, the eastern end of a hollow way that curves across the monument westwards, about 50m south of the south moat ditch. Either side of this hollow way, which was the main street of the village, there are the earthwork remains of house platforms standing up to 0.5m high, many with clearly visible remains of buildings with grassed over stone footings still in situ. Most of these house platforms lie on the south side of the street, forming an almost continuous row extending at least 200m beyond western end of the deep ditch. One of the breaks in this row is for a second hollow way which runs from the main street SSE from a point south of the eastern end of the moated island. Just to the west of this there is a raised trackway that curves from the road and forms the southern boundary of the monument, passing between the moat and the canal. This trackway, which runs towards the modern Sawcliffe Farm, overlies both the main street and a house platform and is therefore of a later date. The monument includes a number of other earthworks. These include at least one small building platform to the north of the canal, an irregular area of hollows to its south and, towards the north west corner of the monument, a slight 7m diameter mound which is considered to be a windmill mound. A number of features are excluded from the scheduling; these are the electricity pylon that stands in the south western part of the monument, the water pipeline maintenance access way that lies close to the western boundary due west of the moated island, and all modern fencing, although the ground beneath all these features is included.

MAP EXTRACT The site of the monument is shown on the attached map extract.

Sources

Other

SMR record, Humber Archaeological Partnership, 1705, (1997)

SMR record, Humber Archaeological Partnership, 1996, (1997)

Asset/Event Number	13
Asset/Event Name	EARTHWORK REMAINS OF ST BARTHOLOMEW'S CHURCH, HIGH RISBY
Type of Site	Earthwork Remains of Church
Listing No./NRHE Number	1016931
HER Number	MLS19667
Status	Scheduled Monument
Easting	491887
Northing	414697
Parish	Roxby cum Risby
Council	North Lincolnshire
Description	<p>Reasons for Designation</p> <p>A parish church is a building, usually of roughly rectangular outline and containing a range of furnishings and fittings appropriate to its use for Christian worship by a secular community, whose members gather in it on Sundays and on the occasion of religious festivals. Children are initiated into the Christian religion at the church's font and the dead are buried in its churchyard. Parish churches were designed for congregational worship and are generally divided into two main parts: the nave, which provides accommodation for the laity, and the chancel, which is the main domain of the priest and contains the principal altar. Either or both parts are sometimes provided with aisles, giving additional accommodation or spaces for additional altars. Most parish churches also possess towers, generally at the west end, but</p>

central towers at the crossing of nave and chancel are not uncommon and some churches have a free-standing or irregularly sited tower. Many parish churches also possess transepts at the crossing of chancel and nave, and south or north porches are also common. The main periods of parish church foundation were in the 10th to 11th and 19th centuries. Most medieval churches were rebuilt and modified on a number of occasions and hence the visible fabric of the church will be of several different dates, with in some cases little fabric of the first church being still easily visible. Parish churches are found throughout England. Their distribution reflects the density of population at the time they were founded. In regions of dispersed settlement parishes were often large and churches less numerous. The densest clusters of parish churches were found in thriving medieval towns. A survey of 1625 reported the existence of nearly 9000 parish churches in England. New churches built in the 18th, 19th and 20th centuries increased numbers to around 18,000 of which 17,000 remain in ecclesiastical use. Parish churches have always been major features of the landscape and a major focus of life for their parishioners. They provide important insights into medieval and later population levels or economic cycles, religious activity, artistic endeavour and technical achievement. A significant number of surviving examples are identified to be nationally important.

The earthworks of St Bartholomew's Church will contain valuable archaeological information about the construction and design of rural medieval churches that has often been lost through renovation at churches which have continued in use. The monument is thought to include rare features of a Saxon church which was recorded in the Domesday Book. The church and surrounding churchyard will also contain medieval burials undisturbed by later inhumations and these will retain important information about the population of a small medieval village.

Details

The monument includes the buried and earthwork remains of St Bartholomew's Church and churchyard, located adjacent to the west of the farm at High Risby. The medieval settlement of High Risby extended to the north east, but is not included within the monument as few remains survive. Risby is one of the few places where the Domesday Book of 1087 lists the existence of a church. The main land holder in Risby was recorded as being Roger de Bully, who had possession of a church and priest in Risby along with 31 villagers, 2 smallholders and 31 freemen, all as part of an estate valued at ten pounds. Two smaller holdings in Risby were in the possession of the Bishop of Bayeux and St Peter's Abbey, Peterborough. The church is thought to have passed into the possession of Thornholme Augustinian Priory sometime after the mid-12th century until the priory's dissolution in 1536. Vicars continued to be instituted at St Bartholomew's until 1631; however, the vicarage was united with that of Roxby in 1662 and in 1696 Abraham de la Pryme recorded that only the church's foundations remained. In addition he noted that the earthworks of the depopulated village could also be seen. The earthworks of the church measure approximately 35m east-west and 15m north-south and survive up to 1.5m high, rising to their highest at the eastern end. They indicate the position of the church walls which had dimensions of approximately 30m long and 10m wide. The church lacked transepts, although Abraham de la Pryme recorded that the church had a tower which the earthworks suggest must have been sited on the main axis of the church. The adjoining churchyard is flat, very slightly higher than the surrounding ground and defined by a stony bank up to 0.8m high. It measures 60m north-south and 95m east-west at its greatest extent. The northern and eastern sides are straight and form an obtuse angle, with the remainder of the circuit completed in three curving sections. The post and wire fence is excluded from the scheduling, although the ground beneath is included.

MAP EXTRACT The site of the monument is shown on the attached map extract. It includes a 2 metre boundary around the archaeological features, considered to be essential for the monument's support and preservation.

Sources

Other

SMR record cards, North Lincolnshire SMR, 1989, (1998)

Asset/Event Name	WINTERTON
Type of Site	Conservation Area
Listing No./NRHE Number	
HER Number	
Status	Conservation Area
Easting	492617
Northing	418469
Parish	
Council	North Lincolnshire
Description	Winterton Conservation Area map and Townscape analysis can be found here: https://www.northlincs.gov.uk/planning-and-environment/historic-environment-record/#1592388923832-4310b8ee-aa4c

Asset/Event Number	15
Asset/Event Name	Fieldwalking south of Roxby in an area of RB Occupation, "MAW 0001", North Lincolnshire, 198
Type of Site	UNSYSTEMATIC FIELDWALKING SURVEY
Listing No./NRHE Number	
HER Number	ELS116
Status	Event
Easting	491950
Northing	416150
Parish	
Council	North Lincolnshire
Description	Fieldwalking, carried out by Humberside Archaeology Unit as part of the WGM 81 'Site Survey and Reconnaissance' programme. Unidentified officers RE, AH, BKP walked 10m wide strips, starting in the NW corner of the field. Greyware pottery, possible slag, rubble spreads and much tile was recorded. Field described as 'productive' [

Asset/Event Number	16
Asset/Event Name	MPP field visit
Type of Site	FIELD OBSERVATION (VISUAL ASSESSMENT)
Listing No./NRHE Number	
HER Number	ELS1347
Status	Event
Easting	491353
Northing	414933
Parish	
Council	North Lincolnshire
Description	Visit to battery in order to assess condition for MPP. Ground photographs taken. A non-scheduling report was produced.

Asset/Event Number	17
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1352
Status	Event
Easting	491060
Northing	415208
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	18
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1353
Status	Event
Easting	490949
Northing	414893
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	19
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1354
Status	Event
Easting	492060
Northing	415038
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	20
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1355
Status	Event
Easting	491742
Northing	415201
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	21
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1356
Status	Event
Easting	491747
Northing	415153
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	22
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1357
Status	Event
Easting	491471
Northing	415904
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	23
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1358
Status	Event
Easting	491354
Northing	414016
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	24
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1359
Status	Event
Easting	490718
Northing	414537
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	25
Asset/Event Name	Elwes Estate metal detecting survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1360
Status	Event
Easting	491756
Northing	415106
Parish	
Council	North Lincolnshire
Description	Ongoing survey of Elwes Estate land, overseen by Marina Elwes.

Asset/Event Number	26
---------------------------	----

Asset/Event Name	Aerial photographic sortie
Type of Site	Aerial Photography
Listing No./NRHE Number	
HER Number	ELS1369
Status	Event
Easting	491883
Northing	416617
Parish	
Council	North Lincolnshire
Description	Aerial Photography

Asset/Event Number	27
Asset/Event Name	Aerial photographic sortie
Type of Site	Aerial photography
Listing No./NRHE Number	
HER Number	ELS1396
Status	Event
Easting	491978
Northing	415135
Parish	
Council	North Lincolnshire
Description	Centre recorded within 1km study area Flight by Chris Knowles AERIAL PHOTOGRAPH: C Knowles. 1967. GCK 3. (SLS4062) AERIAL PHOTOGRAPH: C Knowles. 1967. GCK 2. (SLS1579) AERIAL PHOTOGRAPH: C Knowles. 1967. GCK 1. (SLS1578)

Asset/Event Number	28
Asset/Event Name	Auger Survey, former Railway Sidings, Conesby Quarry, 2000
Type of Site	AUGER SURVEY
Listing No./NRHE Number	
HER Number	ELS1456
Status	Event
Easting	490054
Northing	414453
Parish	
Council	North Lincolnshire
Description	Close interval auger survey comprising 60 cores of c.4ha area in advance of quarrying to test

for the presence of archaeological horizons within the sand revealed no archaeological deposits but a thin organic horizon at the base of 4m of sand was radiocarbon dated to Cal BC 11470 to Cal BC 11070. [1] Report on macrofossil plant remains from the survey is listed in the northern region gazetteer :

Report on macrofossil plant remains from the survey is listed in the northern region gazetteer :
Site No 2100 Conesby Quarry Sidings EAU 2001/07.

Reference : Hall A nd Kenward H, 2001, 'Evaluation of biological remains from borehole samples from Conesby

Quarry Sidings, North Lincolnshire (CQS2000) Reports from the Environmental Archaeology Unit, York 2001/07,

4pp [2]

Asset/Event Number	29
Asset/Event Name	Watching brief on the Dragonby Mains Relay, North Lincolnshire, 1994
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS148
Status	Event
Easting	490585
Northing	414285
Parish	
Council	North Lincolnshire
Description	This watching brief took place during the excavations for a new water services pipe, part of which passed to the north of the Ancient Monument "Money Field", the eastern end of the pipeline terminates adjacent to the DMV of Sawcliffe. The excavations for the pipeline were monitored, and a record of the excavation kept (notes, dictaphone record, record drawings). The course of the pipeline encountered many varied soils and subsoils, however no archaeological features relating to "Money Field" were identified. A large ditch which can be seen in cropmark photographs was noted towards the eastern end of the pipeline, however this is undated.

Asset/Event Number	30
Asset/Event Name	Fieldwalking during Dragonby Mains Relay, North Lincolnshire, 1994
Type of Site	UNSYSTEMATIC FIELDWALKING SURVEY
Listing No./NRHE Number	
HER Number	ELS149
Status	Event
Easting	490855
Northing	414315
Parish	
Council	North Lincolnshire
Description	The field walking was part of the scheme of works which included a watching brief, and was completed during the laying of a water pipeline. The route passed to the north of the Ancient Monument "Money Field", and the eastern end terminates adjacent to the DMV of Sawcliffe.

The western end of the pipeline, as it passed near the area known as Money Field did not reveal any archaeology. At the eastern end there were a number of finds recovered from deepening ploughsoil, but very few features were noted along the pipeline.

Asset/Event Number	31
Asset/Event Name	Elwes Estate Metal Detecting Survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1747
Status	Event
Easting	491217
Northing	414752
Parish	
Council	North Lincolnshire
Description	Part of the continuing survey of the estate, overseen by Marina Elwes.

Asset/Event Number	32
Asset/Event Name	Elwes Estate Metal Detecting Survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1748
Status	Event
Easting	490799
Northing	414215
Parish	
Council	North Lincolnshire
Description	Part of the continuing survey of the estate, overseen by Marina Elwes.

Asset/Event Number	33
Asset/Event Name	Elwes Estate Metal Detecting Survey
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS1749
Status	Event
Easting	491727
Northing	416691
Parish	

Council	North Lincolnshire
Description	Part of the continuing survey of the estate, overseen by Marina Elwes.

Asset/Event Number	34
Asset/Event Name	Aerial Photograph of Sawcliffe DMV
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS1760
Status	Event
Easting	491105
Northing	414392
Parish	
Council	North Lincolnshire
Description	Sortie of unknown extent. Oblique shot of Sawcliffe DMV and moated site. Building platforms clearly visible as earthworks.

Asset/Event Number	35
Asset/Event Name	Watching brief, Sand Extraction at Conesby Quarry, December 2002 - February 2003
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS2053
Status	Event
Easting	490054
Northing	414440
Parish	
Council	North Lincolnshire
Description	<p>A watching brief was maintained during the site strip and extraction of sand and clays from the former ironstone quarry at Conesby Railway Sidings. An organic layer was revealed within the wind-deposited sands, possibly representing ancient land surfaces. No archaeological features or finds were identified.</p> <p>COMPUTER DISK/TAPE: Atkinson, D.. 2004. HFA Watching Brief Reports. WBreport620 (SLS2692) REPORT - INTERIM, RESEARCH, SPECIALIST, ETC: N.G. Adamson, D. Atkinson, Humber Field Archaeology. 2003. An Archaeological Watching Brief at Conesby Quarry, North Lincolnshire. (SLS2414)</p>

Asset/Event Number	36
Asset/Event Name	Palaeoenvironmental sampling, Conesby Quarry, December 2002 - February 2003
Type of Site	ENVIRONMENTAL SAMPLING

Listing No./NRHE Number**HER Number** ELS2055**Status** Event**Easting** 490046**Northing** 414412**Parish****Council** North Lincolnshire

Description Three samples were taken from an organic layer revealed below wind-deposited sands during the extraction of sand and clays from the former ironstone quarry at Conesby Railway Sidings. A single sediment sample from a thin deposit of highly humified and silty peat was submitted for palaeoenvironmental analysis. Two subsamples from the top and base of the layer were also submitted for radiocarbon dating. These returned conventional radiocarbon ages of 11660 +/- 180 BP for the base of the layer, and 10950 +/- 100 BP for the top. The material recovered from a 3 kg subsample was mostly quartz sand, with some granular organic matter, mainly small, rather strongly decayed wood fragments. Most of the rest of the material was well-humified silty peat. The range of pollen grains identified in samples from the base and top of the peat was small and dominated by that of sedges. There was also a small and generally poorly preserved, but distinctive, insect fauna, typical of those from Late-Glacial tundra landscapes.

Asset/Event Number 37**Asset/Event Name** Watching Brief, High Street, Dragonby, September 2003**Type of Site** WATCHING BRIEF**Listing No./NRHE Number****HER Number** ELS2110**Status** Event**Easting** 490552**Northing** 414117**Parish****Council** North Lincolnshire

Description An archaeological watching brief was carried out during groundworks associated with the erection of a house in the vicinity of the Iron Age and Romano-British settlement at Dragonby. The plot sloped markedly to the west and south, and the north-eastern corner had been terraced to a depth of 1.3m prior to the commencement of the watching brief. Machine excavation of the northern part of the house foundation was monitored. The watching brief was curtailed prior to the excavation of the south-eastern part of the house foundation, the garage foundation and service trenches. The deposits comprised a very light sandy loam (topsoil remnant) and a substantial underlying deposit of clean ginger-brown sand. The apparently natural deposit of firm, mottled grey and ginger clay was exposed at the base of all inspected parts of the foundation trench. A 1cm dusting of brown loamy sand, in isolated patches between the clay and sand may represent a buried land surface. Only 20th century artefacts were collected.

Asset/Event Number 38**Asset/Event Name** Excavation of Roxby Villa mosaics, Roxby, 1972**Type of Site** EXCAVATION

Listing No./NRHE Number**HER Number** ELS2146**Status** Event**Easting** 492020**Northing** 416970**Parish****Council** North Lincolnshire**Description**

At the request of the Elwes Estate, the mosaics were uncovered by Chris & Margaret Knowles together with a group of volunteers in summer 1972, for public display during the Roxby Flower Festival. [1-3] The overburden was removed entirely by hand and the mosaics cleaned off. Robber trenches of wall foundations were noted but there was no further excavation of the archaeological remains. The excavation cutting was planned by Knowles but not referenced to any landmarks, hence exact location of the mosaics on the ground has been problematic. The mosaics were planned and drawn, the borders by Chris Knowles and the central decorated panel by David Neal. The mosaics were backfilled at the end of the summer.

Asset/Event Number 39**Asset/Event Name** Trial trench, North Street, Roxby c.1971**Type of Site** TRIAL TRENCH**Listing No./NRHE Number****HER Number** ELS2147**Status** Event**Easting** 492043**Northing** 416985**Parish****Council** North Lincolnshire**Description**

Prior to the commencement of house building at no.24 North Street, a linear north-south trench was hand dug by the excavator on a single day to identify any remains associated with the adjacent mosaics. Nothing consistent with a villa structure or any associated features was identified, although the excavator noted that robber trenches and other slight features may not have been seen due to the limitations of the work. No plans were drawn and no archive kept.

Asset/Event Number 40**Asset/Event Name** Watching brief, 22 North Street, Roxby c.1973**Type of Site** WATCHING BRIEF**Listing No./NRHE Number****HER Number** ELS2148**Status** Event**Easting** 492036**Northing** 416969**Parish**

Council	North Lincolnshire
Description	The open foundation trenches for a new dwelling adjacent to the Roxby Roman mosaics were inspected by Chris & Margaret Knowles but no features or finds consistent with a villa structure were observed. No archive was kept.

Asset/Event Number	41
Asset/Event Name	Watching brief at 20A North Street, Roxby, 2005
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS2345
Status	Event
Easting	492014
Northing	416977

Parish

Council North Lincolnshire

Description	<p>A watching brief was carried out on the construction of foundations for a single storey extension. It lies within the recorded footprint of Roxby Roman villa, close to the excavation trench dug in 1989. A concrete slab foundation was designed to have minimal impact. The rectangular foundation trench measuring approximately 4m x 3m was a maximum of 0.4m deep and 0.6m wide; the reduction of the interior level was not monitored. Directly beneath modern topsoil, in the west and east perimeter trenches of the foundation slab, was a very compacted and laminated deposit of very dark grey clay loam, which contained small pieces and flecks of stone, flecks of charcoal and the occasional small sherd of 19th century china. The interface between the two topsoils lay at approximately 43.33m OD. It seems likely that this remnant of an earlier topsoil had become compacted either during or immediately prior to the construction of the bungalow, perhaps when the area over and around the 1989 excavation trenches was backfilled and consolidated. Within the southern perimeter trench, a hollow in the top of the buried topsoil had been filled with a dirty mixture of yellowish clay and small stones, possibly spoil from the bungalow's foundation trench, prior to the deposition of the modern topsoil. A higher density of flecks and pieces of limestone (the latter averaging 10 x 6 x 4cm in size) within the compacted buried topsoil, towards the 43.20m OD bottom of the foundation trench, may represent the top of the spread of rubble associated with the demolition of the villa. Although there were no datable finds within this stonier horizon, it appears likely that the buried topsoil observed during the 2005 watching brief is the truncated and disturbed equivalent of a layer (numbered 18) described by John Farrimond in 1989. [1] When it had been demonstrated that the groundworks associated with the redesigned slab foundation would not impinge upon the medieval or Roman deposits, the watching brief was concluded. The supervising archaeologist left site when the perimeter trench had been emptied but before the level of the internal area was reduced to an approximate level of 43.40m OD to accommodate the concrete floor slab.</p>
--------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Asset/Event Number	42
Asset/Event Name	Watching brief, 4 North Street, Roxby, 2007
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS2679
Status	Event

Easting	491889
Northing	416916
Parish	
Council	North Lincolnshire
Description	An archaeological watching brief was maintained during the construction groundworks for a two-storey extension on the side of an existing dwelling close to the site of the Roman villa at Roxby. Machine excavation of the foundation trenches revealed relatively clean clay and /or limestone bedrock below disturbed deposits closest to the existing building. Two large irregular slabs of limestone (0.40m x 0.25m x 0.10m) were observed in the disturbed layers. Beyond the disturbed area, the foundation trenches revealed 0.30m to 0.65m depth of cultivated soil consisting of grey/ginger brown clay loam over a very clean mid ginger-brown loamy clay and/or the limestone bedrock. No features, deposits or artefacts of archaeological significance were encountered.

Asset/Event Number	43
Asset/Event Name	Excavations at Dragonby Money Field, 1927
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS2893
Status	Event
Easting	490618
Northing	413907
Parish	
Council	North Lincolnshire
Description	Excavation by Mr George R Walshaw. Outlines of structures in white limestone had been noted after ploughing the previous year, and Roman pottery and a quernstone were found. The excavation revealed a complete rectangular building measuring 13.25m by 6.1m. The interior fill of the building was completely removed. The walls survived in places up to 1.22m in height, and the masonry was bonded with mortar. A fragment of coloured wall plaster, pottery including samian ware and a 4th century coin. Walshaw's ms report, location plan and 2 photographs are located in the NLM parish files.

Asset/Event Number	44
Asset/Event Name	Trial holes at Dragonby Money Field, 1928
Type of Site	TRIAL TRENCH
Listing No./NRHE Number	
HER Number	ELS2894
Status	Event
Easting	490561
Northing	414029
Parish	
Council	North Lincolnshire
Description	Excavation of 6 trial holes in the north-eastern quarter of Dragonby 'Money Field' by George R

Walshaw. The holes were designated A to F. In Hole C, a possible stone road surface was found at a depth of c. 0.6m, thought to be a route to the spring on the hillside. Hole F was the most westerly, and contained medieval (?) green glazed pottery and two floor surfaces at c. 1.0m and 1.5m. The curving course of a road was also traced by excavation, and is shown on the plan attached to Walshaw's ms report.

Asset/Event Number	45
Asset/Event Name	Excavations in Dragonby Money Field, 1963
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS2896
Status	Event
Easting	490630
Northing	413943
Parish	
Council	North Lincolnshire
Description	Excavations initiated by RH Arrand, with the object of relocating Walshaw's 1927 building. Buildings were found, not apparently the same one. A Roman pottery kiln and a sizeable ditch yielding important Iron Age pottery were also recorded. Dr IM Stead took over the excavation of the kiln, which he published in 1976. Arrand's excavations comprised a grid of 9ft squares, with 3ft baulks between them. An attempt was made during the 1964-73 excavations to relocate Arrand's excavations and features, not entirely successfully. The Dragonby report mentions Arrand's plans, but does not reproduce them. Stead's report shows the excavated Kiln 3 in plan and section, but with no locational information apart from the grid reference SE906 139.

Asset/Event Number	46
Asset/Event Name	Magnetometer Survey, Dragonby 1964-1971
Type of Site	GEOPHYSICAL SURVEY
Listing No./NRHE Number	
HER Number	ELS2897
Status	Event
Easting	490689
Northing	413852
Parish	
Council	North Lincolnshire
Description	A 6 hectare survey of Dragonby Money Field was begun in February 1964 by Dr P Strange (University of Nottingham) and J May. The survey continued from March 1964 by MJ Aitken and concluded by a Professor Tite by 1971. An additional 5 survey areas were also investigated in adjacent fields (OS parcels 0170, 0005, 4226). The surveys used an ELSEC absolute proton magnetometer, with readings at 5ft intervals on a square grid. An extremely complex pattern of anomalies was recorded. They were later found to match features recorded during the subsequent excavations.

Asset/Event Number	47
Asset/Event Name	Magnetic Susceptibility Survey, Dragonby 1964-1971
Type of Site	GEOPHYSICAL SURVEY
Listing No./NRHE Number	
HER Number	ELS2898
Status	Event
Easting	490593
Northing	413976
Parish	
Council	North Lincolnshire
Description	A series of topsoil samples were collected from the Money Field and adjoining fields. Samples of pit and ditch fillings were also taken for comparison. The samples were lab processed in order to determine the concentration of iron oxide, and hence magnetic susceptibility. This susceptibility is known to be influenced by fires on the topsoil. The values obtained were found to agree with the magnetometer data, i.e. the northwestern two-thirds of the Money Field were the most intensively occupied.

Asset/Event Number	48
Asset/Event Name	Field walking on land at Sawcliffe DMV, Roxby, North Lincolnshire, 1981
Type of Site	EXCAVATION;UNSYSTEMATIC FIELDWALKING SURVEY; WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS29
Status	Event
Easting	491033
Northing	414428
Parish	
Council	North Lincolnshire
Description	Field walking completed on the land at Sawcliffe DMV. Medieval pottery was recovered. This fieldwalking was associated with a watching brief and a small-scale excavation which was carried out during the laying of a new watermain from Elsham to Scunthorpe. There is no record other than a HAU sitecode for the fieldwalking, watching brief or excavation available.

Asset/Event Number	49
Asset/Event Name	Contour Survey, Dragonby Money Field
Type of Site	TOPOGRAPHIC SURVEY
Listing No./NRHE Number	
HER Number	ELS2900
Status	Event
Easting	490613
Northing	413883

Parish**Council** North Lincolnshire**Description** Contour survey of the Money Field and surrounding fields, carried out by Jeffrey Ball of Nottingham Trent Polytechnic, date unknown. Height measurements were taken at 5ft intervals.

Asset/Event Number 50**Asset/Event Name** Dragonby Excavations 1964-1973**Type of Site** EXCAVATION**Listing No./NRHE Number****HER Number** ELS2901**Status** Event**Easting** 490550**Northing** 413857**Parish****Council** North Lincolnshire**Description** Excavations over a 10 year period (81 weeks), under the direction of Jeffrey May (Dept of Archaeology, University of Nottingham). In the early years, an excavation committee was chaired by Prof. CFC Hawkes of the University of Oxford, which organised some fundraising; there was also a grant from the Ministry of Public Building and Works. Volunteer labour was also used throughout the excavation. Post-excavation income was largely provided by English Heritage, the British Academy and the Manpower Services Commission. The 1964 season was dominated by the threat of imminent quarrying for ironstone on the eastern edge of the Money Field. 20 small cuttings were dug, informed by the results of a magnetometer survey (ELS2897). Three major Iron Age ditches were recorded, as well as Romano-British features including a pottery kiln (Kiln 4). The ditches were further investigated in 1965 by more hand cuttings, revealing some very complex Iron Age and Romano-British features. By 1966 the proposed quarrying had been postponed for a second time. A larger area was opened out (Cutting 53), although still excavated by hand due to waterlogging. A new area to the south (Site 2) was machine stripped, revealing a Romano-British enclosure. Between 1967 and 1973, a 0.53Ha area (Site 1) was subject to large scale area excavation. A few exploratory cuttings were also dug in the eastern part of the field, and also in the fields to the east and north. The proposed quarrying never took place.

Asset/Event Number 51**Asset/Event Name** Test pit evaluation at Roxby Landfill Site, Roxby, North Lincolnshire, 2007**Type of Site** ENVIRONMENTAL SAMPLING**Listing No./NRHE Number****HER Number** ELS2978**Status** Event**Easting** 491091**Northing** 416534**Parish****Council** North Lincolnshire

Description The test pit evaluation was carried out in advance of the construction of three passing bays on the access road to Roxby landfill site. Ten 1m x 1m test pits were excavated, five at each of the two locations where new passing bays are to be constructed. Vegetation was removed by hand from the surface at each of the test pits, and then the topsoil was manually removed in 0.1m spits and sieved for finds. Where dry sieving was not possible in pits 8 and 10, 30 litres of topsoil was removed as a sample and subsequently soaked in water overnight and then manually wet sieved using a 2mm mesh. Following excavation, the test pits were recorded and photographed. Further information on the recording methodologies is not given. In Bay 1, the topsoil depth was between 0.14m and 0.5m. Two of the test pits had redeposited glacial clay mixed in with the topsoil, and one of the test pits had a stony lense within the topsoil, suggesting some disturbance. Topsoil depth in Bay 2 was between 0.03m and 0.2m deep. There were no archaeological features identified in any of the test pits.

Asset/Event Number 52
Asset/Event Name Photographic survey at Old Hall Farm, Roxby, North Lincolnshire
Type of Site PHOTOGRAPHIC SURVEY
Listing No./NRHE Number
HER Number ELS2989
Status Event
Easting 492324
Northing 417071
Parish
Council North Lincolnshire

Description This photographic survey took place as the first stage of an investigation into the buildings at Old Hall Farm during the repair and conversion of six buildings including the old farmhouse, stables, shelter sheds and barn into dwellings. The photographic survey involved making a record of the internal and external elevations and spaces. This was done using a 35mm format monochrome and colour slide record, with a digital record of the buildings being kept using a Kodak DX6340. Field notes accompanied the photographic record. Site survey was limited to smaller features which could be measured within the buildings. Ten visits were made to the site during the works to complete this survey and the associated watching brief.

Asset/Event Number 53
Asset/Event Name Watching brief at Old Hall Farm, Roxby, North Lincolnshire, 2005
Type of Site WATCHING BRIEF
Listing No./NRHE Number
HER Number ELS2990
Status Event
Easting 492341
Northing 417075
Parish
Council North Lincolnshire

Description This watching brief took place as the second phase of work as part of the investigation into the buildings at Old Hall Farm during the repair and conversion of six buildings including the old farmhouse, stables, shelter sheds and barn into dwellings. The watching brief involved the

monitoring of the groundworks associated with the access road and a length of service pipe trench. The access road monitored measured 15.5m x 6.3m, and was 0.5m deep. Within this a limestone rubble showed the position of a wall foundation. The service trench measured 6.7m x 0.8m, and was 1.8m deep. Any features identified during this watching brief were recorded by maintaining a plan and section record, and a photographic record. There is no more information given concerning the excavation or recording methodologies used during the watching brief.

Asset/Event Number	54
Asset/Event Name	Watching brief on land adjacent to 48 North Street, Roxby, North Lincolnshire, 2001
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3120
Status	Event
Easting	492424
Northing	417115
Parish	
Council	North Lincolnshire
Description	This watching brief was conducted during the development of a new dwelling at land adjacent to 48 North Street. The development lies at the eastern side of the village, in the vicinity to Roxby Roman villa. Further cropmarks extend towards this development area. The trenches excavated were a maximum of 0.7m deep. No archaeological features were identified during this watching brief.

Asset/Event Number	55
Asset/Event Name	Watching Brief at The Old Hall, Roxby, North Lincolnshire, 2000
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3133
Status	Event
Easting	492220
Northing	417057
Parish	
Council	North Lincolnshire
Description	Watching brief completed during the groundworks associated with the conversion of a barn into a dwelling and garage. The development lies close to Roxby Roman villa, the full extent of which is not known. Excavations of the foundation and service trenches were monitored, and where archaeological features were noted a written description was supplemented by a scale plan and section drawings and a photographic record. Four visits were made to the site during the excavations. There were a small number of features identified during this watching brief, including a Romano-British pit and an uncovered well that was probably associated with the farm buildings which occupied this site until recently.

Asset/Event Number	56
Asset/Event Name	Watching Brief during the construction of Water Main Pipelines at Roxby and Winterton, North
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3137
Status	Event
Easting	492731
Northing	418308
Parish	
Council	North Lincolnshire
Description	This watching brief took place during the laying down of a new water pipelines. Twenty three visits were made by an archaeologist during the works, to examine exposed sections of the trenches. The areas monitored comprised of: 100m at the B1207, near to Ermine Street, the line along the B1430 between Thealby and the A1077 junction, part of the A1077 lines in streets around Roxby. The north-south pipeline was not monitored due to the lack of finds during unrelated fieldwalking surveys. The total length of the new pipeline is 1500m. The working width of the pipeline is approximately 3m, with the width of the topsoil strip limited to 0.5m. The depth of excavations is 0.9m. At the northern end of the pipeline along the A1077, there was an area of 20th century domestic refuse and building material dumped to raise the level of the road. There were no archaeological features identified during this watching brief.

Asset/Event Number	57
Asset/Event Name	Building survey at Bagmoor Farm, Bagmoor Lane, Butrton on Stather, North Lincolnshire, 2008
Type of Site	PHOTOGRAPHIC SURVEY
Listing No./NRHE Number	
HER Number	ELS3176
Status	Event
Easting	490416
Northing	416313
Parish	
Council	North Lincolnshire
Description	This photographic survey was part of the scheme of works investigating buildings at Bagmoor Farm prior and during the construction and conversion of existing agricultural buildings into an equestrian centre and associated dwelling, carpark and outdoor ménage. The farm buildings which are to be effected are first seen on 1886 maps, suggesting they are Victorian or older. The proposed development will alter damage and obscure parts of the historic buildings. Existing plans of the buildings were annotated and used by the archaeologists for the survey. Nikon 35mm film and digital cameras were used to take monochrome and colour images. There were two main groups of buildings, one grouped to the north of the main farmhouse which was not a part of this investigation, and the second to the north-east of the former, on the edge of a large yard area. The buildings included a two-storey barn, various agricultural sheds, a garage and stable block. A written description of the building materials, dimensions, and architectural details was kept.

Asset/Event Number	58
---------------------------	----

Asset/Event Name	Watching brief at Bagmoor Farm, Bagmoor Lane, Burton on Stather, North Lincolnshire, 2008
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3177
Status	Event
Easting	490419
Northing	416306
Parish	
Council	North Lincolnshire

Description This watching brief was part of the scheme of works investigating the land at Bagmoor Farm prior to the conversion of existing farm buildings and associated construction of a new equestrian centre. The site lies on a farm in an area where agricultural buildings dating to the 18th century currently exist. A single visit was made to the site to monitor the excavation of service pipe trenches linking the converted barn to the other buildings, showing 0.3m of topsoil overlying obscured deposits. A further, larger trench was excavated at the north end of the barn (0.6m wide). The deposits in both trenches showed a limestone yard surface overlying a 0.15m thick topsoil. To the south layers of sand interpreted as make up layers were identified, while at the north end the topsoil overlay a layer of ironstone. A brick culvert was identified running below the wall of one of the sheds. A further visit was made to examine the area topsoil stripped by bulldozer for the ménage area. This area was excavated without archaeological supervision, in order to level the area. In the south west corner the surface was now 0.9m below ground level, but in other places the ground had been levelled by depositing sand. No archaeological features were visible in this area. Four worked flints were collected from the eastern edge of the area, dated to between the Mesolithic and early Bronze Age, but this was the only evidence of human activity in this area.

Asset/Event Number	59
Asset/Event Name	Investigations at Sheffield's Hill, Roxby, North Lincolnshire, 1927-31
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS3221
Status	Event
Easting	490781
Northing	414972
Parish	
Council	North Lincolnshire

Description Although the term excavation is not used in the material available, it appears that a series of small-scale investigations into Sheffield's Hill were conducted between 1927 - 1931. The site was led by AL Armstrong. The site was brought to his attention by a Mr. Dent, a shallow depression, about 100 yards across, in the slope just off the summit of Sheffield's Hill, where there was a strong concentration of flint artefacts. The finds are described as being on an old land surface, suggesting that some digging was done to discover this. The artefacts recovered included a number of worked flints, Neolithic arrowheads, blades, borers, scrapers, chisel ended blades and burins. Debitage from striking the flints was also noted.

Asset/Event Number	60
---------------------------	----

Asset/Event Name	Excavation of Roman pottery kilns at Roxby-cum-Risby, North Lincolnshire, 1940
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS3224
Status	Event
Easting	490771
Northing	414022
Parish	
Council	North Lincolnshire
Description	Two Roman pottery kilns were unearthed by workmen who were digging the groundworks for a large septic tank near Dragonby in "Money Field". One was in better condition than the other. They were examined by H. E. Dudley, who identified them as up-draught kilns. They lay just above the 200m contour line. The more complete kiln was 5ft in external diameter and about 5ft high. No pottery was found in either of the kilns, however a 2nd century cooking pot was found nearby. After the kilns had been examined and recorded, they were covered with planks and the area backfilled. [1] No plan is available showing the exact location of the kilns.

Asset/Event Number	61
Asset/Event Name	Cropmark transcription from Google Maps
Type of Site	AERIAL PHOTOGRAPH INTERPRETATION
Listing No./NRHE Number	
HER Number	ELS3278
Status	Event
Easting	491464
Northing	414281
Parish	
Council	North Lincolnshire
Description	Transcription of cropmark features visible on Google Maps AP dataset, south east of Sawcliffe. A screenshot of the area was rectified to OS Mastermap, and the features transcribed directly to table Cmsketchplots.T

Asset/Event Number	62
Asset/Event Name	Topographical survey, Church of St Bartholomew
Type of Site	ANALYTICAL EARTHWORK SURVEY
Listing No./NRHE Number	
HER Number	ELS3399
Status	Event
Easting	491904
Northing	414686
Parish	

Council	North Lincolnshire
Description	Topographical survey of the earthworks of the church of St Bartholomew, carried out by MA student Jeremy Burton. The amount of trees on the site only allowed a simplified 'top and bottom' approach to the earthworks, with measurements logged in a total station (probably - the technique is not made clear in the dissertation). The survey plan (Fig 24) is a computer plot of the high and low points, with no hachures. The surrounding enclosure appears 'stretched' east-west, compared to the OS mastermap survey. Two elements of the building were identified, a nave and a smaller eastern chancel

Asset/Event Number	63
Asset/Event Name	Fieldwalking at Manor Farm, 1983
Type of Site	SYSTEMATIC FIELDWALKING SURVEY
Listing No./NRHE Number	
HER Number	ELS3468
Status	Event
Easting	491693
Northing	416681
Parish	
Council	North Lincolnshire
Description	Solo fieldwalking by Jane Grenville. NLM holds the finds, but there is no paper archive, and the finds were never processed or identified

Asset/Event Number	64
Asset/Event Name	Fieldwalking at Manor Farm, 1986
Type of Site	SYSTEMATIC FIELDWALKING SURVEY
Listing No./NRHE Number	
HER Number	ELS3469
Status	Event
Easting	491689
Northing	416855
Parish	
Council	North Lincolnshire
Description	SBN 86 field team fieldwalking, led by John Creighton. Largely post-medieval ceramic 'background noise'.

Asset/Event Number	65
Asset/Event Name	Survey of a horse engine, Roxby
Type of Site	BUILDING SURVEY
Listing No./NRHE Number	
HER Number	ELS3473

Status	Event
Easting	492008
Northing	416832
Parish	
Council	North Lincolnshire
Description	Building recording by CM Wilson and B Brooke, 1976. A short report and a single drawing were published in LHA

Asset/Event Number	66
Asset/Event Name	Aerial photographic Sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS3571
Status	Event
Easting	491117
Northing	414439
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPHY

Asset/Event Number	67
Asset/Event Name	Watching Brief, 44 South Street, Roxby
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3619
Status	Event
Easting	492197
Northing	416995
Parish	
Council	North Lincolnshire
Description	Observation and recording on groundworks recovered no dateable archaeological features.

Asset/Event Number	68
Asset/Event Name	Ermine house, 5 East Street, Roxby, Scunthorpe
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3623

Status	Event
Easting	492184
Northing	417030
Parish	
Council	North Lincolnshire
Description	Observation and recording of house extension which produced a small pit containing an example of an early Roxby kiln product

Asset/Event Number	69
Asset/Event Name	9 South Street, Roxby, Scunthorpe
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3633
Status	Event
Easting	491975
Northing	416868
Parish	
Council	North Lincolnshire
Description	Observation and recording of house extension which produced evidence of later medieval terracing through residual pottery scatters uncovered during groundworks.

Asset/Event Number	70
Asset/Event Name	Roxby Landfill site revised restoration proposals
Type of Site	DESK BASED ASSESSMENT
Listing No./NRHE Number	
HER Number	ELS3686
Status	Event
Easting	491350
Northing	417315
Parish	
Council	North Lincolnshire
Description	An initial H.E.R search concluded that no detailed research was necessary as any remaining archaeology would not be disturbed.

Asset/Event Number	71
Asset/Event Name	Former Normanby Park Steelworks and Conesby Quarry phase III
Type of Site	DESK BASED ASSESSMENT
Listing No./NRHE Number	

HER Number	ELS3687
Status	Event
Easting	489873
Northing	414554
Parish	
Council	North Lincolnshire
Description	A Desk based assessment concluding that any archaeological remains that were once present on the site have since been investigated and removed during quarrying therefore infilling of the land will have no impact on the archaeology.

Asset/Event Number	72
Asset/Event Name	Find of a Bronze Age arrowhead, Bagmoor Farm Cottage
Type of Site	Stray Finds - Recorded
Listing No./NRHE Number	
HER Number	MLS22038; ELS3721
Status	Non-designated Heritage Asset
Easting	490400
Northing	416290
Parish	
Council	North Lincolnshire
Description	<p>Find of a Bronze Age arrowhead, Bagmoor Farm Cottage. Recorded in NLM accession database as donated in July 1969, presumably found the same year.</p> <p>An Early Bronze Age barbed and tanged flint arrowhead was found at Bagmoor Farm Cottage, and donated to North Lincolnshire Museum in 1969. One barb was complete, the tang and the second barb incomplete. It was assigned museum site code BSDB 4.</p>

Asset/Event Number	73
Asset/Event Name	Metal detecting, 2006
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS3760
Status	Event
Easting	492119
Northing	417120
Parish	
Council	North Lincolnshire
Description	A metal detecting survey conducted by a single individual in March 2006

Asset/Event Number	74
Asset/Event Name	Metal detecting, 2007
Type of Site	METAL DETECTING USE
Listing No./NRHE Number	
HER Number	ELS3762
Status	Event
Easting	491300
Northing	415700
Parish	
Council	North Lincolnshire
Description	Metal detecting by a single individual in November 2007 on a site previously investigated by Scunthorpe Metal Detectors club

Asset/Event Number	75
Asset/Event Name	Aerial photographic assessment and transcription
Type of Site	AERIAL PHOTOGRAPH INTERPRETATION
Listing No./NRHE Number	
HER Number	ELS3782
Status	Event
Easting	492053
Northing	414617
Parish	
Council	North Lincolnshire
Description	Cropmarks of a linear trackway noted on Google Maps AP coverage, extending WNW-ESE between SE91491485 and SE92871439, passing through High Risby DMV.

Asset/Event Number	76
Asset/Event Name	Sheffield's Hill re-excavation
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS3784
Status	Event
Easting	490780
Northing	414968
Parish	
Council	North Lincolnshire
Description	Cropmarks of a linear trackway noted on Google Maps AP coverage, extending WNW-ESE between SE91491485 and SE92871439, passing through High Risby DMV.

Asset/Event Number	77
Asset/Event Name	De La Pryme excavation, Roxby Villa, 1699
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS3785
Status	Event
Easting	492012
Northing	416968
Parish	
Council	North Lincolnshire
Description	<p>Excavation of a Roman mosaic floor, as reported in a letter to Thomas Gale (Dean of York) by the diarist Abraham de la Pryme. Thomas Smith, a tenant of the landowner Elwes, had already exposed a portion and allowed local schoolboys to help themselves to tessera. De la Pryme excavated with two Winterton men, Mr Place and Mr Nevil: ‘..haveing got a spade, a shovel, and a besom, we fell to work, and with a great deal of labour, bared about a yard and a half squair-; in bareing of which we cast up many pieces of Roman tyle, ye bone of ye hinder legg of an ox or cow, broken in two, and many pieces of lime and sand, or plaster, painted red and yellow, which had been ye cornish either of some altar, or some part of ye building that was there, whatever it was; and we observed, likewise, that several great stones, in their falling, had broken through ye pavement, and there laye untill that we removed them. "Then, having swept ye space aforesayd, that we had bared, very clean, ye pavement look'd exceeding beautiful' and pretty, and one would not imagine that such mean stones could make such pretty work, for they are nothing but four squair bitts of brick, slate, and cauk, set in curious figures and order, and are only of colours red, blew and white, specimens of all which I have sent by the bearer (of the letter here quoted); amongst which is one as larg again as any of the rest, of which many whole rows and rectangular figures of the same bigness, consisting of blew, red, and white, were composed all on ye outside of ye smaller work. Ye material that these little pavers are set in, is a floor of lime and sand, and not plaster as many are, which floor is so rotten with time, that one may easily take up ye little pavers, some whole flowers of which I intend to take up whole, and send to Hatfield, if it be possible.’</p>

Asset/Event Number	78
Asset/Event Name	Exposure of a kiln structure, South Street, 1961-62
Type of Site	Recorded Observation
Listing No./NRHE Number	
HER Number	ELS3787
Status	Event
Easting	492060
Northing	416960
Parish	
Council	North Lincolnshire
Description	<p>OS field investigator, April 1964: A Mr. P. Dawson made the finds of 1961/62; he indicated the spot at SE 9206 1696 and said that the material consisted of Roman brick, fragmentary pottery and burnt earth spread over an area of 3-4 square feet at an approx. depth of 18"; the material was not dated by an authority and was later reburied in refuse</p>

Asset/Event Number	79
Asset/Event Name	Rescue excavation for pipeline trench excavation, Sawcliffe DMV
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS3819
Status	Event
Easting	490920
Northing	414469
Parish	
Council	North Lincolnshire
Description	Rescue excavation on a strip of land withing the SAM of Sawcliffe. A pipeline trench was cut and recorded. Archive location is unkown but the finds were deposited with the Humberside Archaeology Unit and are now within Scunthorpe Museum. Location details from Keith Miller suggesting that the land strip occurred in the same location where a forestry application was made.

Asset/Event Number	80
Asset/Event Name	Aerial photographic assessment and transcription
Type of Site	AERIAL PHOTOGRAPH INTERPRETATION
Listing No./NRHE Number	
HER Number	ELS3858
Status	Event
Easting	491155
Northing	416260
Parish	
Council	North Lincolnshire
Description	Assessment of 2 Kevin Leahy AP slides, taken in 1996. A scan of one slide was rectified using Aerial 5.12, using 5 control points. Accuraccy within Aerial was high, with a maximum 1.6m error. Image was georeferenced to OS MasterMap using 4 control points, maximum error was 3 pixels. All cropmark features were transcribed directly to table Cmsketchplots.tab, copied to Cropmarks.tab. The second slide (11 7/96 F 021) showed 1 simple cropmark, sketch plotted to Cmsketchplots.tab.

Asset/Event Number	81
Asset/Event Name	Air photography
Type of Site	Air photography
Listing No./NRHE Number	
HER Number	ELS3893
Status	Event
Easting	491865

Northing	414463
Parish	
Council	North Lincolnshire
Description	Centre point within 1km study area recorded
	136 digital aerial photographs, taken by Chris Cole during a flight from North Moor airfield. Photos taken at Flixborough, Normanby, Alkborough, Whitton, Winteringham, Roxby, Appleby, Horkstow, Saxby All Saints, South Ferriby, Barton upon Humber. A Canon G1X 14Mpx large sensor camera was used. *NB images are for the use of NLHER only. Requests for other uses to be directed to Innervations.*

Asset/Event Number	82
Asset/Event Name	Fieldwalking, West Field, High Risby
Type of Site	UNSYSTEMATIC FIELDWALKING SURVEY
Listing No./NRHE Number	
HER Number	ELS4068
Status	Event
Easting	491718
Northing	415108
Parish	
Council	North Lincolnshire
Description	Solo? Fieldwalking by ME Knowles, date unknown. Worked flint, Greenstone axe fragment, Roman high status sherds including a face pot fragment, Med & PM pottery. Collection donated to NLM.

Asset/Event Number	83
Asset/Event Name	Aerial photographic assessment and transcription
Type of Site	AERIAL PHOTOGRAPH INTERPRETATION
Listing No./NRHE Number	
HER Number	ELS4227
Status	Event
Easting	492195
Northing	416822
Parish	
Council	North Lincolnshire
Description	Assessment of DN Riley aerial photo, south of Roxby. Print enhanced within Photoshop, resulting image rectified within Aerial 5, maximum control point error 3m. Resulting image georeferenced within Mapinfo, maximum control point error 3 pixels. All cropmark features then transcribed directly to Cropmarks.tab, copied to Cmsketchplots.tab

Asset/Event Number	84
---------------------------	----

Asset/Event Name	Aerial photographic assessment and transcription
Type of Site	AERIAL PHOTOGRAPH INTERPRETATION
Listing No./NRHE Number	
HER Number	ELS4228
Status	Event
Easting	491642
Northing	416098
Parish	
Council	North Lincolnshire
Description	Assessment of DN Riley aerial photo, south of Roxby. Print enhanced within Photoshop, resulting image rectified within Aerial 5, maximum control point error 3m. Resulting image georeferenced within Mapinfo, maximum control point error 3 pixels. All cropmark features then transcribed directly to Cropmarks.tab, copied to Cmsketchplots.tab

Asset/Event Number	85
Asset/Event Name	Trial Trenching, Land off Old Hall Road, Roxby, 2019
Type of Site	TRIAL TRENCH
Listing No./NRHE Number	
HER Number	ELS4393
Status	Event
Easting	492302
Northing	416960
Parish	
Council	North Lincolnshire
Description	<p>An archaeological evaluation comprising the excavation of four trenches was undertaken in connection with a proposed residential development. Due to the presence of a narrow strip of land protected under the countryside stewardship scheme, Trench 4 and the northern half of Trench 2 could not be excavated. Trench 3 was also moved 4m south to avoid casting spoil in the protected land. All work was undertaken in accordance with accepted professional standards and guidelines (Historic England 2008; Clfa 2014), in accordance with the ASWYAS site recording manual (ASWYAS 2011) and in compliance with the WSI. All trenches were set out and the limits resurveyed using a Trimble VRS differential GPS accurate to +/-0.01cm. The trenches were opened in a controlled manner using a JCB using a flat-bladed ditching bucket under direct archaeological supervision. All topsoil deposits were removed in level spits (not more than 0.20m) with the topsoil and subsoil being separated to allow for re-instating in reverse order. Machining stopped at the first archaeological horizon or natural deposits, whichever was encountered first. All excavations of archaeological deposits were undertaken manually with the stripped surface being cleaned and investigated for archaeological remains. An appropriate sample was excavated through all archaeological features with at least a 10% sample through linear features (with a minimum sample of 1m) and a 50% sample through discrete features. These were undertaken to investigate the full depth, profile and fills, where possible, and to recover dating evidence from the fills. All excavated sections were, where possible, located adjacent to the trench edge in order to provide a full stratigraphic sequence. A soil sampling programme was undertaken consisting of bulk soil samples for the identification of plant macro-fossils, small animal bones and other small artefacts. All samples were taken from appropriate archaeological deposits, in accordance with the WSI and Historic England guidelines. All archaeological features were accurately recorded in plan at a scale of 1:20 or 1:50. Feature sections were drawn at a scale of 1:10 or 1:20. All plans and sections</p>

include spot heights that relate to Ordnance Datum in metres. A full written, drawn and photographic record was made of all archaeological work undertaken. Encountered within the trenches were multiple ditches and several small pits. All features were sealed by a friable, mid-brown sandy clay topsoil (000) and a firm, midbrown-yellow sandy clay subsoil (001). The underlying geology comprised light brownyellow firm sandy clay with small sub-rounded gravel inclusions (002).

Asset/Event Number	86
Asset/Event Name	Excavations at Roxby Roman Villa, North Lincolnshire, 1989
Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS44
Status	Event
Easting	492005
Northing	416954
Parish	
Council	North Lincolnshire
Description	Excavation of two trenches at Roxby Roman Villa, in advance of re-development. The trenches were machine excavated. Trench 1 was 1.5m wide at the west end, expanding to approximately 2m wide at the east end, and 17m long. Trench 2 ran away from the centre of trench 1 and was 1.5m wide and 13.5m long. The mosaics revealed were dated to between 350 - 370 AD.

Asset/Event Number	87
Asset/Event Name	Photographic Record, Barns at Old Hall Lane, Roxby, 2019
Type of Site	PHOTOGRAPHIC RECORDING
Listing No./NRHE Number	
HER Number	ELS4409
Status	Event
Easting	492338
Northing	417016
Parish	
Council	North Lincolnshire
Description	Basic photographic record of two barns, one to be converted to residential use, the second in semi-derelict state at the time of survey, to be demolished. Digital photographic record of external and internal elevations, windows and doors, and fixtures and fittings; no measuring scale used. No archive.

Asset/Event Number	88
Asset/Event Name	Geophysical survey, Winterton Road, Scunthorpe 2020
Type of Site	MAGNETOMETRY SURVEY

Listing No./NRHE Number**HER Number** ELS4425**Status** Event**Easting** 490755**Northing** 414559**Parish****Council** North Lincolnshire**Description**

A fluxgate gradiometer survey was undertaken along a proposed water pipeline route comprising c.2.18ha of land. The geophysical survey comprised hand-carried GNSS-positioned fluxgate gradiometer survey. In the south of the survey area c.0.5ha could not be surveyed due to the presence of overgrown vegetation. The magnetic data were collected using MS' bespoke hand-carried GNSS-positioned system. MS' hand-carried system was comprised of four Bartington Instruments Grad 13 Digital Three-Axis Gradiometers. Positional referencing was through a multichannel, multi-constellation GNSS Smart Antenna RTK GPS outputting in NMEA mode to ensure high positional accuracy of collected measurements. The RTK GPS is accurate to 0.008m + 1ppm in the horizontal and 0.015m + 1ppm in the vertical. Magnetic and GPS data were stored on an SD card within MS' bespoke datalogger. The datalogger was continuously synced, via an in-field Wi-Fi unit, to servers within MS' offices. This allowed for data collection, processing and visualisation to be monitored in real-time as fieldwork was ongoing. A navigation system was integrated with the RTK GPS, which was used to guide the surveyor. Data were collected by traversing the survey area along the longest possible lines, ensuring efficient collection and processing. Magnetic data were processed in bespoke in-house software produced by MS. The geophysical survey has detected a range of different types of anomalies of modern, agricultural and undetermined origin. Modern activity is present in the form of a service line which runs the length of the survey area, this may have obscured any weaker anomalies in the vicinity (should any have been present). The majority of anomalies identified were classified as "Undetermined" in origin due to the lack of context provided by the narrow survey corridor and the impact of magnetic disturbance produced by the service line. Whether the undetermined anomalies have natural, or possible archaeological provenance related to the undated cropmarks and nearby scheduled monument is not possible to say through the scope of this survey alone. Agricultural activity has been detected in the form of weak linear anomalies which correspond with the ploughing direction at the time of survey.

Asset/Event Number 89**Asset/Event Name** Winterton Road Growth, Scheme, Scunthorpe, Lincolnshire, Heritage Impact Assessment**Type of Site** DESK BASED ASSESSMENT**Listing No./NRHE Number****HER Number** ELS4478**Status** Event**Easting** 490643**Northing** 414446**Parish****Council** North Lincolnshire**Description**

Oxford Archaeology were commissioned by Anglian Water to prepare a heritage impact assessment for a new 3.6km pipeline to the north of Scunthorpe. This involved a 250m search area around the eastern section, as requested by the Historic Environment Officer, which was used to identify designated and non-designated heritage assets which could be affected by the proposed scheme. The assessment was informed through both a desk-based review and a site

visit. The following sources were consulted to inform this assessment: - The National Heritage List for England (NHLE) for designated heritage assets; - North Lincolnshire Historic Environment Record (NLHER) for non-designated heritage assets, archaeological events, National Mapping Programme (NMP) data and the location of modern ironstone quarry; - Groundsure Mapping for Historic Ordnance Survey Maps; - LiDAR data as held by the Environment Agency; - Geotechnical data as held by the client and the British Geological Survey; and - Other relevant primary and secondary sources including published and unpublished works as held by OA and relevant libraries. A walkover survey of the eastern part of the proposed scheme was carried out in February 2020 to assess the current character and condition of the site and inform the assessment of previous impacts. This section of the proposed scheme is 1450m in length and is situated between the railway line and the Sawcliffe Reservoir. The full length of this section was visited apart from approximately 270m at the western end which is directly to the east of the railway. No new archaeological features were identified during the visit. The proposed scheme for a new 3.6km pipeline is situated to the north of Scunthorpe and extends from Cupola Road in the west to Sawcliffe Reservoir in the east. It crosses a landscape that has produced evidence of human activity from the prehistoric period through to the present day although it has also been extensively quarried for the extraction of ironstone during the twentieth century. The western end of the proposed scheme crosses areas of former opencast mining and ground that has been previously disturbed. The North Lincolnshire Historic Environment Officer has agreed that there will not be any archaeological implications in this part of the scheme. The eastern section of the proposed scheme has largely avoided quarrying apart from a small area adjacent to the railway line to the west of Dragonby. This section crosses fields which have been in agricultural use since the post-medieval period and possibly earlier. Other than historic episodes of cultivation which are likely to have had a limited impact upon archaeological remains it is anticipated that archaeological remains if present are likely to have survived. This section of the proposed scheme lies in an area that has produced a large quantity of prehistoric finds, including a recorded scatter of Neolithic and Bronze Age flintwork and is close to an Iron Age and Romano-British settlement although no prehistoric or Romano-British features have as yet been recorded within the study area. The focus of the settlement is to the south of Dragonby and it is unlikely that it extends as far as the proposed scheme. The pipeline does pass through the hinterland of the settlement and as such it is possible that archaeological remains of this date could be present. The proposed pipeline also passes close to the deserted medieval village of Sawcliffe which is now a scheduled monument. The extent of this settlement is covered by the scheduled area and it is unlikely that remains of the village will be present within the footprint of the proposed scheme. It is however possible that medieval or postmedieval agricultural remains could be present. In addition, the eastern section of the proposed scheme crosses two areas of cropmarks which have been interpreted by the NLHER as relatively recent field boundaries. However, these features do not appear on historic Ordnance Survey maps and could be older. Overall this study has identified no over-riding archaeological constraints which are likely to prohibit development or result in significant alteration to the route of the eastern section of the pipeline.

Asset/Event Number	90
Asset/Event Name	Archaeological Trial Trench Evaluation, Land off Winterton Road, Scunthorpe, North Lincolnshir
Type of Site	TRIAL TRENCH
Listing No./NRHE Number	
HER Number	ELS4479
Status	Event
Easting	490573
Northing	414394
Parish	
Council	North Lincolnshire

Description

Trent & Peak Archaeology were commissioned by Anglian Water to undertake archaeological evaluation along the linear route of a new water pipeline crossing land off Winterton Road, Scunthorpe, North Lincolnshire. The features identified by the previous geophysical survey were targeted by trial trench evaluation in order to investigate the site's archaeological potential, this comprised Stage 2 of the works. The trial trenching evaluation consisted of six trenches (initially intended to be eight trenches, but Trench 6 could not be excavated due to location beneath overhead lines and Trenches 2 and 3 were amalgamated due to overhead power line running across Trench 2) measuring 50m x 1.8m. Trench 4 was shortened to avoid blocking a public footpath. The trenches were located to investigate geophysical anomalies detected by the geophysical survey of the site (Swinbank 2020). While being targeted on anomalies, seemingly blank areas were also included to test the geophysical survey results and gain a representative sample of the archaeology across the site. This was especially the case for Trench 1 as the dense vegetation made geophysical survey impossible. The trenches were located using a Leica CS15GS15 RTK Differential GNSS prior to excavation. The area of each Trench was scanned with a CAT Scanner before any breaking of ground in order to locate any services not shown on the service plan supplied by the client, this CAT scan resulted in the rotation and movement, approximately 4m south-east of Trench 1 as it was too close to the current water main. All machine excavation was undertaken using a 360o tracked excavator fitted with a toothless ditching bucket under constant archaeological supervision. Topsoil and subsoil were excavated in spits no greater than 200mm and were stored separately to allow for reinstatement. The trenches were excavated to the top of the first archaeological horizon, or to natural geological deposits if these were encountered first, with spoil stored at a safe distance from the trench edge and checked for artefacts. All identified archaeological features were hand-cleaned. Features were sample excavated to a degree sufficient to determine their plan and form, and to recover any datable artefacts. The fills of archaeological features were removed by contextual change (the smallest usefully definable unit of stratification) and/or in spits no greater than 100mm. Substantial features were hand excavated to a maximum depth of 1.2m, or a perceived safe depth if the sides were unstable. Overall, the key result of this trial Trench excavation was that the area had high archaeological potential, especially at the crest of the hill.

Asset/Event Number	91
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS799
Status	Event
Easting	492150
Northing	414850
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPH: CUAC. 1967. ATS 75. (SLS1040)

Asset/Event Number	92
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS802

Status	Event
Easting	492150
Northing	414850
Parish	
Council	North Lincolnshire
Description	

Asset/Event Number	93
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS833
Status	Event
Easting	490550
Northing	413950
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPH: DN Riley. 1983. SE9013/29. (SLS1082) AERIAL PHOTOGRAPH: DN Riley. 1983. SE9013/28. (SLS1081) AERIAL PHOTOGRAPH: DN Riley. 1983. SE9013/30. (SLS1077)

Asset/Event Number	94
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS888
Status	Event
Easting	492229
Northing	415760
Parish	
Council	North Lincolnshire
Description	Approximate location given within the 1km study area AERIAL PHOTOGRAPH: RAF. 1994. 06154:33ZJUL 94. (SLS1070) AERIAL PHOTOGRAPH: RAF. 1994. 061515:02Z JUL94. (SLS547) AERIAL PHOTOGRAPH: RAF. 1994. 061515:02ZJUL94. (SLS546) AERIAL PHOTOGRAPH: RAF. 1994. 061514:08ZJUL94. (SLS532) AERIAL PHOTOGRAPH: RAF. 1994. 06154:08ZJUL94. (SLS531)

Asset/Event Number	95
--------------------	----

Asset/Event Name Aerial photographic sortie
Type of Site AERIAL PHOTOGRAPHY
Listing No./NRHE Number
HER Number ELS893
Status Event
Easting 491550
Northing 414050
Parish
Council North Lincolnshire
Description AERIAL PHOTOGRAPH: RAF. 1947. CPE/UK/2042. (SLS1066)

Asset/Event Number 96
Asset/Event Name Aerial photographic sortie
Type of Site AERIAL PHOTOGRAPHY
Listing No./NRHE Number
HER Number ELS896
Status Event
Easting 490250
Northing 414250
Parish
Council North Lincolnshire
Description AERIAL PHOTOGRAPH: RCHM. 1975. SE9014/1. (SLS1057)

Asset/Event Number 97
Asset/Event Name Aerial photographic sortie, 1971
Type of Site AERIAL PHOTOGRAPHY
Listing No./NRHE Number
HER Number ELS903
Status Event
Easting 492448
Northing 416445
Parish
Council North Lincolnshire
Description AERIAL PHOTOGRAPHY

Asset/Event Number 98
Asset/Event Name Aerial photographic sortie

Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS928
Status	Event
Easting	491150
Northing	414650
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPH: CUAC. ?. AON 26. (SLS1044)

Asset/Event Number	99
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS937
Status	Event
Easting	491150
Northing	415450
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPH: K. Leahy. 1994. KAL 9115/1. (SLS1058)

Asset/Event Number	100
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS939
Status	Event
Easting	492350
Northing	415650
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPH: K. Leahy. 1994. KAL SE9215/2. (SLS1072) AERIAL PHOTOGRAPH: K. Leahy. 1994. KAL SE9215/1. (SLS1071)

Asset/Event Number	101
Asset/Event Name	Roxby double cemetery

Type of Site	EXCAVATION
Listing No./NRHE Number	
HER Number	ELS959
Status	Event
Easting	490958
Northing	415312
Parish	
Council	North Lincolnshire
Description	PUBLISHED MATERIAL: J Jones. Remains of leather or skin products preserved on an Anglo Saxon Shield from Sheffields Hill, North Lincolnshire. (SLS5047) PUBLISHED MATERIAL: Direct. 2002. Anglo-Saxon Roxby revealed. (SLS5049)

Asset/Event Number	102
Asset/Event Name	Pit alignment. RCHM plot
Type of Site	Pit alignment
Listing No./NRHE Number	
HER Number	ELS3234;MLS16919
Status	Non-designated Heritage Asset
Easting	492270
Northing	415568
Parish	
Council	North Lincolnshire
Description	Within the extent of Asset 176 but unknown exactly where

Asset/Event Number	103
Asset/Event Name	CURVILINEAR DITCH
Type of Site	DITCH (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS20808
Status	Non-designated Heritage Asset
Easting	491620
Northing	417080
Parish	
Council	North Lincolnshire
Description	A length of curvilinear ditch, visible as a cropmark on an aerial photograph taken in 1971 A series of four curvilinear ditches on two alignments, three are clustered in the north east of the site and the other to the south west. The longest ditch (NGR SE915170) which is the singular, measures approx 72m long and is

aligned north west - south east.

The second on the same alignment is the northern most of the cluster. This cropmark is more rectangular than the others and measures approx 38m.

The other two ditches are aligned north east - south east. The larger of the two measuring approx 72m and the smaller 35m.

Asset/Event Number	104
Asset/Event Name	TRACKWAYS AND CIRCULAR FEATURES (CM),
Type of Site	ROAD (PU, Unknown date)
Listing No./NRHE Number	
HER Number	ELS3236; MLS10108
Status	Non-designated Heritage Asset
Easting	491012
Northing	415467
Parish	
Council	North Lincolnshire
Description	An aerial photograph taken in 1994 shows possible trackways and circular cropmarks. One SW-NE length of track, one curving SE-NW track, two circular features. [1] Also visible on a 1971 air photograph (Riley 26/R 28 26.07.1971) MLS10728.

Asset/Event Number	105
Asset/Event Name	LINEAR CROPMARK
Type of Site	TRACKWAY? (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS20809
Status	Non-designated Heritage Asset
Easting	491580
Northing	415790
Parish	
Council	North Lincolnshire
Description	Cropmark of a former trackway or watercourse, visible on an aerial photograph taken in 1947 A single cropmark line running roughly north west - south east for approx 650m. The original aerial photograph is not held in the HER. [1] This cropmark is visible but indistinct on an air photograph taken in June 1971. [2]

Asset/Event Number	106
Asset/Event Name	RECTANGULAR ENCLOSURE

Type of Site	ENCLOSURE (PU, Unknown date)
Listing No./NRHE Number	
HER Number	19313 - MLS19313
Status	Non-designated Heritage Asset
Easting	491840
Northing	415370
Parish	
Council	North Lincolnshire
Description	Vertical photograph shows an earthwork enclosure or field boundary on the same alignment as the modern drain. Centred to SE918153. (1)

Asset/Event Number	107
Asset/Event Name	High Risby DMV
Type of Site	DESERTED SETTLEMENT (MED, Medieval - 1066 AD to 1539 AD)
Listing No./NRHE Number	
HER Number	MLS1989
Status	Non-designated Heritage Asset
Easting	492060
Northing	414840
Parish	
Council	North Lincolnshire
Description	<p>High Risby or Great Risby was formerly a villata and a parish in its own right. It later became a hamlet within the parish of Roxby. Vicars were instituted at the church of St Bartholomew until 1631, but by 1662 the vicarage had been united to the parish of Roxby. The fragmentary earthworks of domestic enclosures, centred to SE92161485, were surveyed by an Ordnance Survey field inspector in 1962. The maximum height of the banks was 1.0m. Adjacent areas of former earthworks were under the plough at that time. [1, 2'] Site of High (Great) Risby DMV, mentioned in DB. Last institution at St. Bartholomew's Church in 1631. Church site at SE 919 147, walls remain up to 1.5m. high, chancel more prominent than nave, churchyard flat, the wall survives to 0.8m. high, now ploughed around. Masonry, bases and fragments of pillars exposed during excavations by Rev. B K Selby (late 19th cent.?). Some DMV earthworks S of trackway at SE 921 048, toft boundaries, no house-sites visible, area 2ha. To N cropmarks on AP show roads, toft boundaries and house sites, area 4ha. (GCK obl. 1967; SM, RX/08). Med. pottery including Stamford and shelly wares, early post-med. wares, from ploughsoil, 1965 (AN 1965, 51). [3] Aerial photographs. Those dated 1956 - 58 show clear earthwork remains of the village, including individual building sites. Those from 1967 show that the northern section of the earthworks had been ploughed out by that date. [4-9] A copy of a 1993 BA (Hons) essay by NR Wilkyn entitled 'Deserted and shrunken villages in Lincolnshire and a study of Risby' is held in the HER dissertations/projects file. [10] The remaining village earthworks at High Risby were assessed for scheduling by English Heritage in 1998. The report noted that the earthworks that survived ploughing in the 1960s had been further reduced by ploughing and earthmoving. 'The surviving earthworks consist of a section of hollow way and three small banked enclosures with no visible evidence of internal features. It is estimated to represent at most 10% of the original extent of the village.' The scheduled earthworks of the church site were confirmed as of national importance, but scheduling was not recommended for the remaining village earthworks. [11]</p>

Asset/Event Number	108
Asset/Event Name	OLD FIELD BOUNDARIES, N OF DRAGONBY (CM)
Type of Site	BOUNDARY (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS10868
Status	Non-designated Heritage Asset
Easting	490400
Northing	414300
Parish	
Council	North Lincolnshire
Description	<p>Old field boundaries, north of Dragonby (cropmark)</p> <p>A series of rectilinear earthworks were photographed from the air, 1947. Field boundaries. ? [1] An aerial photograph taken in 1975 showed that the area had been ploughed, but the boundaries were visible as cropmarks. [2] Aerial photographs, June 1987. [3, 4]</p>

Asset/Event Number	109
Asset/Event Name	CROPMARKS, DRAGONBY
Type of Site	ENCLOSURE (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS19311
Status	Non-designated Heritage Asset
Easting	490740
Northing	414540
Parish	
Council	North Lincolnshire
Description	<p>Cropmark enclosures north east of Dragonby village.</p> <p>Vague cropmarks centred to SE90651445 appear to show at least two conjoined rectangular enclosures. They may be of the same character as SMR 10868, and therefore relatively recent. [1] North/south aligned cropmarks centred to SE90791445. One possible ovoid enclosure. [2]</p>

Asset/Event Number	110
Asset/Event Name	LINEAR CROPMARKS, DRAGONBY
Type of Site	DITCH (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS21054
Status	Non-designated Heritage Asset

Easting	490700
Northing	414130
Parish	
Council	North Lincolnshire
Description	Two parallel linear cropmarks, east of Dragonby, plotted from an unknown aerial photograph. Date uncertain. Two parallel ditches measuring approx 93 and 103m. They are on a northnorthwest-southsoutheast alignment. [1,2]

Asset/Event Number	111
Asset/Event Name	OPEN FIELD SYSTEM, ROXBY CUM RISBY
Type of Site	OPEN FIELD (MED, Medieval - 1066 AD to 1539 AD); RIDGE AND FURROW (MED, Medieval - 106
Listing No./NRHE Number	
HER Number	MLS21294
Status	Non-designated Heritage Asset
Easting	491843
Northing	414885
Parish	
Council	North Lincolnshire
Description	A partially ploughed-out headland or hollow way in area SE925169 was visible on air photographs, taken in April 1984. [1, 2]

Asset/Event Number	112
Asset/Event Name	RECTILINEAR ENCLOSURES
Type of Site	ENCLOSURE (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS19625
Status	Non-designated Heritage Asset
Easting	491100
Northing	414200
Parish	
Council	North Lincolnshire
Description	SE910141 Rectilinear; fragments of enclosures ?, including scatter of Pits ? at SE91251422. Ridge summit; aspect, all. Source : DNR SE9114/3-4, 21.06.1975. (1,2)

Asset/Event Number	113
Asset/Event Name	LINEAR DITCH

Type of Site	DITCH (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS20659
Status	Non-designated Heritage Asset
Easting	491790
Northing	416940
Parish	
Council	North Lincolnshire
Description	<p>A linear cropmark in visible on air photographs taken in 1998</p> <p>SE91791694 A 170m long linear cropmark, defined by a substantial ditch. Possible boundary of Prehistoric or Roman date.</p> <p>Source : NMR SE 9116/5 (17140/20) 24-JUL-1998 [1, 2]</p>

Asset/Event Number	114
Asset/Event Name	TRACKWAY & DITCHES (CM), W OF SOUTH
Type of Site	DITCH (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS15185
Status	Non-designated Heritage Asset
Easting	491600
Northing	416600
Parish	
Council	North Lincolnshire
Description	<p>Trackway & ditches (cropmark), west of South Street</p> <p>Cropmarks, plotted from an unknown photograph at Scunthorpe Museum in the 1970s. A double ditched trackway that has the appearance of a westerly continuation of South Street, 340m in length. Possible boundary ditches to the north. [1, 2]</p> <p>Oblique aerial photograph. A curvilinear crop mark and other trackways and ditches are visible. [3]</p> <p>A vertical aerial photograph taken in 1947 shows the features as described in Ref 1 above. A distinct rectangular area with a curved NW corner is enclosed an area to the west of Brackenholmes Road. [4]</p>

Asset/Event Number	115
Asset/Event Name	CROPMARKS, WEST OF WINTERTON ROAD
Type of Site	DITCH (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS21055
Status	Non-designated Heritage Asset
Easting	491360

Northing	416310
Parish	
Council	North Lincolnshire
Description	A faint and diffuse linear ditch, visible on an air photograph taken in 1971. It is east- west and measures approx 83m. Indications of a possible joining ditch on a southeast-northwest alignment.

Asset/Event Number	116
Asset/Event Name	LINEAR CROPMARKS
Type of Site	LINEAR FEATURE (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS1999
Status	Non-designated Heritage Asset
Easting	492200
Northing	416300
Parish	
Council	North Lincolnshire
Description	SE922 164 (centre). Cropmark site, linear feature running ENE-WSW, 70-80m. long at SE 921 164, indications of short lines joining at right-angles - field system? Further indeterminate features. (DNR obl. 1971; SM, RX/04) [1, 2] Aerial photograph. [3]

Asset/Event Number	117
Asset/Event Name	LINEAR CROPMARK
Type of Site	LINEAR FEATURE (PU, Unknown date)
Listing No./NRHE Number	
HER Number	MLS2001
Status	Non-designated Heritage Asset
Easting	492200
Northing	416100
Parish	
Council	North Lincolnshire
Description	SE921 161 Cropmark site, short length of double parallel lines running NNE-SSW (DNR obl. 1971; SM, RX/04). [1, 2] Aerial photographs [3 - 5]

Asset/Event Number	118
Asset/Event Name	CROPMARKS, SOUTH EAST OF SAWCLIFFE
Type of Site	DITCH (PU, Unknown date)

Listing No./NRHE Number**HER Number** MLS21182**Status** Non-designated Heritage Asset**Easting** 491440**Northing** 414250**Parish****Council** North Lincolnshire

Description Fragmentary cropmarks of unknown date were visible on Google Maps AP coverage in 2009. The most prominent feature was a crescent-shaped feature, 30m across, centred to SE9145414268. A possible ovoid mark immediately to the north west of this, but very fragmentary. A series of generally north-south linear ditches were visible either side of the crescent. The cropmarks did not have the appearance of a settlement site of any period. They may have been associated with a warren ?

Asset/Event Number 119**Asset/Event Name** MEDIEVAL TRACKWAY, A1077 -**Type of Site** TRACKWAY (MED?, Medieval - 1066 AD? to 1539 AD?)**Listing No./NRHE Number****HER Number** MLS22401**Status** Non-designated Heritage Asset**Easting** 490977**Northing** 415176**Parish****Council** North Lincolnshire

Description A former routeway is visible as a cropmark on air photographs, linking the A1077 Winterton Road with Brackenholmes Road, via High Risby. The western end of the route, at the junction with the A1077, is still extant as an unnamed track that gives access to the Sawcliffe Reservoir. From SE91501485 it continues as a broad cropmark within arable fields, continuing on a WNW - ESE alignment. It merges with the western boundary of the former church of St Bartholomew at SE91831470, becoming invisible within pasture and gardens at High Risby. The cropmark continues through arable fields between SE92071461 and SE92881439, where it intersects with Brackenholmes Road. A possible medieval routeway, given the close association with the medieval church and village at High Risby. [1] The Ordnance Survey 2" surveyor's drawing of 1819 shows the western section as a double pecked line between the Winterton Road and the church of St Bartholomew. The eastern part is not shown. [2] The trackway was visible on air photographs taken in April 1984. [3, 4] Broad, diffuse soilmarks were visible on air photographs taken in March 1976. The alignment of the trackway could be seen to continue north-westwards beyond the A1077, meeting Sheffield's Plantation in area SE90931520. It continued through the plantation as a slight earthwork, intersecting with the railway line in area SE90671540. [5 - 7] Aerial photographs, June 1971. The trackway shows as a faint cropmark.

Asset/Event Number 120**Asset/Event Name** ENCLOSURES, FOLLY FIELD**Type of Site** ENCLOSURE (RO?, Roman - 43 AD? to 409 AD?)

Listing No./NRHE Number

HER Number ELS3858; MLS22578
Status Non-designated Heritage Asset
Easting 491100
Northing 416200
Parish
Council North Lincolnshire

Description

At least two faint cropmark enclosures, visible on an air photograph taken in 1996. One is centred to SE91201630, and measures c. 52m by 32m. Defined by a single ditch, its long axis is on a NW-SE orientation. There are indications of a similarly sized enclosure c. 15m to the NW, and a possible trackway on the S side. At least 5 dark, circular pit features up to 2m in diameter are visible at the eastern end of the enclosure, both inside and outside the ditch. A 28m length ditch fragment to the NE, on a SW-NE orientation, appears to be part of the same complex. A second enclosure c. 115m to the SW is on a similar alignment, and measures c. 47m by 28m. There may be further cropmark features continuing to the SE into 'Sand Field'. All these cropmarks are dark, positive marks. There are many more light coloured negative marks in the same field, with the appearance of irregular conjoined enclosures. They may be of archaeological origin, but are more likely to be geological in origin.

Asset/Event Number 121
Asset/Event Name ENCLOSURE FRAGMENT, SAND FIELD
Type of Site RECTANGULAR ENCLOSURE (PU, Unknown date)

Listing No./NRHE Number

HER Number MLS22579
Status Non-designated Heritage Asset
Easting 491040
Northing 415950
Parish
Council North Lincolnshire

Description

Two linear cropmark ditches, probably part of a rectangular enclosure, were photographed from the air in 1996. The enclosure ditches measure c. 92m by 56m. Both ditches are roughly parallel to modern field boundaries, so may be of relatively recent origin.

Asset/Event Number 122
Asset/Event Name Aerial photographic assessment & transcription
Type of Site AERIAL PHOTOGRAPH INTERPRETATION

Listing No./NRHE Number

HER Number ELS4107
Status Event
Easting 490001
Northing 414283
Parish

Council	North Lincolnshire
Description	Centre point recorded as 489000, 410000- moved within the 1km study area Assessment and transcription of b/w vertical aerial photographs in the Development Management collection, primarily from CUAC and Meridian Airmaps surveys. These images can be georeferenced to an accuracy of c.10 pixels without preliminary rectification. Cropmark/soilmark features then transcribed directly to Cropmarks.TAB and copied to Cmsketchplots.TAB

Asset/Event Number	123
Asset/Event Name	JURASSIC WAY PREHIS TRACKWAY (PRE:IA/RO) - CONJECTURAL EVIDENCE
Type of Site	TRACKWAY (PRE:IA/RO, Early Neolithic to Roman - 4000 BC to 409 AD)
Listing No./NRHE Number	
HER Number	MLS20003
Status	Non-designated Heritage Asset
Easting	491323
Northing	416201
Parish	
Council	North Lincolnshire
Description	<p>Jeffrey May described the route of the Jurassic Way in 1976: 'The possible line of the Jurassic Way can be traced for eighty kilometres south from the Humber, despite the fact that no clear proof, in the form of road metalling, timber track or worn surface, has been, or is ever likely to be recovered. Considerable lengths of modern road, including B1398 and A607, follow a sinuous line along the well-marked crest of the limestone scarp. These roads were certainly in use during the medieval period, and one kind of traffic carried by the stretch between Lincoln and Ancaster is suggested by the use of the name 'Pottergate' along its various parts. Yet the road does not link the local medieval and Anglo-Saxon villages. These generally lie on the spring lines below the limestone crest, and are connected to the Jurassic Way by their own short individual link roads. Lanes linking these villages, and obviously developed to meet their needs, straggle along the low ground at the foot of the scarp to the west. Such general considerations as these suggest a pre-medieval date for the Jurassic Way as a whole. Some confirmation of this conclusion is to be seen north of Kirton in Lindsey, where the road coincides with the boundaries of several Anglo-Saxon parishes, which presumably were set out along an already existing line. Yet the presence of the Roman Ermine Street following the same direction between one and three kilometres to the east, together with the sinuous line of the modern road, shows that the Jurassic Way was not part of the Roman military road system, even though it may have functioned in that period, and we therefore may infer a pre-Roman origin. When the Jurassic Way first came into use, we have no means of knowing, and it is quite possible that the route was already ancient in the Iron Age.' [1] HE Dudley, writing in 1949, named this prehistoric routeway as 'Middle Street'. Moving north from Kirton and Manton, he conjectured that it passed through Raventhorpe and Manby, '..at which point it is now lost, although the former continuation of the road, passing Gokewell and High Santon, is shown on old Lincolnshire maps such as those of Andrew Armitage (1794), John Cary (1801) and the Tower Map of 1824. From Low Santon, a sandy bridle road leads northwards across the Risby Warren to a point between Low and High Risby. This passage across the Warren is known to older local residents as the Burton-Brigg road, being part of the ancient road which gave communication between the markets of Brigg and Burton upon Stather, and mentioned by Abraham de la Pryme in 1697. A continuation of the road passes to Brackenholmes and Roxby, at which the Middle Street becomes once more a good highway to Winterton, Winterringham and the Humber. ' In a later chapter 'The Romans and Middle Street', Dudley links the Romano-British sites at Santon, Risby Warren, Roxby, Winterton, Northlands and</p>

Winteringham to continued use of this routeway. [2] Hollow ways to the north and south of Ravensthorpe DMV, plotted from air photographs in 2005, are on the same alignment as Dudley's 'Middle Street' route. [3] Note that the linear trackways which are components of HER 7205 and HER 18471 are on the same alignment as Dudley's proposed route, but c. 800m to the east. [4] The route between Manton and Roxby, as described in Ref. 2 (above) is shown on Armstrong's map of Lincolnshire, published in 1778. It passes through 'Ravensthorpe', 'Manby', through a plantation east of 'Gowk Hill', to 'H Santon', then between 'H Riseby' and 'L Riseby' to Roxby.

Asset/Event Number	124
Asset/Event Name	SUB-RECTANGULAR ENCLOSURE & FIELD
Type of Site	ENCLOSURE (PRE:IA/RO, Middle Iron Age to Roman - 400 BC to 300 AD)
Listing No./NRHE Number	
HER Number	MLS2002
Status	Non-designated Heritage Asset
Easting	492464
Northing	416751
Parish	
Council	North Lincolnshire
Description	SE927 166 (centre). Cropmark site, sub-rectangular enclosure, c. 70m. by c. 50m., aligned NNE-SSW with indications of internal features, surrounded by linear features aligned NNW-SSE/ENE-WSW, probable field systems, some of which bisect the enclosure. E portion of a rectilinear enclosure with entrance in E side at SE 926 168. Cropmarks extend into fields on N and E sides, area c. 30ha. It seems likely that features extend W towards site at SE 922 164. (DNR obl. 1971; SM, RX/03; AN 1971, 13).

Asset/Event Number	125
Asset/Event Name	POSSIBLE FIELD SYSTEM (CM)
Type of Site	FIELD SYSTEM (PRE:IA/RO, Late Iron Age to Roman - 100 BC to 409 AD)
Listing No./NRHE Number	
HER Number	MLS2003
Status	Non-designated Heritage Asset
Easting	492200
Northing	416800
Parish	
Council	North Lincolnshire
Description	SE922 168 (centre). Cropmark site, in field bordering S side of Roxby village, N of sites centred on SE 927 166, above. Linear features - probable field systems, area c. 2ha. (DNR obl. 1971; SM, RX/05).

Asset/Event Number	126
Asset/Event Name	RB OCCUPATION, W OF BRACKENHOLMES

Type of Site	ENCLOSURE (RO, Roman - 43 AD to 409 AD); OCCUPATION SITE (RO, Roman - 43 AD to 409 AD)
Listing No./NRHE Number	
HER Number	ELS4107; MLS2000
Status	Non-designated Heritage Asset
Easting	491700
Northing	416100
Parish	
Council	North Lincolnshire
Description	<p>SE915 160 - SE 920 162. Cropmark site, linear feature running ENE-WSW for c. 500m., eastern portion flanked by field boundaries/ enclosures with a group at SE 920 162. At W end, centred on SE 915 160, more regular rectilinear features, some small, - enclosures or buildings? Features are on similar alignment to major ENE-WSW feature. Area extends over 6ha. (DNR obl. 1971-2; SM, RX/02). [1] Aerial photographs [2-4] Fieldwalking was carried out by Humberside Archaeology Unit in 1982, targeting the cropmarks. Many greyware sherds were recorded in the western margin of the field, along with rubble spreads, possible slag, and tile. [5, 6] SE915 160 - SE920 162. Linear cropmark running ENE-WSW for c500m. The eastern portion is flanked by field boundaries/enclosures. At the west end there are more regular rectilinear features, some small - possible enclosures or buildings. Source : Loughlin & Miller, 1979. [7] Aerial photograph, June 1971. The main linear trackway was clearly visible. Enclosures to the north and south were fragmentary, apart from several small enclosures c. 10m wide immediately south of the trackway in area SE91591602. [8, 9]</p>

Asset/Event Number	127
Asset/Event Name	DBA, Rainham Steel, Scunthorpe 2008
Type of Site	Desk Based Assessment
Listing No./NRHE Number	
HER Number	ELS2902
Status	Event
Easting	490387
Northing	414128
Parish	
Council	North Lincolnshire
Description	No further information recorded by the HER

Asset/Event Number	128
Asset/Event Name	Wind Energy Project, Winterton Wind Farm
Type of Site	Desk Based Assessment

Listing No./NRHE Number

HER Number ELS3900

Status Event

Easting 491022

Northing 415824

Parish

Council North Lincolnshire

Description No further information recorded by the HER
Centre point recorded where it includes the Site

Asset/Event Number 129

Asset/Event Name Normanby Park Steelworks - Assessment of potential

Type of Site Desk Based Assessment

Listing No./NRHE Number

HER Number LS1982

Status Event

Easting 490099

Northing 414624

Parish

Council North Lincolnshire

Description No further information recorded by the HER

Asset/Event Number 130

Asset/Event Name Conesby Quarry Phase III Landfill Proposal

Type of Site Desk Based Assessment

Listing No./NRHE Number

HER Number LS1981

Status Event

Easting 490309

Northing 415164

Parish

Council North Lincolnshire

Description No further information recorded by the HER

Asset/Event Number 131

Asset/Event Name Conesby Farm, Normanby Road, Scunthorpe

Type of Site	Desk Based Assessment
Listing No./NRHE Number	
HER Number	ELS4150; SLS6951
Status	Event
Easting	490901
Northing	414949
Parish	
Council	North Lincolnshire
Description	Centre point recorded where it extended into the Site

Asset/Event Number	132
Asset/Event Name	Conesby Farm, Normanby Road, Scunthorpe
Type of Site	Desk Based Assessment
Listing No./NRHE Number	
HER Number	ELS4179; SLS7018
Status	Event
Easting	490170
Northing	414307
Parish	
Council	North Lincolnshire
Description	Centre point recorded where it extended into the 1km study area

Asset/Event Number	133
Asset/Event Name	Winterton Road Growth, Scheme, Scunthorpe, Lincoln
Type of Site	Desk Based Assessment
Listing No./NRHE Number	
HER Number	ELS4478
Status	Event
Easting	491043
Northing	414922
Parish	
Council	North Lincolnshire
Description	Centre point recorded where it extended into the site

Asset/Event Number	134
Asset/Event Name	PM SETTLEMENT, DRAGONBY
Type of Site	SETTLEMENT (PM)

Listing No./NRHE Number**HER Number** MLS10059**Status** Non-designated Heritage Asset**Easting** 490400**Northing** 414000**Parish****Council** North Lincolnshire**Description** Dragonby village was established c.1910 on Elwes land, as a settlement for mainly Roman Catholic steelworkers. The name was invented by Lady Winifrede Elwes, named after the 'Dragon' geological outcrop.

Asset/Event Number 136**Asset/Event Name** MEDIEVAL POTTERY, MANOR HOUSE AREA, 1983, 1986**Type of Site** FINDSPOT (MED/PM)**Listing No./NRHE Number****HER Number** MLS10329**Status** Non-designated Heritage Asset**Easting** 491700**Northing** 416800**Parish****Council** North Lincolnshire**Description** North Lincolnshire Museum hold a 'large collection' of medieval sherds from solo fieldwalking in Manor House Field in 1983. They have not been processed or closely identified. Accession SMAG:10.4.1985/1, Site code RXHF. [1, 2] Another fieldwalking exercise took place in 1986 in the field to the north of the A1077. Only small amounts of pottery were found, mostly post-medieval. 2 sherds may have been medieval. A single flint and animal bone of unknown date was also collected.

Asset/Event Number 137**Asset/Event Name** NEOLITHIC POTTERY**Type of Site** FINDSPOT (PRE:NEO)**Listing No./NRHE Number****HER Number** MLS10397**Status** Non-designated Heritage Asset**Easting** 490800**Northing** 416300**Parish****Council** North Lincolnshire**Description** 3 Late Neolithic sherds were donated to Scunthorpe Museum in 1980: Grooved Ware rim sherd. Accession: SMAG:19.12.1980/2. Site Code RXWQ 1 Mortlake Ware sherd. Accession: SMAG:19.12.1980/3. Site Code RXWQ 2 Mortlake Ware sherd. Accession: SMAG:19.12.1980/4.

Site Code RXWQ 3. Findspot SE908 163.

Asset/Event Number	138
Asset/Event Name	MEDIEVAL SHERD, NORTH STREET
Type of Site	FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS10636
Status	Non-designated Heritage Asset
Easting	492170
Northing	417080
Parish	
Council	North Lincolnshire
Description	A medieval sherd, type not recorded, was found in the garden of No. 31 North Street, Roxby. Donated to North Lincolnshire Museum, Site code RXVE.

Asset/Event Number	139
Asset/Event Name	MELON BEAD & TILES, ROXBY GRAVEYARD
Type of Site	FINDSPOT (RO)
Listing No./NRHE Number	
HER Number	MLS10637
Status	Non-designated Heritage Asset
Easting	492070
Northing	417040
Parish	
Council	North Lincolnshire
Description	Items donated to North Lincolnshire Museum by the same donor : Roman melon bead. Site code: RXWM 1 'Flue tiles'. Site code: RX (incomplete on database) Findspot : Roxby graveyard. Note that the tiles have a specific recorded grid reference of SE92191703, which is 120m east of the graveyard.

Asset/Event Number	140
Asset/Event Name	RB POTTERY & WALL PLASTER, 1 EAST STREET
Type of Site	FINDSPOT (RO); FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS10638
Status	Non-designated Heritage Asset
Easting	492154
Northing	417045

Parish**Council** North Lincolnshire**Description** Romano-British finds from Roxby donated to North Lincolnshire Museum in 1978: Greyware sherds. Accession: SMAG:1978.020. Site code: RXVP 1 Romano-British wall plaster fragment. Accession: SMAG:1978.020. Site code: RXVP 2. Findspot: Gas trench outside No. 1, East Street.

Asset/Event Number 141**Asset/Event Name** RB-POST MEDIEVAL SHERDS, 42 SOUTH STREET**Type of Site** FINDSPOT (RO); FINDSPOT (MED/PM)**Listing No./NRHE Number****HER Number** MLS10639**Status** Non-designated Heritage Asset**Easting** 492157**Northing** 416946**Parish****Council** North Lincolnshire**Description** Donated to North Lincolnshire Museum from the garden of 42 South Street, 1983 and 1991 : Roman coarseware sherds. Accession: SMAG:1991.444.001. Site code: RXWO 1 Medieval sherds. Accession: SMAG:1991.444.002. Site code: RXWO 2 Medieval sherds. Accession: SMAG:4.1.1983/6. Site code: RXWO 3 Roman sherds. Accession: SMAG:4.1.1983/6. Site code: RXWO 3 Post-medieval sherds. Accession: SMAG:4.1.1983/6. Site code: RXWO 3 [

Asset/Event Number 142**Asset/Event Name** BRONZE BLADE FRAGMENT**Type of Site** FINDSPOT (PRE:BA?)**Listing No./NRHE Number****HER Number** MLS10640**Status** Non-designated Heritage Asset**Easting** 491400**Northing** 416700**Parish****Council** North Lincolnshire**Description** A copper alloy blade fragment, described as an 'odd form'. Accession: SMAG:19.12.1980/8. Site code: RXWP.

Asset/Event Number 143**Asset/Event Name** RB-POST MEDIEVAL POTTERY, NORTH STREET, ROXBY**Type of Site** FINDSPOT (RO); FINDSPOT (MED/PM)**Listing No./NRHE Number**

HER Number	MLS10641
Status	Non-designated Heritage Asset
Easting	491980
Northing	416950
Parish	
Council	North Lincolnshire
Description	3 sherds, donated to North Lincolnshire Museum. Findspot SE91981695, 'Foundations of a house on North Street'. Roman sherd. Site code: RXVN 1 Medieval sherd: RXVN 2 Post-medieval sherd: RXVN 3.

Asset/Event Number	144
Asset/Event Name	RB & MEDIEVAL SHERDS, 27 NORTH STREET
Type of Site	FINDSPOT (R0); FINDSPOT (MED/PM)
Listing No./NRHE Number	
HER Number	MLS10642
Status	Non-designated Heritage Asset
Easting	492150
Northing	417080
Parish	
Council	North Lincolnshire
Description	Found in the garden of No. 27 North Street, donated to North Lincolnshire Museum : Romano-British greyware sherd. Site code: RXVO 2 Medieval sherds. Site code: RXVO 1.

Asset/Event Number	145
Asset/Event Name	POST MEDIEVAL POTTERY, 35 NORTH STREET
Type of Site	FINDSPOT (PM)
Listing No./NRHE Number	
HER Number	MLS10643
Status	Non-designated Heritage Asset
Easting	492230
Northing	417110
Parish	
Council	North Lincolnshire
Description	An unknown quantity was found in the garden of No 35 North Street, Roxby, and donated to North Lincolnshire Museum. Site code: RXVB 1.

Asset/Event Number	147
Asset/Event Name	ANGLO SAXON CEMETERY, BAGMOOR, 1928

Type of Site	CREMATION CEMETERY (EMED:AS:C15,C6); INHUMATION CEMETERY
Listing No./NRHE Number	
HER Number	MLS1082
Status	Non-designated Heritage Asset
Easting	490500
Northing	417100
Parish	
Council	North Lincolnshire
Description	SE905 171. AS cemetery found 1928, "many" cremation urns and "several skeletons" found. An iron axe (Dudley 1949, 226, fig. 81, no. 2) and 2 plain urns (Dudley, 1949, 225-6, fig. 80, 2-3) were recovered. Both urns contained cremations, and one a glass bead necklace, remains of an ivory armband found in larger urn; SM, BS BF. (Dudley 1949, 225-6, figs. 81-2; Myres 1951, 96, 2; Meaney 1964, 152). [1] Gazetteer entry. [2] The North Lincolnshire Museum accession database has an 8-figure grid reference for the findspot, SE90441712. [3] The surviving urns from this cemetery date from the 5th to 6th century. A 5th century date seems likely for the iron axe (francisca) found on the site. [4]

Asset/Event Number	148
Asset/Event Name	ANGLO-SAXON URN, BAGMOOR
Type of Site	FINDSPOT (EMED:AS)
Listing No./NRHE Number	
HER Number	MLS1083
Status	Non-designated Heritage Asset
Easting	490100
Northing	415800
Parish	
Council	North Lincolnshire
Description	SE901 158 (area). AS cinerary urn from a "low mound" in W Face Mine. Wide-mouthed urn decorated with seven grooves around neck, contents removed by finder. (Dudley 1949, 226, fig. 80, 1; Myres 1951, 76, 3, 97. 7, fig. 3.3; Meaney 1964, 154- 5). [1] A findspot at SE899 159 is listed in the North Lincolnshire Museum accession database. [2]

Asset/Event Number	149
Asset/Event Name	OLD FIELD BOUNDARIES, N OF DRAGONBY (CM)
Type of Site	BOUNDARY (PU)
Listing No./NRHE Number	
HER Number	MLS10868
Status	Non-designated Heritage Asset
Easting	490440
Northing	414371
Parish	

Council	North Lincolnshire
Description	A series of rectilinear earthworks were photographed from the air, 1947. Field boundaries. ? [1] An aerial photograph taken in 1975 showed that the area had been ploughed, but the boundaries were visible as cropmarks.

Asset/Event Number	150
Asset/Event Name	STONE AXE FRAGMENT
Type of Site	FINDSPOT (PRE:NEO)
Listing No./NRHE Number	
HER Number	MLS1100
Status	Non-designated Heritage Asset
Easting	490700
Northing	416400
Parish	
Council	North Lincolnshire
Description	Ground stone axe fragment, butt broken, Group VI coarse, section no. 249; SM, BS BG. [1]

Asset/Event Number	151
Asset/Event Name	POLISHED STONE AXE
Type of Site	FINDSPOT (PRE:NEO)
Listing No./NRHE Number	
HER Number	MLS1101
Status	Non-designated Heritage Asset
Easting	490630
Northing	416830
Parish	
Council	North Lincolnshire
Description	Polished stone axe, dolerite, section no. 144; SM, BS BE. [1]

Asset/Event Number	152
Asset/Event Name	EXTENSIVE PREHISTORIC OCCUPATION, NW OF BAGMOOR FARM
Type of Site	SETTLEMENT (PRE:MES,NEO,BA); OCCUPATION SITE (PRE:MES,NEO,BA)
Listing No./NRHE Number	
HER Number	MLS1111
Status	Non-designated Heritage Asset
Easting	490400
Northing	416400

Parish**Council** North Lincolnshire**Description** Extensive prehistoric occupation is evidenced by the profusion of finds from Bagmoor [See also SK 81 NE 5] Cores and flakes; arrowheads including tangless with long single barb and transverse; flint pick; axes; plough stones; bronze spear heads; food vessels, cinerary urn, etc., found. Find locations were recorded by CW Phillips (Ordnance Survey) and Harold Dudley (Scunthorpe, later North Lincolnshire Museum). A vast amount of the Bagmoor material is held by North Lincolnshire Museum. In 1964, 'representative' collections were also held by Lincoln, Newark, Hull and Gainsborough Museums. [1 - 3] Gazetteer entry. [4]

Asset/Event Number 153**Asset/Event Name** TWO ROMAN BRONZE FIGURINES, DRAGONBY**Type of Site** FINDSPOT (RO)**Listing No./NRHE Number****HER Number** MLS11695**Status** Non-designated Heritage Asset**Easting** 490626**Northing** 413889**Parish****Council** North Lincolnshire**Description** Two figurines of Mars, found by different metal detectorists in the early 1970s. The findspot is described as '...a ploughed field where the centre of the Roman settlement might be expected.' They may have been related to a temple or shrine. Both are in the collections of North Lincolnshire Museum. One represents Mars Gravidus, wearing a Corinthian helmet. 8cm tall, but limbs incomplete. NLM code CRDR 215 The other represents a version of Mars Ultor. 9.8cm tall, complete apart from the left hand. Dressed in military uniform, but with a Celtic tunic. The rendering of the uniform and the 'Celticised' facial features suggest that this may have represented a local warrior god. NLM Code CRDR 214

Asset/Event Number 154**Asset/Event Name** BA FOOD VESSELS, NW OF BAGMOOR FARM, 1938**Type of Site** FINDSPOT (PRE:BA)**Listing No./NRHE Number****HER Number** MLS14091**Status** Non-designated Heritage Asset**Easting** 490100**Northing** 416520**Parish****Council** North Lincolnshire**Description** Food Vessel, "Yorkshire" type with pierced lugs, found in mine, 1938. A smaller Food Vessel was found within a few feet of the first. (Dudley 1949, 65, fig. 23, 4-5).

Asset/Event Number	155
Asset/Event Name	SOCKETED SPEARHEADS, BAGMOOR
Type of Site	FINDSPOT (PRE:BA)
Listing No./NRHE Number	
HER Number	MLS14092
Status	Non-designated Heritage Asset
Easting	490300
Northing	416400
Parish	
Council	North Lincolnshire
Description	Two bronze socketed spearheads, the smaller with a socketed gauge inside, found whilst digging potato clamp on Bagmoor Farm; SM, BS BU 1-3. (Davey 1973, 94 nos. 351-3).

Asset/Event Number	156
Asset/Event Name	BA FOOD VESSEL, SW OF BAGMOOR FARM
Type of Site	FINDSPOT (PRE:BA)
Listing No./NRHE Number	
HER Number	MLS14093
Status	Non-designated Heritage Asset
Easting	490300
Northing	416100
Parish	
Council	North Lincolnshire
Description	Food Vessel, "Yorkshire" type, found in ironstone quarry (Dudley 1949, 65, fig. 23, 3).

Asset/Event Number	157
Asset/Event Name	TRACKWAY & DITCHES (CM), W OF SOUTH STREET
Type of Site	ROAD (PU); DITCH (PU)
Listing No./NRHE Number	
HER Number	MLS15185
Status	Non-designated Heritage Asset
Easting	491672
Northing	416683
Parish	
Council	North Lincolnshire
Description	Cropmarks, plotted from an unknown photograph at Scunthorpe Museum in the 1970s. A double ditched trackway that has the appearance of a westerly continuation of South Street, 340m in length. Possible boundary ditches to the north. [1, 2] Oblique aerial photograph. A curvilinear crop mark and other trackways and ditches are visible. [3] A vertical aerial photograph taken in 1947 shows the features as described in Ref 1 above. A distinct

rectangular area with a curved NW corner is enclosed an area to the west of Brackenholmes Road.

Asset/Event Number	158
Asset/Event Name	FLINT, BRONZE AGE URN FRAGMENT, SHEFFIELD'S HILL `1'
Type of Site	FINDSPOT (PRE:NEO,BA)
Listing No./NRHE Number	
HER Number	MLS15614
Status	Non-designated Heritage Asset
Easting	490900
Northing	414800
Parish	
Council	North Lincolnshire
Description	Extract from a journal entry dated 20th December 1948: 'At Armstrong's site in S.H. 1 (Sheffield's Hill) I found very little as it had just been ploughed, but I made a systematic search. All the flints I found are only scraps, and the only good flint from this site is one Mr Dent gave me. I did find a bit of Bronze Age cinerary urn here though, bearing 'thumb nail' incisions on the rim.' [1] Armstrong's Mesolithic site was located at SE907149. Arrand's Field SH 1 was probably the one centred to SE909148.

Asset/Event Number	159
Asset/Event Name	ANGLO SAXON CEMETERY
Type of Site	INHUMATION CEMETERY (EMED:AS:C6,C7)
Listing No./NRHE Number	
HER Number	MLS15987
Status	Non-designated Heritage Asset
Easting	490948
Northing	415320
Parish	
Council	North Lincolnshire
Description	<p>In 1990, local metal detector users found two gold and garnet pendants and several beads on the ground surface at Sheffield's Hill near Roxby. An evaluation by the then Scunthorpe Museum demonstrated that an Anglo-Saxon cemetery was being damaged by ploughing and rabbit activity. Over five seasons, the cemetery was completely excavated by museum staff and volunteers.</p> <p>In most cases, the highly acidic sandy soil had dissolved the skeletons, leaving only pseudomorphs of the bodies. Dark stains indicated the presence of coffins, and traces of tree branches showed that the graves had been covered. Some organic remains were preserved by metal corrosion products, including textiles, wood and leather.</p> <p>As work progressed it became clear that there were two distinct cemeteries, Cemetery 1 (6th century) and 10 metres south,</p>

Cemetery II (7th century). Aerial photographic evidence shows that a boundary on the same alignment existed on the eastern side of the field.

In Cemetery I, the burials had no consistent alignment. They were accompanied by grave goods such as brooches, sleeve clasps and beads. Two graves were surrounded by ring ditches. Two urned cremations were present in this earlier cemetery.

Cemetery II was typical of the final phase of pagan Anglo-Saxon burial. Christian influences were apparent - the graves were aligned west - east and are arranged in rows. Graves goods were few or absent, the exception being a small (perhaps a family) group of rich burials with gold pendants, and two males with pattern welded swords. No evidence was found for buildings, but the quantity of pottery on the site suggests that the settlement was not far away. [1]

Site visit sheet dated 25.08.1993. [2]

Press cutting dated 16.10.1998 [3]

An article in Archaeological Leather Group Newsletter about the shield boss and mounts found in grave 115. [5]

Aerial photographs of the cemetery area, 1994 and 1996. Geological cropmarks only. [6 - 8]
Transcription and reinterpretation of these aerial photographs in 2020 for publication (in prep) of the cemetery excavations suggest they form a rectilinear field system of probable Romano-British date. [9, 10]

Asset/Event Number	160
Asset/Event Name	WW II ARMY CAMP (SITE OF), DRAGONBY
Type of Site	ARMY CAMP (PM:C20:1940)
Listing No./NRHE Number	
HER Number	MLS16578
Status	Non-designated Heritage Asset
Easting	490590
Northing	414130
Parish	
Council	North Lincolnshire
Description	This site was listed in a desk-based assessment carried out by Pre-Construct Archaeology in 2008. No additional information. [1] During construction of a pipeline in 1994, a local landowner was contacted. He stated that the concrete base of a cookhouse (closest to the present path), a concrete slab on brick footings for a shed, and brick footings for two Nissen huts were still visible. Near the Nissen huts was a local command post. The camp was established for troops returned from Dunkirk. Tents were also pitched on "the green" (when written a bungalow had just been constructed on the site). A linear earthwork bank was not related to the military occupation; it was produced by gardening and clearance of the area it encloses.

Asset/Event Number	161
Asset/Event Name	HORSE GIN (SITE OF), ROXBY
Type of Site	HORSE ENGINE (PM)
Listing No./NRHE Number	

HER Number	MLS17292
Status	Non-designated Heritage Asset
Easting	492009
Northing	416832
Parish	
Council	North Lincolnshire
Description	A full survey of a horse engine house was carried out prior to demolition, 1976. It was an open sided structure, built onto the side of an existing barn. Four rough stone piers supported a pantiled roof. The remaining machinery was a bearing point on the main roof beam, two gear wheels and a drive shaft that passed through the barn wall. A chaff-cutter remained inside the barn, but other crop-processing machinery would also have been driven by it.

Asset/Event Number	162
Asset/Event Name	NORTH LINDSEY LIGHT RAILWAY (SITE OF)
Type of Site	RAILWAY (PM:C20); GUN EMPLACEMENT (PM:C20)
Listing No./NRHE Number	
HER Number	MLS17658
Status	Non-designated Heritage Asset
Easting	490692
Northing	417030
Parish	
Council	North Lincolnshire
Description	<p>In 1896 Parliament passed an Act allowing the construction of what were termed "light railways", for the purpose of developing agricultural areas. The act made the procedure for constructing such railways quicker and cheaper than before and made provisions for these lines, if and when laid, to be operated under less stringent conditions, but with a lower speed limit. This act stimulated the local farming community along with the local ironstone interests, and at a meeting at Scunthorpe on Tuesday, 5th May, 1896 it was proposed that a line be applied for from Scunthorpe to Whitton via Winteringham, and connected at Winterton to Appleby. An application for such a Light Railway Order was filed in May, 1898 with the Light Railway Commissioners for the proposed railway. The Great Central Railway Company (formerly the Manchester Sheffield and Lincolnshire Railway) ran the NLLR from July 1907. Construction of the NLLR line did not begin until 1904 due to the difficulty of raising capital. The line was opened in stages with the advancement of construction. The section between Scunthorpe, Winterton and Thealby was opened for passengers and goods on Monday, 3rd September 1906, with a goods only service to West Halton from the same date. The service to Winteringham was started soon after on 15th July, 1907. The terminus at Whitton was ready for opening in the summer of 1910 but a service was not begun until 1st December. The passenger service on this line was only three trains per day, with none on Sundays, to Winteringham, and only two to Whitton. All passenger trains were third class. The service was on occasion reduced to only twice a day, for example during rail and coal strikes. The goods service however was very heavy for a "light" railway. The opening of John Lysaghts iron and steel works in 1912, the northwards expansion of ironstone mining along the NLLR and the agricultural traffic meant that the goods service timetable was relatively comprehensive. The stations of Winterton and Thealby, West Halton, Winteringham and Whitton were all served with a daily goods train (except Sundays) which brought in coal, seed, seed potatoes, etc., with outward traffic being of a similar farming nature. Cattle docks were also provided at these stations. This traffic was added to by the transport of slag and cement (for the Humber Bank improvements and Rosyth Naval Harbour in Scotland) from the iron and steel works in Scunthorpe out of Winteringham Haven wharf. Bagged cement, bricks, etc., from the cement</p>

and brick works at South Ferriby were taken down the NLLR to Scunthorpe on the return journey. The wharf at Winteringham Haven was at the end of a short spur with siding accommodation for wagon storage and two wagon tippler chutes for transferring goods to river vessels. Other items such as parcels, milk, etc. would be conveyed by passenger train. Passenger takings on the railway declined in the 1920s with the advent of motor bus services, and the passenger service on the railway ceased in 1925. The goods service, however, was maintained through to the Second World War. The goods facilities at Winteringham and Whitton closed in 1950. The line to Winterton kept working until the 1970s, when ironstone mining ceased. [1] A First World War vintage 12" railway howitzer was deployed on the railway line at Whitton Ness as part of coastal artillery defences, area SE915244. It had a range of 6-8 miles, and fired a 750 pound shell, with 120 degrees of traverse each way. A turntable loading platform included crew accommodation, and outriggers provided stability.

Asset/Event Number	163
Asset/Event Name	RING DITCH AND DITCHES (CM), N OF HIGH RISBY
Type of Site	RING DITCH (PRE:BA?)
Listing No./NRHE Number	
HER Number	MLS17805
Status	Non-designated Heritage Asset
Easting	492323
Northing	415591
Parish	
Council	North Lincolnshire
Description	Aerial photographs taken in 1994 show a circular feature, possibly a ring ditch, and other ditches. [1 - 5] The ring ditch was visible on air photographs taken in 2011. It was described as a 'small curvilinear enclosure, potentially a Neolithic or oval barrow'. Internal dimensions were estimated at 16m by 20m. Source photograph: NMR 28179_033, 1st July 2011.

Asset/Event Number	164
Asset/Event Name	PREHISTORIC FINDS, SHEFFIELD'S HILL
Type of Site	FINDSPOT (PRE:MES,NEO,BA)
Listing No./NRHE Number	
HER Number	MLS18084
Status	Non-designated Heritage Asset
Easting	491000
Northing	415100
Parish	
Council	North Lincolnshire
Description	Continuation of surface finds along Sheffield's Hill. "Many flint implements in these two fields, particularly along the western slope, where micro-burins, shouldered points, end scrapers etc. are frequent. Occasional Beaker sherds, frag. of flint dagger" (HED map note SM, 1950). "Beaker sherds have been found in a field opposite the Roxby reservoir, but only very occasionally" (Dudley 1949, 63). Clarke refers to Dudley's published note and includes as corpus no. 477F, "Roxby, Sheffield's Hill-Private-Indeterminate" (Clarke 1970, 487). Non-geometric and geometric microliths, micro-burins, notched flakes, scrapers, cores, serrated

flake, leaf-shaped arrowheads and fragments, plough-stones, plain prehistoric sherds, finger-nail impressed rimsherd, cord-impressed Beaker sherd, rim sherd with incised decoration - Beaker?; pp. & SM, RX SK.

Asset/Event Number	165
Asset/Event Name	FLINT ARROWHEAD, W OF SAWCLIFFE DMV
Type of Site	FINDSPOT (PRE:NEO?)
Listing No./NRHE Number	
HER Number	MLS18085
Status	Non-designated Heritage Asset
Easting	490850
Northing	414450
Parish	
Council	North Lincolnshire
Description	SE90851445. A large barbed and tanged flint arrowhead, found c. 1950. [1] This arrowhead is in the North Lincolnshire Museum collections, code RXSD 2.

Asset/Event Number	166
Asset/Event Name	MICROLITHIC SITE, N OF DRAGONBY
Type of Site	OCCUPATION SITE (PRE:MES)
Listing No./NRHE Number	
HER Number	MLS18086
Status	Non-designated Heritage Asset
Easting	490220
Northing	414420
Parish	
Council	North Lincolnshire
Description	Area centred SE90221442. A small microlithic site in a sandy hollow. The implements included good scalene triangles. Identified at some time before 1949, by 1964 it was a small area of cultivation on the very edge of an ironworks.

Asset/Event Number	167
Asset/Event Name	`RB FINDS', 3 EAST STREET
Type of Site	FINDSPOT (RO)
Listing No./NRHE Number	
HER Number	MLS18366
Status	Non-designated Heritage Asset
Easting	492190
Northing	417030

Parish**Council** North Lincolnshire**Description** SE92191703. 'Roxby. RB finds.' [1] Roman tiles and a melon bead from this grid reference are listed on the North Lincolnshire Museum accession database, code RX (incomplete). However, the findspot is given as the churchyard, 120m to the west.

Asset/Event Number 168**Asset/Event Name** HORNSTONE AXE FRAGMENT**Type of Site** FINDSPOT (PRE)**Listing No./NRHE Number****HER Number** MLS1898**Status** Non-designated Heritage Asset**Easting** 490190**Northing** 414130**Parish****Council** North Lincolnshire**Description** The butt end of a hornstone axe, 2 1/2 inches long, recorded at SE90191413. An Ordnance Survey field inspector visited the findspot in 1964, when it was under the plough. [1] AAF16 - Butt end of a stone axe. Hornstone. Section 235, Group VI fine. Findspot: Dragonby Brickworks, 1909-12. [2]

Asset/Event Number 169**Asset/Event Name** SOCKETED AXE, S OF BAGMOOR LANE**Type of Site** FINDSPOT (PRE:BA)**Listing No./NRHE Number****HER Number** MLS19301**Status** Non-designated Heritage Asset**Easting** 490000**Northing** 416000**Parish****Council** North Lincolnshire**Description** SE900 1660 approx., Bagmoor. A bronze socketed axe was discovered after ploughing on land to the south of Bagmoor Lane. This area has been quarried out for ironstone, and now restored to agricultural use. In Scunthorpe Museum, BSBA .

Asset/Event Number 170**Asset/Event Name** DRAINAGE DITCHES, SAWCLIFFE**Type of Site** DITCH (PU)**Listing No./NRHE Number**

HER Number	MLS19312
Status	Non-designated Heritage Asset
Easting	491529
Northing	414416
Parish	
Council	North Lincolnshire
Description	Sharply defined ditches visible on vertical photograph, centred to SE915144. They may be former watercourses which conjoin to form the appearance of an ovoid enclosure. [1] On a photograph from April 1984, there is a single ditch crossing the field, leading into the pond at SE91641436. A north south branch meets the main ditch at SE91591440. Both ditches are surrounded by darker areas suggesting flood deposits.

Asset/Event Number	171
Asset/Event Name	PIT ALIGNMENT
Type of Site	PIT ALIGNMENT (PRE:IA?)
Listing No./NRHE Number	
HER Number	MLS19619
Status	Non-designated Heritage Asset
Easting	491718
Northing	417073
Parish	
Council	North Lincolnshire
Description	SE917170 Pit alignment, orientation approx NW-SE. Interrupted by two breaks. Longest stretch 14+ pits. Features at SE end less certain. Running obliquely to parish boundary c.0.6km to the N. Sited below crest of ridge on lower ground, in dip of the dip slope. Ploughed out ridge and furrow and headlands ? showing immediately to S. Also curvilinear feature in corner (SE) of field. Sources : CACAP BUR43, 46 11.08.1975, DNR SE9117/18 03.07.1976.

Asset/Event Number	172
Asset/Event Name	RECTILINEAR ENCLOSURES
Type of Site	ENCLOSURE (PU)
Listing No./NRHE Number	
HER Number	MLS19625
Status	Non-designated Heritage Asset
Easting	491144
Northing	414206
Parish	
Council	North Lincolnshire
Description	SE910141 Rectilinear; fragments of enclosures ?, including scatter of Pits ? at SE91251422. Ridge summit; aspect, all. Source : DNR SE9114/3-4, 21.06.1975.

Asset/Event Number	173
Asset/Event Name	ANTI-AIRCRAFT BATTERY AND BARRACKS, SAWCLIFFE
Type of Site	HEAVY ANTI AIRCRAFT BATTERY (PM:C20); MILITARY CAMP (PM:C20); SQUATTER SETTLEMENT
Listing No./NRHE Number	
HER Number	MLS19666
Status	Non-designated Heritage Asset
Easting	491232
Northing	414913
Parish	
Council	North Lincolnshire
Description	<p>Site of a Heavy Anti-Aircraft Battery, equipped with four 3.7 inch static guns and a GL Mark 1A radar set. The battery has been assessed for the Monuments Protection Programme. In a report dated 28 July 2000, the MPP Archaeologist listed extensive damage to the surviving elements, including complete demolition of the south east emplacement, damage to the north western emplacement, and the adaptation of the command post for use as a piggery. A corrugated iron Nissen hut survived largely intact. No further scheduling action was taken. The report includes a colour copy of an oblique aerial photograph, and ground photographs. [1] Post-war Ordnance Survey 6" maps show the barracks, but not the battery itself. There were at least 18 huts in the military camp, located immediately south of a reservoir. [2] A single roofed Nissen hut centred to SE91171490 survived on the site in 2013, depicted on Ordnance Survey MasterMap. The bases of several other structures were also depicted. [3] Aerial photograph, taken April 1984. [4] The military Nissen huts were occupied by squatters in the immediate post-war period, c.1946-48. This was in response to the housing shortage caused by wartime bombing. The camp at Sawcliffe was apparently filmed as part of a newsreel report on the squatter movement.</p>

Asset/Event Number	174
Asset/Event Name	MEDIEVAL WATERMILL (SITE OF)
Type of Site	WATERMILL; WINDMILL?
Listing No./NRHE Number	
HER Number	MLS19670
Status	Non-designated Heritage Asset
Easting	490011
Northing	414757
Parish	
Council	North Lincolnshire
Description	<p>Only a few field names (for Sawcliffe) appear in published early records.. (in) 1265 a watermill is mentioned, and in 1267 there is a several (enclosed) pasture called Milncroft (mill close). Although the existence of ponds, etc. on the (Sawcliffe) DMV site may have been partly for a mill, a better site is shown on the 1797 estate map, where the westernmost salient of the manor is a c. 10 acre enclosure called Mill Close, which is probably the earlier milncroft, and must have evolved into the windmill noted in c. 1600. The 'fall' of Mill Close from the cliff towards Normanby would have been more suitable for a watermill site, and early district maps show becks there, which may have provided the incoming water.</p>

Asset/Event Number	175
Asset/Event Name	MEDIEVAL SHERDS FROM VILLAGE GARDEN, 1970
Type of Site	FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS1983
Status	Non-designated Heritage Asset
Easting	492000
Northing	416900
Parish	
Council	North Lincolnshire
Description	Medieval sherds, found in a village garden in 1970. Donated to Scunthorpe (North Lincolnshire) museum, code RXVD. [1]

Asset/Event Number	176
Asset/Event Name	MEDIEVAL POTTERY
Type of Site	FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS1984
Status	Non-designated Heritage Asset
Easting	491120
Northing	416740
Parish	
Council	North Lincolnshire
Description	Concentration of medieval sherds; SM, RX SN. (AN 1969, 5) [1, 2] SE91121674 Medieval sherds, site code RXSN 1. The findspot was 'North of lane to Bagmoor, large scatter concentrated at above NGR'. [3] The findspot is now within the Roxby refuse tip. [4]

Asset/Event Number	177
Asset/Event Name	LEAD SPINDLEWHORL
Type of Site	FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS1992
Status	Non-designated Heritage Asset
Easting	492040
Northing	416080
Parish	
Council	North Lincolnshire
Description	Lead weight or spindle-whorl; SM, RX WG. [1] The North Lincolnshire Museum accession database names this object as a spindle whorl, and lists the findspot as SE92041608, 'north

west of Brackenholmes Cottages'. [2]

Asset/Event Number	178
Asset/Event Name	BRONZE BELT TAG, E OF DRAGONBY
Type of Site	FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS1993
Status	Non-designated Heritage Asset
Easting	490980
Northing	414020
Parish	
Council	North Lincolnshire
Description	Med. bronze belt tag or chape, two riveted plates and damaged trefoil terminal, found 1969; SM RX SC. (AN 1969, 14). [1] This site was listed in a desk-based assessment carried out by Pre-Construct Archaeology in 2008. No additional information. [2]

Asset/Event Number	179
Asset/Event Name	LATE GLACIAL ENVIRONMENTAL SAMPLE
Type of Site	PALAEOLANDSCAPE (PRE:PAL)
Listing No./NRHE Number	
HER Number	MLS19934
Status	Non-designated Heritage Asset
Easting	490074
Northing	414567
Parish	
Council	North Lincolnshire
Description	Three environmental samples were taken from an organic layer revealed below wind-deposited sands during the extraction of sand and clays from the former ironstone quarry at Conesby Railway Sidings, 2003. A single sediment sample from a thin deposit of highly humified and silty peat was submitted for palaeoenvironmental analysis. Two subsamples from the top and base of the layer were also submitted for radiocarbon dating. These returned conventional radiocarbon ages of 11660 +/- 180 BP for the base of the layer, and 10950 +/- 100 BP for the top. This provides dating for a period of peat formation during an interstadial, when the climate was cold but not fully arctic. The landscape was a sedge-dominated wetland environment with grasses, herbs and some dwarf tree/shrub cover. This deposit was sealed beneath coversands following climatic deterioration. The material recovered from a 3 kg subsample was mostly quartz sand, with some granular organic matter, mainly small, rather strongly decayed wood fragments thought to be willow. Most of the rest of the material was well-humified silty peat. The range of pollen grains identified in samples from the base and top of the peat was small and dominated by that of sedges, which accounted for 85-90% of the samples. Other grains identified were wild grasses, birch, Scots' pine and parsley fern. There was also a small and generally poorly preserved, but distinctive, invertebrate fauna, typical of those from Late-Glacial tundra landscapes.

Asset/Event Number	180
Asset/Event Name	MESOLITHIC OCCUPATION, SHEFFIELD'S HILL
Type of Site	OCCUPATION SITE (PRE:MES,NEO,BA)
Listing No./NRHE Number	
HER Number	MLS1995
Status	Non-designated Heritage Asset
Easting	490780
Northing	414970
Parish	
Council	North Lincolnshire
Description	<p>Early-Late Mesolithic site, Sheffield's Hill, a saucer-shaped hollow in the brow of the escarpment investigated by A L Armstrong 1927-31. "The artifacts occur upon a floor lying upon the old land surface, at the base of the sand, the thickness of the covering varying from 6-9in." "Charcoal is present in scattered patches, also small fragments of partially dissolved bones. These appear to be bones of deer and small animals, but no identifiable fragments have been recovered" (Armstrong 1931, 33). Armstrong regarded the site as dating from the Upper Palaeolithic - "Here the latest phase of the Creswellian culture is seen, with the earliest Mesolithic super-imposed upon it" (Armstrong 1956, 97). More recently the stratigraphy recorded at Sheffield's Hill and the claims of stratigraphical relationships with an exposed section at Risby Warren have been doubted, and a post-glacial early Late Mesolithic date has been suggested. (Clarke 1932, 35, 93; Dudley 1949, 31-2, fig. 11; Buckland and Dolby 1973, 25; Mellars 1974, 90). Flints are dominated by non-geometric forms, obliquely-blunted points, (some with opposed retouch), end-scrapers on blades, chisel-ended or truncated flakes and blades, geometric microliths and possible tranchet axe sharpening flakes, later flints; SM, RX Sl. Armstrong collection bequeathed to BM, 1959; other flints in pp. Sheffield's Hill Site re-excavated 1970 by R Jacobi. Soil samples, flint microliths, flakes in SM, RX TA-TE. [1] Jeffrey May recorded that Armstrong's Mesolithic site on Sheffield's Hill was a saucer-shaped depression below the crest of the hill, 'roughly one hundred metres in diameter.' He quoted Armstrong: 'the artifacts occur upon a floor lying upon the old land surface, at the base of the sand, the thickness of the covering varying from six to nine inches.' Charcoal was present, although no hearths were found, and the partially dissolved bones of deer and other small animals indicated post-glacial fauna. The flint implements included backed blades, borers, scrapers, burins and microliths, including six geometric microliths. [2] Flint implements from the 5 trenches that Roger Jacobi excavated at Sheffield's Hill in 1970 are held at North Lincolnshire Museum under sitecodes RXTA, TXTB, RXTC, RXTD, RXTE. No other archive is listed on the accessions database. [3]</p>

Asset/Event Number	181
Asset/Event Name	OCCUPATION SITE, RYECLIFF FIELD
Type of Site	OCCUPATION SITE (PRE:PAL,NEO,BA)
Listing No./NRHE Number	
HER Number	MLS1997
Status	Non-designated Heritage Asset
Easting	491100
Northing	416600
Parish	
Council	North Lincolnshire

Description "Ryeclyffe Field". Surface finds concentrated on sandy crest of escarpment, - flint flakes, plough pebble, 1966; SM, RX RM. Palaeolithic flaked flint hand axe found 1971 at SE 9110 1673 (AN 1971, 4). Flint flakes - some retouched, backed blades, cores, scrapers, knife, barbed and tanged arrowhead, prehistoric sherd with incised decoration; SM, RXSN. Clarke records a fragmentary N2? Beaker from Roxby, Ryeclyffe, unpublished, as corpus no. 476 F; pp. (Clarke 1970, 487.). [

Asset/Event Number 182
Asset/Event Name OCCUPATION SITE, SANDS FIELD
Type of Site OCCUPATION SITE (PRE:MES,NEO/RO)
Listing No./NRHE Number
HER Number MLS1998
Status Non-designated Heritage Asset
Easting 491100
Northing 416060
Parish
Council North Lincolnshire
Description

SE911 161 (centre). "Sands Field". Flint microliths, microburins "particularly near brow of hill", obliquely-blunted points, scrapers, cores, flakes, plano-convex knife, tranchet arrowhead, plain prehistoric sherd, RB pottery, gritstone quern fragment, building stones brought to surface during deep-ploughing 1933, coin of Augustus and Agrippa c. 20 BC; SM, RX SF. (Dudley 1949, 40,140). [1]

Asset/Event Number 183
Asset/Event Name LINEAR CROPMARKS
Type of Site LINEAR FEATURE (PU)
Listing No./NRHE Number
HER Number MLS1999
Status Non-designated Heritage Asset
Easting 492255
Northing 416372
Parish
Council North Lincolnshire
Description

SE922 164 (centre). Cropmark site, linear feature running ENE-WSW, 70-80m. long at SE 921 164, indications of short lines joining at right-angles - field system? Further indeterminate features. (DNR obl. 1971; SM, RX/04)

Asset/Event Number 184
Asset/Event Name POSSIBLE FIELD SYSTEM (CM)
Type of Site FIELD SYSTEM (PRE:IA/RO)
Listing No./NRHE Number

HER Number	MLS2003
Status	Non-designated Heritage Asset
Easting	492213
Northing	416809
Parish	
Council	North Lincolnshire
Description	SE922 168 (centre). Cropmark site, in field bordering S side of Roxby village, N of sites centred on SE 927 166, above. Linear features - probable field systems, area c. 2ha. (DNR obl. 1971; SM, RX/05). [1, 2] Aerial photographs [3 - 7]

Asset/Event Number	185
Asset/Event Name	FIELD SYSTEM (CM)
Type of Site	FIELD SYSTEM (PU); ENCLOSURE (PU)
Listing No./NRHE Number	
HER Number	MLS2004
Status	Non-designated Heritage Asset
Easting	492269
Northing	417496
Parish	
Council	North Lincolnshire
Description	SE922 172 (centre). Cropmark site, fields between Roxby and Winterton villages, some appear to be field systems - others may be due to limestone cracking - could also apply to features S of Roxby village. (DNR obl. 1971-74; SM, RX/06). [1, 2] Aerial photographs [3-6] One of the DN Riley 1971 photographs was rectified and georeferenced for accurate cropmark plotting, 2015. The rectilinear field system was on a SW-NE orientation. A square enclosure measuring 40m across was centred to SE92511777, and had a noticeably different E-W orientation. It had the appearance of an Iron Age or Romano-British enclosure.

Asset/Event Number	186
Asset/Event Name	POSSIBLE ENCLOSURE (CM)
Type of Site	ENCLOSURE (PM?)
Listing No./NRHE Number	
HER Number	MLS2006
Status	Non-designated Heritage Asset
Easting	490024
Northing	414752
Parish	
Council	North Lincolnshire
Description	Former enclosure? A rectangular portion of Roxby parish protrudes W into Flixborough parish, the area is shown as an enclosure between Conesby and Flixborough Warrens on mid-18th cent. Normanby Estate Map. Area c. 200m. irregular square, now quarried. No finds recorded.

(EMAB 9, 1966, 27). [1] A mid 18th century Normanby estate map shows this area as an enclosure between Conesby and Flixborough warrens, and names it 'Mr Elwis's free Land.' It was originally c. 250 yards square. The area has now been quarried away for ironstone; no trace.

Asset/Event Number	187
Asset/Event Name	BRONZE AGE URNS, IRON AXES
Type of Site	FINDSPOT (PRE:BA)
Listing No./NRHE Number	
HER Number	MLS2007
Status	Non-designated Heritage Asset
Easting	490840
Northing	417020
Parish	
Council	North Lincolnshire
Description	Sherds from two collared urns with cord-impressed decoration - 1) biconical collared urn with twisted-cord trellis decoration on and above shoulder - collar restored by HM. 2) Sherd from larger urn, herringbone decorated ?collar. 3) Another small roughly made pot 2 1/4ins. high, "bucket" shape with expanded base. (Sheppard 1929, 13-15, illus.; Dudley 1931, fig. 19, 19a). [1] The Ordnance Survey record for these urns links them with 'two probably Danish iron axe-heads'; the source was an annotated 6" map compiled by CW Phillips in 1930. An Ordnance Survey field inspector was unable to locate these iron implements in any museum in 1964. By that time, the findspot was an open-cast quarry.

Asset/Event Number	188
Asset/Event Name	ROMAN POTTERY KILNS, E OF DRAGONBY, 1940
Type of Site	POTTERY KILN (RO)
Listing No./NRHE Number	
HER Number	MLS2010
Status	Non-designated Heritage Asset
Easting	490773
Northing	414008
Parish	
Council	North Lincolnshire
Description	Two RB kilns found 1940 in field to E of Dragonby "Money Field". Both kilns excavated by H E Dudley, 1940; one damaged, other well preserved with arched flue leading to circular oven. No pottery found in kilns, sherds of 2nd cent. pot found nearby. The better preserved kiln was covered and reburied (Dudley 1949, 191-2, figs. 66, 67). Cropmarks on APs show enclosures, continuation of road from Money Field and other indeterminate features in the triangular field between Winterton Road and the road to Dragonby village, centred on SE 907 140. Area 3 or more ha. (DNR obl. 1971; SM, CS/01). See also Scunthorpe District, Crosby, SE 905 138 (centre).

Asset/Event Number	189
---------------------------	-----

Asset/Event Name	POSSIBLE STONEPITS
Type of Site	QUARRY? (PU)
Listing No./NRHE Number	
HER Number	MLS2012
Status	Non-designated Heritage Asset
Easting	490845
Northing	414289
Parish	
Council	North Lincolnshire
Description	Series of hollows in field, limestone rubble around rims, dark silty filling, observed 1969 - stonepits? (SMI). [1] Archaeological observation and recording was carried out during the installation of a water pipeline in 1994. A bowl-shaped hollow c. 70m in diameter was noted to the west of the A1077, centred to SE90841429. It appeared to be a quarry pit, filled in during the 20th century, although medieval and post-medieval material was incorporated into its backfill.

Asset/Event Number	190
Asset/Event Name	PLOUGHSTONE
Type of Site	FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS2013
Status	Non-designated Heritage Asset
Easting	490900
Northing	413900
Parish	
Council	North Lincolnshire
Description	Ploughstone; SM, RX SE. [1] This find is labelled with the findspot: 'Field at top of hill above Dent's Cottage'. [2] This site was listed in a desk-based assessment carried out by Pre-Construct Archaeology in 2008. No additional information.

Asset/Event Number	191
Asset/Event Name	FLINT IMPLEMENTS, PLOUGHSTONES, RB SHERDS, 'FOLLY FIELD'
Type of Site	FINDSPOT (PRE:PAL,MES?/RO)
Listing No./NRHE Number	
HER Number	MLS2015
Status	Non-designated Heritage Asset
Easting	491240
Northing	416360
Parish	
Council	North Lincolnshire

Description "Folly Field". Flint flakes, scrapers, cores, plough pebble, RB sherds, blue glass bead; SM, RX SG. [

Asset/Event Number 192

Asset/Event Name ROMAN VILLA (SITE OF), NORTH STREET

Type of Site VILLA (RO:C3,C4); SETTLEMENT (RO:C3,C4); MOSAIC (RO:C3,C4)

Listing No./NRHE Number

HER Number MLS2016

Status Non-designated Heritage Asset

Easting 491991

Northing 416956

Parish

Council North Lincolnshire

Description RB building and mosaic pavements, Roxby village. Discovery of first pavement described by de la Pryme in 1699. (de la Pryme, 212). Engraving by Fowler published 1799. In 1873 V D H Cary-Elwes dug extensively on the site and discovered a simpler tessellated pavement in a room adjoining the larger one exposed in 1699, but partly destroyed by a farm building. In 1874 Elwes records that the pavement had been investigated on many occasions and suffered considerably (de la Pryme, 212n.). Pavement exposed completely Sept-Oct 1972. Unstratified finds from topsoil covering pavement, RB sherds, tile fragments, tesserae samples, med. and post-med. sherds; SM; RX VK. (SMI; AN 1972, 41). [1] The excavation of a Roman mosaic floor in July 1699 was reported in a letter to Thomas Gale (Dean of York) by the diarist Abraham de la Pryme. Thomas Smith, a tenant of the landowner Elwes, had already exposed a portion and allowed local schoolboys to help themselves to tessera. The first published illustration of the Roxby mosaic appeared in 1752. Charles Mitley was commissioned by Francis Drake of York to make drawings of the Winterton Villa mosaic. The inscription above the engraving states that the Roxby pavement had not been completely exposed. The Winterton antiquary William Fowler copied Mitley's illustration and description of Roxby when he published his first engraving of the Winterton mosaic in 1796. By 1866, the estate owner VDH Cary Elwes recognised that much damage had been done to the mosaic by carelessness and ignorance. He recorded that the tenant had allowed visitors to take away pieces of the pavement as souvenirs. In 1873 he examined the site himself, uncovering the full extent of the mosaic for the first time. Part of a smaller second pavement was revealed to the east. Elwes ordered the mosaic to be covered with boards and backfilled. A small portion was re-opened in June 1888 for inspection by the Lincoln & Nottingham Architectural and Archaeological Society. At the request of the Elwes Estate, the mosaics were uncovered by Chris Knowles of Scunthorpe Museum in 1972, assisted by Margaret Knowles and a group of volunteers. The mosaic was on public display during the Roxby Flower Festival in the summer of that year. The pavement was found to have suffered very considerable damage. The western half was disturbed by a former cart track, as recorded by Elwes. The outer margins had been damaged when the stone from surrounding walls had been robbed out. Short lengths of surviving walls were noted on the west and north sides. The northern part of the smaller pavement and the north-eastern part of the larger one had been destroyed by the construction of a wagon shed. The centre of the large pavement was largely absent due to previous disturbance. The available evidence in 1972 suggested that the mosaics related to a building with a corridor plan, facing eastwards, with a sequence of rooms on an approximate north-south axis. [4, 7, 8] Ground slides taken during the 1972 exposure. [9 - 16] In September 1989, an archaeological evaluation was carried out by Humberside Archaeology Unit, south of North Street. This was in advance of the construction of a single dwelling. Two trenches were excavated, conjoined into an inverted 'T' shape. Demolition deposits uncovered were clearly the north wall of the villa building, but the dimensions of the wall were not significantly load-bearing. This led to the conclusion that this was the side wall of an aisled building, orientated on an ENE-WSW alignment. This could be compared with two similar structures excavated at Winterton Villa. Building 'D' at Winterton

had mosaic pavements in a suite of rooms at the western end of an aisled building, with baths built into the southern aisle. The reconstructed dimensions at Roxby gave a width of c. 4.5m for the north aisle, and c. 8.5m for the central rooms. If the south aisle was the same with, then the building was c. 20m wide. The length would have been between 40m and 60m. A post-demolition Phase 2 was also recorded within the trenches. A hearth and two clay ovens had been constructed over the rubble spread. They were probably within a building of some sort, but no trace of this was found, and there was no dating evidence. [17, 18]

Asset/Event Number	193
Asset/Event Name	RB POTTERY, POSSIBLE RB KILNS
Type of Site	KILN? (RO)
Listing No./NRHE Number	
HER Number	MLS2017
Status	Non-designated Heritage Asset
Easting	491200
Northing	415800
Parish	
Council	North Lincolnshire
Description	Spread of RB greyware sherds SE of probable kiln sites, also flint flakes, scrapers, med. sherds; SM, RX SR.

Asset/Event Number	194
Asset/Event Name	RB POTTERY AND KILN WASTERS
Type of Site	FINDSPOT (RO:C2)
Listing No./NRHE Number	
HER Number	MLS2018
Status	Non-designated Heritage Asset
Easting	491150
Northing	415950
Parish	
Council	North Lincolnshire
Description	RB pottery, 2nd cent. kiln wasters found in trench for electricity cable 1961. Excavations 1961, 1964 directed by I M Stead yielded further pottery but kilns not located; SM, RX R, AB-Z, BA-F. (EMAB 1961, 10). Field- walking 1970 revealed concentration of sherds within dark area on W side of which were two patches of burnt clay - kiln sites?; SM, RX AA. [

Asset/Event Number	195
Asset/Event Name	FLINT FLAKES, RB & MEDIEVAL POTTERY, 1970
Type of Site	FINDSPOT (PRE); FINDSPOT (RO); FINDSPOT (MED/PM)
Listing No./NRHE Number	

HER Number	MLS2019
Status	Non-designated Heritage Asset
Easting	491400
Northing	415800
Parish	
Council	North Lincolnshire
Description	Flint flakes, Romano-British, medieval sherds found 1970; SM, RX WJ.

Asset/Event Number	196
Asset/Event Name	POSSIBLE RB KILN (SITE OF), N OF WESTFIELD HOLT
Type of Site	POTTERY KILN? (RO)
Listing No./NRHE Number	
HER Number	MLS2020
Status	Non-designated Heritage Asset
Easting	491568
Northing	415630
Parish	
Council	North Lincolnshire
Description	SE91581563. Romano-British site, 'RB potsherds occur in the SW corner of a field lying immediately to the N of Westfield Holt.; (Dudley, 1949, 140). RB greywares, coarsewares, box-flue fragments, worked flints, 1970; SM, RXWH. SE91551563 Flint flakes, RB sherds, lumps of baked clay from area W of site at SE 91581563; SM, RX WI. Possible kiln site.

Asset/Event Number	197
Asset/Event Name	FLINT IMPLEMENTS
Type of Site	FINDSPOT (PRE:MES,NEO)
Listing No./NRHE Number	
HER Number	MLS2021
Status	Non-designated Heritage Asset
Easting	491300
Northing	416600
Parish	
Council	North Lincolnshire
Description	SE 913 166 Flint flakes, end scraper, retouched flake; private possession. and SM, RX SM. [1] North Lincolnshire Museum collections contain worked flint from this findspot from two donors.

Asset/Event Number	198
---------------------------	-----

Asset/Event Name	FLINT MICROLITH
Type of Site	FINDSPOT (PRE:MES)
Listing No./NRHE Number	
HER Number	MLS2022
Status	Non-designated Heritage Asset
Easting	491300
Northing	415100
Parish	
Council	North Lincolnshire
Description	SE913 151 (area). Flint microlith; SM, RX SV.

Asset/Event Number	199
Asset/Event Name	FLINT FLAKES, CORE, PLOUGH PEBBLE, 1970
Type of Site	FINDSPOT (PRE); FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS2023
Status	Non-designated Heritage Asset
Easting	491300
Northing	417000
Parish	
Council	North Lincolnshire
Description	Flint flakes, core, plough pebble, 1970; SM, RX ST. [

Asset/Event Number	200
Asset/Event Name	FLINT FLAKE
Type of Site	FINDSPOT (PRE)
Listing No./NRHE Number	
HER Number	MLS2024
Status	Non-designated Heritage Asset
Easting	491980
Northing	415450
Parish	
Council	North Lincolnshire
Description	Flint flake from core in grey flint, 1972-3; GA, 1727.

Asset/Event Number	201
Asset/Event Name	FLINT IMPLEMENTS, "BRACKENHOLMES"

Type of Site	FLINT SCATTER (PRE); FINDSPOT
Listing No./NRHE Number	
HER Number	MLS2025
Status	Non-designated Heritage Asset
Easting	492380
Northing	415850
Parish	
Council	North Lincolnshire
Description	Flint scrapers, flake, knife, plough pebble from "Brackenholmes"; SM, RX BH.

Asset/Event Number	202
Asset/Event Name	FLINT IMPLEMENTS, SLAG
Type of Site	FINDSPOT (PRE)
Listing No./NRHE Number	
HER Number	MLS2027
Status	Non-designated Heritage Asset
Easting	491200
Northing	416800
Parish	
Council	North Lincolnshire
Description	Flint flakes, scrapers, core, slag; SM, RX SP.

Asset/Event Number	203
Asset/Event Name	FLINTS, SLAG, POST MEDIEVAL POTTERY, 1970
Type of Site	FINDSPOT (PRE)
Listing No./NRHE Number	
HER Number	MLS2028
Status	Non-designated Heritage Asset
Easting	491200
Northing	416900
Parish	
Council	North Lincolnshire
Description	Flint flakes, slag, post-med. sherds, 1970; SM, RX SS.

Asset/Event Number	204
Asset/Event Name	FLINT IMPLEMENTS, MEDIEVAL SHERDS
Type of Site	FINDSPOT (PRE/MED); FINDSPOT (RO); FINDSPOT (MED/PM)

Listing No./NRHE Number**HER Number** MLS2029**Status** Non-designated Heritage Asset**Easting** 491200**Northing** 416600**Parish****Council** North Lincolnshire**Description** Flint flakes, scrapers, cores, points, blades; SM, RX SO. Finds from topsoil stripping 1966 - flint flakes, scraper, med. sherds; SM, RX BM. [1] North Lincolnshire Museum accession records include Roman sherds (code RXBM 3) amongst the finds from this location. The findspot is recorded as 'east of Bagmoor Lane', but the recorded grid reference of SE912 176 is a long way north of this location, so probably a transcription error. [

Asset/Event Number 205**Asset/Event Name** FLINT FLAKES, RB & POST MEDIEVAL POTTERY**Type of Site** FINDSPOT (PRE); FINDSPOT (RO)**Listing No./NRHE Number****HER Number** MLS2031**Status** Non-designated Heritage Asset**Easting** 492400**Northing** 417300**Parish****Council** North Lincolnshire**Description** Flint flakes, RB colour-coated sherd, post-med. sherds; SM, RX BD.

Asset/Event Number 206**Asset/Event Name** FLINT & POTTERY, DRAGONBY**Type of Site** FINDSPOT (PRE:NEO,BA?); FINDSPOT (MED)**Listing No./NRHE Number****HER Number** MLS2034**Status** Non-designated Heritage Asset**Easting** 490440**Northing** 414180**Parish****Council** North Lincolnshire**Description** Finds from vicinity of "Sunken Church", Dragonby, flint scrapers, cores, flakes (some retouched), med. sherds; SM, RX BI.

Asset/Event Number 207

Asset/Event Name	STONE AXE, DRAGONBY, 1909
Type of Site	FINDSPOT (PRE:NEO)
Listing No./NRHE Number	
HER Number	MLS2035
Status	Non-designated Heritage Asset
Easting	490180
Northing	414130
Parish	
Council	North Lincolnshire
Description	Butt end of stone axe found at Dragonby c. 1909, during construction of brickworks, Group VI fine, section no. 235; SM, RX BE. (Dudley 1949, 50, F16).

Asset/Event Number	208
Asset/Event Name	FLINTS, 1972-3
Type of Site	FINDSPOT (PRE:NEO)
Listing No./NRHE Number	
HER Number	MLS2036
Status	Non-designated Heritage Asset
Easting	491000
Northing	415500
Parish	
Council	North Lincolnshire
Description	Three flint flakes, blade, scraper, retouched flake, 1972-3; GA, 1720-25. [

Asset/Event Number	209
Asset/Event Name	FINDS, FIELD W OF ROXBY VILLAGE
Type of Site	FINDSPOT (PRE:BA,IA/RO/MED/PM); FINDSPOT (RO)
Listing No./NRHE Number	
HER Number	MLS2039
Status	Non-designated Heritage Asset
Easting	491800
Northing	416800
Parish	
Council	North Lincolnshire
Description	Flint flake, flint knife, RB sherds, tile fragments, med. and post-med. sherds, 1970, from field to W of village; SM, RX VC.

Asset/Event Number	210
Asset/Event Name	FLINT & POTTERY, NW OF ROXBY VILLAGE
Type of Site	FINDSPOT (PRE/RO/MED/PM); FINDSPOT; FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS2040
Status	Non-designated Heritage Asset
Easting	491700
Northing	417100
Parish	
Council	North Lincolnshire
Description	Flint flakes (one retouched), RB sherd, med. and post-med. sherds from field NW of village; SM RX SZ.

Asset/Event Number	211
Asset/Event Name	WORKED FLINT, PREHISTORIC SHERD
Type of Site	FINDSPOT (PRE:MES,NEO,BA/MED?)
Listing No./NRHE Number	
HER Number	MLS2041
Status	Non-designated Heritage Asset
Easting	490900
Northing	414800
Parish	
Council	North Lincolnshire
Description	SE909 148 (centre). Flint microliths, points, cores, scrapers, burin, point of flint ?dagger, prehistoric sherd, ploughstone; SM, RX SJ. [1] The North Lincolnshire Museum accession records for this flint assemblage include 4 geometric microliths (RXSJ 15 - 18) and 8 obliquely blunted points (RXSJ 19 - 26) of Mesolithic date.

Asset/Event Number	212
Asset/Event Name	FLINT SCATTER, SHEFFIELDS HILL
Type of Site	FINDSPOT (PRE:NEO,BA); FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS2042
Status	Non-designated Heritage Asset
Easting	490800
Northing	414500
Parish	
Council	North Lincolnshire
Description	Southernmost extent of flint surface finds along brow of escarpment - flint scrapers, cores, flakes, possible knife fragment, large barbed and tanged "arrowhead" 2 1/8in. long 1 1/4in.

wide found at SE 9087 1446; SM, RX SD. [1] The North Lincolnshire Museum accession database describes the findspot of this assemblage as 'Riley and Walshaw's S-R III.' In addition to the flint implements listed in Ref 1 (above), there are also medieval pottery sherds, including curfew fragments (code RXSD 8).

Asset/Event Number	213
Asset/Event Name	FLINT SCATTER
Type of Site	FINDSPOT (PRE:MES,NEO,BA); FINDSPOT (MED)
Listing No./NRHE Number	
HER Number	MLS2043
Status	Non-designated Heritage Asset
Easting	491120
Northing	416480
Parish	
Council	North Lincolnshire
Description	SE91121648. Finds from ploughsoil, "mainly from sandy higher ground centred on above grid ref." (SMI). Flint flakes - some retouched, scrapers, cores, obliquely-blunted point, shouldered point, microlith, microburin; SM, RX SQ. [1] The North Lincolnshire Museum accession database names the findspot of this assemblage as 'Triangular area south of Bagmoor lane, primarily in the SE corner'. It includes a plough pebble (code RXSQ 5), dated as prehistoric but probably medieval.

Asset/Event Number	214
Asset/Event Name	FLINT & RB POTTERY
Type of Site	FINDSPOT (PRE); FINDSPOT (RO)
Listing No./NRHE Number	
HER Number	MLS2044
Status	Non-designated Heritage Asset
Easting	491300
Northing	416100
Parish	
Council	North Lincolnshire
Description	Flint flakes and Romano-British sherds found 1970; SM, RX SU.

Asset/Event Number	215
Asset/Event Name	RING DITCH (CM), E OF BRACKENHOLMES ROAD
Type of Site	RING DITCH (PRE?)
Listing No./NRHE Number	
HER Number	MLS20604
Status	Non-designated Heritage Asset

Easting 492020
Northing 416270
Parish
Council North Lincolnshire
Description SE92021627. A possible ring ditch, approximate diameter 22m, is visible as a cropmark. Prehistoric or Roman date. Source : NMR AP SE 9216/52 (17320/32) 19-JUL-1999

Asset/Event Number 216
Asset/Event Name LINEAR DITCH
Type of Site DITCH (PU)
Listing No./NRHE Number
HER Number MLS20659
Status Non-designated Heritage Asset
Easting 491790
Northing 416940
Parish
Council North Lincolnshire
Description SE91791694 A 170m long linear cropmark, defined by a substantial ditch. Possible boundary of Prehistoric or Roman date. Source : NMR SE 9116/5 (17140/20) 24-JUL-1998

Asset/Event Number 217
Asset/Event Name LINEAR CROPMARK
Type of Site TRACKWAY? (PU)
Listing No./NRHE Number
HER Number MLS20809
Status Non-designated Heritage Asset
Easting 491581
Northing 415793
Parish
Council North Lincolnshire
Description A single cropmark line running roughly north west - south east for approx 650m. The original aerial photograph is not held in the HER. [1] This cropmark is visible but indistinct on an air photograph taken in June 1971.

Asset/Event Number 218
Asset/Event Name ROMANO-BRITISH DITCH, SOUTH OF NORTH STREET
Type of Site DITCH (RO:C3,C4)
Listing No./NRHE Number

HER Number	MLS21244
Status	Non-designated Heritage Asset
Easting	492196
Northing	417072
Parish	
Council	North Lincolnshire
Description	Humber Field Archaeology were commissioned to carry out an archaeological watching brief during groundworks at The Old Hall, Roxby, 2000. One archaeological feature was recorded. Located on the access track immediately south of North Street. It was a small ditch or pit, directly below the topsoil, 0.90m wide and 0.45m deep. The fill contained two sherds of Roman greyware, 3rd-4th century.

Asset/Event Number	219
Asset/Event Name	OPEN FIELD SYSTEM, ROXBY CUM RISBY PARISH
Type of Site	OPEN FIELD (MED); RIDGE AND FURROW (MED)
Listing No./NRHE Number	
HER Number	MLS21294
Status	Non-designated Heritage Asset
Easting	492344
Northing	416174
Parish	
Council	North Lincolnshire
Description	A partially ploughed-out headland or hollow way in area SE925169 was visible on air photographs, taken in April 1984.

Asset/Event Number	220
Asset/Event Name	SEARCHLIGHT BATTERY (SITE OF), ROXBY
Type of Site	SEARCHLIGHT BATTERY (PM:C20)
Listing No./NRHE Number	
HER Number	MLS21405
Status	Non-designated Heritage Asset
Easting	491700
Northing	416800
Parish	
Council	North Lincolnshire
Description	The site of Second World War searchlight battery 1/1 at Roxby. It was site 1, manned by 1 Troop of 323 Searchlight Battery from October 1941. The searchlight battery was established as part of a special deployment of searchlights to defend the Humber estuary. These complemented already established searchlight batteries in the area.

Asset/Event Number	221
Asset/Event Name	MESOLITHIC MICRODENTICULATE
Type of Site	FINDSPOT (PRE:MES)
Listing No./NRHE Number	
HER Number	ELS3409;MLS2146
Status	Non-designated Heritage Asset
Easting	491321
Northing	417915
Parish	
Council	North Lincolnshire
Description	A Mesolithic flint tool was found by a footpath at Cliff Farm in 2008, and brought to North Lincolnshire Museum for identification. It was the tip of a Mesolithic flint bladelet, with four evenly spaced removals to create a serrated edge (a microdenticulate). Very small - measured 11mm by 7.5mm. Photographed.

Asset/Event Number	222
Asset/Event Name	LATE SAXON POTTERY
Type of Site	ARTEFACT SCATTER (EMED:AS)
Listing No./NRHE Number	
HER Number	MLS21550
Status	Non-designated Heritage Asset
Easting	490836
Northing	414298
Parish	
Council	North Lincolnshire
Description	Archaeological observation and recording was carried out during the installation of a water pipeline in the Dragonby area in 1994. Part of a field to the west of the A1077, and west of Sawcliffe, was fieldwalked as part of this recording. At 45-55m west of the A1077, a scatter of shell-tempered pottery was collected. It was most prominent c. 20-30m north of the pipeline (estimated location SE90831429). The pottery was identified as later Saxon. A dense scatter of brick & tile, thought to be 20th century infill of a stone quarry, was observed to be fading out in this area.

Asset/Event Number	223
Asset/Event Name	PRIMITIVE METHODIST CHAPEL
Type of Site	PRIMITIVE METHODIST CHAPEL (PMC19)
Listing No./NRHE Number	
HER Number	MLS21776
Status	Non-designated Heritage Asset
Easting	492067
Northing	416929

Parish**Council** North Lincolnshire**Description** 'Methodist Chapel (Primitive)' printed and shown on Ordnance Survey 25" 2nd edition map of 1907 [1] Building has since been extended and remains in use as a place of worship [2] Date stone reads: '18 P. W. CHAPEL 97.'

Asset/Event Number 224**Asset/Event Name** WINDMILL (SITE OF)**Type of Site** WINDMILL (PM:C19?)**Listing No./NRHE Number****HER Number** MLS21976**Status** Non-designated Heritage Asset**Easting** 491598**Northing** 417568**Parish****Council** North Lincolnshire**Description** A 'Mill' is printed and shown on the Ordnance Survey 2" Surveyors map of 1819

Asset/Event Number 225**Asset/Event Name** ROMAN SILVER RING**Type of Site** FINDSPOT (RO:C2/3)**Listing No./NRHE Number****HER Number** MLS22059**Status** Non-designated Heritage Asset**Easting** 492120**Northing** 417120**Parish****Council** North Lincolnshire**Description** A small silver finger-ring, quite heavily worn. The broad bulbous bezel has scalloped margins and incorporates the shoulders, which reduce sharply to a narrow hoop. External diameter: 18.5mm; internal diameter: 15.9mm; weight: 4.4g. [1,2] The artefact was purchased by North Lincolnshire Museum in December 2007

Asset/Event Number 226**Asset/Event Name** PARTIAL SILVER INGOT**Type of Site** FINDSPOT (EMED:SC:C9/10)**Listing No./NRHE Number****HER Number** MLS22063**Status** Non-designated Heritage Asset

Easting	491300
Northing	415700
Parish	
Council	North Lincolnshire
Description	One end, obliquely cut, from a cigar-shaped ingot with an ovoid section. Its top is smooth. Its under-surface is slightly pitted and flattened at the cut end. There are around five nicked testing marks along each side. Length: 23mm. Weight: 10.07g. [1] The artefact was purchased by North Lincolnshire Museum in February 2009 using the finders share, kindly donated to the museum.

Asset/Event Number	227
Asset/Event Name	FOURWINDS, WINTERTON ROAD
Type of Site	VICARAGE (PM:C19)
Listing No./NRHE Number	
HER Number	MLS22156
Status	Non-designated Heritage Asset
Easting	491552
Northing	416755
Parish	
Council	North Lincolnshire
Description	'Vicarage' is printed and shown on the Ordnance Survey 25" 1st and 2nd edition maps of 1886 and 1907 [1,2] 'The living is a vicarage, with that of Risby annexed, joint net yearly value £500, including 120 acres of glebe and residence in the gift of V.D.H. Cary-Elwes esq. and held since 1879, by the Reverend Walter Arthur Taylor, of Caius College, Cambridge, who is non-resident.' [3] Only the southern most part of the original vicarage appears to survive

Asset/Event Number	228
Asset/Event Name	NATIONAL SCHOOL, NORTH STREET
Type of Site	SCHOOL (PM:C19:1868?)
Listing No./NRHE Number	
HER Number	MLS22157
Status	Non-designated Heritage Asset
Easting	492004
Northing	417009
Parish	
Council	North Lincolnshire
Description	'School' is printed and shown on the Ordnance Survey 25" 1st and 2nd edition maps of 1887 and 1907 [1,2] In 1868, Valentine H. D. CARY-ELWAS funded the building of a National School, built to hold 56 children, initially attended by over 40 children. [3] The building has since been extended to the rear (north) and is used as a private residence

Asset/Event Number	229
Asset/Event Name	Smithy (site of), South Street
Type of Site	SMITHY
Listing No./NRHE Number	
HER Number	MLS22158
Status	Non-designated Heritage Asset
Easting	491990
Northing	416900
Parish	
Council	North Lincolnshire
Description	'Smwthy' is printed and shown on the Ordnance Survey 25" 1st edition map of 1887 [1] 'Smy.' is printed and shown on the Ordnance Survey 25" 2nd edition map of 1907 [2] The building has since been demolished and the land has been redeveloped into terraced housing called 'Anvil Walk'

Asset/Event Number	230
Asset/Event Name	POSSIBLE ROMAN KILN, SOUTH STREET
Type of Site	KILN? (RO?)
Listing No./NRHE Number	
HER Number	MLS22403
Status	Non-designated Heritage Asset
Easting	492060
Northing	416960
Parish	
Council	North Lincolnshire
Description	An Ordnance Survey field investigator recorded in April 1964 that A Mr. P. Dawson found indications of a kiln structure in 1961-62. The indicated findspot was at SE92061696, and the material consisted of Roman brick, fragmentary pottery and burnt earth spread over an area of 3-4 square feet at an approx. depth of 18"; the material was not dated by an authority, and was later reburnt with other refuse.

Asset/Event Number	231
Asset/Event Name	HEAVY ANTI AIRCRAFT BATTERY (SITE OF), SAWCLIFFE FARM
Type of Site	HEAVY ANTI AIRCRAFT BATTERY (PM:C20)
Listing No./NRHE Number	
HER Number	MLS22522
Status	Non-designated Heritage Asset
Easting	491900
Northing	414600
Parish	

Council	North Lincolnshire
Description	A general location record of the site of a First World War heavy anti aircraft battery at Sawcliffe Farm which was armed with a 18-pounder gun in 1917. Source: C S Dobinson 1996 Twentieth century fortifications in England, volume 1. Anti-aircraft artillery : England's air defence gunsites, 1914-46 (289)

Asset/Event Number	232
Asset/Event Name	FLINT MEDIEVAL AND ROMANO BRITISH POTTERY SCATTER.
Type of Site	FINDSPOT; FINDSPOT; FINDSPOT
Listing No./NRHE Number	
HER Number	MLS22533
Status	Non-designated Heritage Asset
Easting	491200
Northing	415800
Parish	
Council	North Lincolnshire
Description	Findspot of Flint flakes, scrapers, Romano-British and Medieval pottery. No more details were provided

Asset/Event Number	233
Asset/Event Name	9TH CENTURY IRISH MOUNT
Type of Site	FINDSPOT (EMED:C9)
Listing No./NRHE Number	
HER Number	MLS22575
Status	Non-designated Heritage Asset
Easting	491000
Northing	415000
Parish	
Council	North Lincolnshire
Description	A gilded copper alloy Irish mount, 9th century AD. Purchased by North Lincolnshire Museum from the landowner in 2001. Museum site code RXWV. On display in the Viking display case, 2011.

Asset/Event Number	234
Asset/Event Name	ROMAN COINS, 38 SOUTH STREET
Type of Site	FINDSPOT (PM)
Listing No./NRHE Number	
HER Number	MLS22611
Status	Non-designated Heritage Asset

Easting	492109
Northing	416932
Parish	
Council	North Lincolnshire
Description	3 Roman coins from the garden of 38 South Street. Donated to North Lincolnshire Museum, 1970. Ae coin of Carausius. AD 287 - 93, Lyon mint. Museum code RXVG 1 Coin of Claudius Gothicus AD 268- 70. Code RXVG 2 Ae coin of Constantius II 337-361 AD. Lyon mint. Code RXVG 3.

Asset/Event Number	235
Asset/Event Name	ROMANO-BRITISH OCCUPATION, WEST FIELD
Type of Site	ARTEFACT SCATTER (RO)
Listing No./NRHE Number	
HER Number	MLS22838
Status	Non-designated Heritage Asset
Easting	491700
Northing	415100
Parish	
Council	North Lincolnshire
Description	Solo fieldwalking at some time in the 1970s, West Field at High Risby. Romano-British pottery was collected, including greyware, samian ware and colour-coated ware. One sherd was from a colour coated face pot. The rim fragment included the top of the head and part of the face. The hair was centre parted and plaited. Also found, a fragment of a copper alloy strip bracelet. Finds donated to North Lincolnshire Museum, parish code RXBL.

Asset/Event Number	236
Asset/Event Name	OLD HALL FARM, ROXBY CUM RISBY
Type of Site	FARMSTEAD
Listing No./NRHE Number	
HER Number	MLS24932
Status	Non-designated Heritage Asset
Easting	492319
Northing	417082
Parish	
Council	North Lincolnshire
Description	Unnamed farmstead (on OS mapping), Roxby cum Risby. Partially extant 19th century unlisted farmstead. Regular courtyard of U plan. The farmhouse location is unclear. There has been a partial loss (less than 50%) of traditional buildings. Located within or in association to a village. [1] Humber Field Archaeology were commissioned by Keigar Homes to carry out a photographic survey of the buildings at Old Hall Farm, prior to conversion to residential use, 2005. The farm buildings were of limestone rubble with the occasional use of brick facings. The oldest of them would appear to have been the barn and stable block, which may have been constructed in the late 18th century. The farmhouse itself and a cartshed were probably built

in the early/mid 19th century, with further buildings, such as a shelter shed and infill to the west of the farmhouse, being built before 1889. At some point in the mid/late 19th century, the farmhouse had been extended into the barn at first floor level. The report and photographic archive is held by North Lincolnshire HER. [2, 3] The converted barns were visited and photographed during the Heritage at Risk project, October 2015. [4] Two further barns at the southern edge of the complex were photographed in 2019 in connection with a planning proposal for the residential conversion of the eastern barn (barn 2) and demolition of the western barn (barn 3), the latter being in a semi derelict state at the time of survey

Asset/Event Number	237
Asset/Event Name	CHARBECK GRANGE, ROXBY CUM RISBY
Type of Site	FARMSTEAD
Listing No./NRHE Number	
HER Number	MLS25114
Status	Non-designated Heritage Asset
Easting	492233
Northing	417048
Parish	
Council	North Lincolnshire
Description	Charbeck Grange, Roxby cum Risby. Partially extant 19th century unlisted farmstead. Regular courtyard of U plan. The farmhouse is detached from the main working complex. There has been a partial loss (less than 50%) of traditional buildings. Located within or in association to a village.

Asset/Event Number	238
Asset/Event Name	HALL FARM (MANOR HOUSE), ROXBY CUM RISBY
Type of Site	FARMSTEAD
Listing No./NRHE Number	
HER Number	MLS25115
Status	Non-designated Heritage Asset
Easting	491891
Northing	416727
Parish	
Council	North Lincolnshire
Description	Hall Farm (Manor House), Roxby cum Risby. Partially extant 18th century unlisted farmstead. Regular courtyard of U plan. The farmhouse is detached from the main working complex. There has been a partial loss (less than 50%) of traditional buildings. Located within or in association to a village. Large modern sheds are located to the side of the site. [1] Roxby Hall Farm was visited and photographed during the Heritage at Risk project, October 2015.

Asset/Event Number	239
Asset/Event Name	HIGH RISBY FARM, ROXBY CUM RISBY

Type of Site	FARMSTEAD
Listing No./NRHE Number	
HER Number	MLS25119
Status	Non-designated Heritage Asset
Easting	491982
Northing	414745
Parish	
Council	North Lincolnshire
Description	(High Risby), Roxby cum Risby. Extant 18th century unlisted farmstead. Regular courtyard with multiple regular yards. The farmhouse is detached from the main working complex. Isolated location. Large modern sheds are located to the side of the site. [1] High Risby Farm was visited and photographed during the Heritage at Risk project, October 2015.

Asset/Event Number	240
Asset/Event Name	SAWCLIFFE FARM, ROXBY CUM RISBY
Type of Site	FARMSTEAD
Listing No./NRHE Number	
HER Number	MLS25120
Status	Non-designated Heritage Asset
Easting	491201
Northing	414495
Parish	
Council	North Lincolnshire
Description	Sawcliffe Farm, Roxby cum Risby. Partially extant 19th century unlisted farmstead. Regular courtyard with multiple regular yards. The farmhouse is attached to a range of working buildings. There has been significant loss (greater than 50%) of traditional buildings. Isolated location. Large modern sheds are located on the site. [1] Sawcliffe Farm was visited and photographed during the Heritage at Risk project, 2015.

Asset/Event Number	241
Asset/Event Name	BAGMOOR FARM, BURTON UPON STATHER
Type of Site	FARMSTEAD
Listing No./NRHE Number	
HER Number	MLS25301
Status	Non-designated Heritage Asset
Easting	490384
Northing	416304
Parish	
Council	North Lincolnshire
Description	Bagmoor Farm, Burton upon Stather. Partially extant 19th century unlisted farmstead. Regular courtyard with multiple regular yards. The farmhouse is detached from the main working

complex. There has been a partial loss (less than 50%) of traditional buildings. Isolated location. Large modern sheds are located on the site.

Asset/Event Number	242
Asset/Event Name	GINMILL BARN, OLD BARN LANE
Type of Site	BARN? (PM:C19?); HORSE ENGINE (PM:C19)
Listing No./NRHE Number	
HER Number	MLS26059
Status	Non-designated Heritage Asset
Easting	492208
Northing	417077
Parish	
Council	North Lincolnshire
Description	An agricultural building with a distinctive polygonal structure on the south side, indicating a housing for horse-powered milling or threshing machinery. [1] The barn was converted to residential use in 2003. Prior to this, a photographic survey was carried out by Caroline Atkins Consultants and was to be deposited at North Lincolnshire Museum, parish code RXBG. [2] Ginmill Barn was visited and photographed during the Heritage at Risk project, October 2015. The mill housing had been incorporated into the residential conversion.

Asset/Event Number	243
Asset/Event Name	FLINTS AND RB POTTERY
Type of Site	FINDSPOT (PRE); FINDSPOT (RO)
Listing No./NRHE Number	
HER Number	MLS6560
Status	Non-designated Heritage Asset
Easting	491700
Northing	415600
Parish	
Council	North Lincolnshire
Description	Finds from 'S W corner of field north of Wesfield Holt near Brackenholmes.' in North Lincolnshire Museum: Romano-British sherds, parish code RXWH 1 Box flue tile fragments, RXWH 2 Flint flakes and a scraper, RXWH 3, 4

Asset/Event Number	244
Asset/Event Name	FLINTS, SAWCLIFFE FARM, NE OF DRAGONBY
Type of Site	FLINT SCATTER (PRE)
Listing No./NRHE Number	
HER Number	MLS6563
Status	Non-designated Heritage Asset

Easting	491210
Northing	414500
Parish	
Council	North Lincolnshire
Description	'Flints' at Sawcliffe Farm were listed in a 1976 gazetteer. No further information. [1] A group of flint implements from Sawcliffe are held at North Lincolnshire Museum. Multiple donors.. The generalised grid reference (SE912 145) is very similar to the 1976 gazetteer reference.

Asset/Event Number	245
Asset/Event Name	NORMANBY PARK SIDINGS, NW OF DRAGONBY
Type of Site	RAILWAY SIDING (PM:C20)
Listing No./NRHE Number	
HER Number	MLS9448
Status	Non-designated Heritage Asset
Easting	490200
Northing	414400
Parish	
Council	North Lincolnshire
Description	Two black & white photographs of the Normanby Park sidings, 1986.

Asset/Event Number	246
Asset/Event Name	DRAGONBY MINE ENTRANCE, N OF DRAGONBY
Type of Site	MINE (PM)
Listing No./NRHE Number	
HER Number	MLS9451
Status	Non-designated Heritage Asset
Easting	490400
Northing	414700
Parish	
Council	North Lincolnshire
Description	3 Black & white prints in box file; photographs taken c. 1987.

Asset/Event Number	247
Asset/Event Name	MED/PM SETTLEMENT, ROXBY
Type of Site	VILLAGE (MED/PM)
Listing No./NRHE Number	
HER Number	MLS9668

Status	Non-designated Heritage Asset
Easting	492100
Northing	416900
Parish	
Council	North Lincolnshire
Description	<p>Roxby cum Risby Former 11th century administrative centre in Manley wapentake. These were originally two separate pre-conquest hundreds Risby (Great and Little) and Roxby, but were later united; Great and Little Risby formed a villata in 1316 and a parish in their own right, but both now form a hamlet in the parish of Roxby. In 1066 Merlosuen had 5 carucates and 3 bovates in Roxby, worth 6 pounds. At Domesday, Ralf Pagenel held 5 carucates in Roxby, 3 teams in demesne, 23 sokemen on 21 bovates of this land, and 8 villeins and 4 bordars with 6 teams, 44 acres of meadow and 6 acres of underwood. Gilbert de Gand held 2 bovates in Roxby, with 1 villein and 2 oxen, as sokeland of Scampton. Norman de Arci held 4 bovates of land in Roxby, with 1 sokeman with 3 oxen, and 7 acres of meadow, as sokeland. In 1115-18 Ralph Paine held 5 carucates in Roxby; Norman de Arci held 4 bovates. St Mary's church may be Norman in Origin. [1] An analysis of the settlement plan of Roxby was included in a volume investigating early Norman 'Lincolnshire Tower' churches. The church was located on a public open space, a former village green located between South Street and North Street. St Mary's stood prominently at the north-western corner of the green, diagonally opposite the dominant Pagnell manor on the east and south-east corner of the green (area SE921170). South Street exited from the south-west corner of this green, and is still lined along its south side by at least 12 very regular, similarly sized village plots that would have been peasant holdings, with the stream forming their common back boundary. A plot at the west end of this row, now occupied by Hall Farm, may be the location of one of the other two Domesday holdings in Roxby, perhaps Gilbert de Gant's berewick (outlying farm) of his major manor of Appleby and Risby. The location of the third Domesday landholding could have been east of the Pagnell manor, or perhaps at Grange Farm.</p>

Asset/Event Number	248
Asset/Event Name	Trackway, High Risby - Sheffield's Hill
Type of Site	TRACKWAY (MED?)
Listing No./NRHE Number	
HER Number	MLS24696
Status	Non-designated Heritage Asset
Easting	491016
Northing	415434
Parish	
Council	North Lincolnshire
Description	<p>An aerial photograph taken in March 1976 showed a clear double-ditched trackway in the field north of Sawcliffe reservoir, centred to SE91311512. Its path was SE-NW, slightly curved, and it had a width of c.6m. Meeting the A1077 at SE91161525, where modern field boundaries also met the road, the trackway continued as a less definite soilmark, north-westwards across Sheffield's Hill to SE90901554. [1] The age of this trackway is uncertain, but it may branch from HER22401, which is thought to be of medieval date.</p>

Asset/Event Number	249
Asset/Event Name	Aerial photographic sortie

Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS800
Status	Event
Easting	491457
Northing	413990
Parish	
Council	North Lincolnshire
Description	Centre point recorded as 493300, 410000- moved within the study area AERIAL PHOTOGRAPH: RZ 50. (SLS1580) AERIAL PHOTOGRAPH: JK St Joseph. 1956. RZ 51. (SLS1577) AERIAL PHOTOGRAPH: JK St Joseph. 1956. RZ 63. (SLS1513) AERIAL PHOTOGRAPH: CUAC. 1956. RZ 62. (SLS805) AERIAL PHOTOGRAPH: CUAC. 1956. RZ 59. (SLS797) AERIAL PHOTOGRAPH: CUAC. 1956. RZ 58. (SLS796) AERIAL PHOTOGRAPH: CUAC. 1956. RZ 57. (SLS616) AERIAL PHOTOGRAPH: CUAC. 1956. RZ 56. (SLS615) AERIAL PHOTOGRAPH: CUAC. 1956. RZ 55. (SLS614)

Asset/Event Number	250
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS801
Status	Event
Easting	491829
Northing	414347
Parish	
Council	North Lincolnshire
Description	Centre point recorded as 495900, 411400- moved within 1km study area AERIAL PHOTOGRAPH: 1957. UB 18. (SLS1444) AERIAL PHOTOGRAPH: CUAC. 1957. UB 23. (SLS1041) AERIAL PHOTOGRAPH: CUAC. 1957. UA 35. (SLS747) AERIAL PHOTOGRAPH: CUAC. 1957. UB 15. (SLS567) AERIAL PHOTOGRAPH: CUAC. 1957. UB 18. (SLS566) AERIAL PHOTOGRAPH: CUAC. 1957. UB 17. (SLS565) AERIAL PHOTOGRAPH: CUAC. 1957. UB 14. (SLS564) AERIAL PHOTOGRAPH: CUAC. 1957. UB 13. (SLS563)

Asset/Event Number	251
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	

HER Number	ELS808
Status	Event
Easting	489998
Northing	414957
Parish	
Council	North Lincolnshire
Description	Centre point recorded as 484400, 412600- moved within the 1km study area High quality vertical air photography, each frame covering about 1 kilometre square. A small number of prints from this sortie are in the HER AP collection box files. A folder containing 64 further prints was held by NLC Spatial Planning in the Civic Centre basement, as at August 2014. These prints were scanned at 600dpi resolution and transferred to T:\Base Maps\Aerial Photos at that time. The folder includes an Excel spreadsheet listing frame numbers and locations

Asset/Event Number	252
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS840
Status	Event
Easting	491777
Northing	414268
Parish	
Council	North Lincolnshire
Description	Centre point recorded as 499400, 411700- moved within 1km study area AERIAL PHOTOGRAPHY

Asset/Event Number	253
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS910
Status	Event
Easting	491141
Northing	417541
Parish	
Council	North Lincolnshire

Description Centre point recorded as 402500, 518300- moved within the 1km study area
AERIAL PHOTOGRAPHY

Asset/Event Number 254
Asset/Event Name Aerial photographic sortie
Type of Site AERIAL PHOTOGRAPHY

Listing No./NRHE Number

HER Number ELS925

Status Event

Easting 492095

Northing 415815

Parish

Council North Lincolnshire

Description Centre grid reference 496000,416000- moved within 1km study area
AERIAL PHOTOGRAPHY

Asset/Event Number 255
Asset/Event Name LIDAR survey flights, 2002
Type of Site AIRBORNE LASER SCANNING (LIDAR) SURVEY

Listing No./NRHE Number

HER Number ELS2578

Status Event

Easting 491245

Northing 415369

Parish

Council North Lincolnshire

Description No centre grid point recorded by HER

Lidar topographical surveys, carried out by the Environment Agency in multiple sorties in North Lincolnshire in 2002. NB the point data for this event represents the centre of each 2km x 2km survey grid.[1]

Asset/Event Number 256
Asset/Event Name Aerial photographic sortie
Type of Site AERIAL PHOTOGRAPHY

Listing No./NRHE Number

HER Number ELS2781

Status Event

Easting	4018940
Northing	5150960
Parish	
Council	North Lincolnshire
Description	AERIAL PHOTOGRAPHY

Asset/Event Number	257
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS2806
Status	Event
Easting	489859
Northing	415002
Parish	
Council	North Lincolnshire
Description	Centre point recorded as 487000, 414200- moved within the 1km study area AERIAL PHOTOGRAPHY

Asset/Event Number	258
Asset/Event Name	Watching Brief on Sawcliffe Area Water Mains
Type of Site	WATCHING BRIEF
Listing No./NRHE Number	
HER Number	ELS3145
Status	Event
Easting	491558
Northing	414833
Parish	
Council	NORTH LINCOLNSHIRE
Description	<p>This watching brief took place during the extensive mains replacement scheme to the north east of Scunthorpe.</p> <p>There were five areas monitored, called A - E, which lie in an area with evidence of archaeological activity spanning multiple phases, Prehistoric, Roman, Saxon, medieval and post medieval. Areas A and B are the northern most, and lie in the vicinity of the DMV of Sawcliffe and a triple ditch cropmark system, the like of which have been dated to the later Prehistoric period. Area C passes through the locations of Prehistoric worked flints, a Roman pottery production centre, at least two Bronze Age barrows and Low Santon DMV. Area D lies along Ermine Street Roman road, and area E lies in the area with the most prehistoric potential, with</p>

eight round
barrows and a number of Prehistoric artefacts having been recovered from the surrounding area.
Archaeological monitoring of the five areas took place intermittently during the works. The trenches measuring 0.5m wide by 0.9m deep were excavated by JCB. The narrowness of the trenches made recording difficult in places. Recording was undertaken by making a written record of each deposit, drawing archaeological features to scale (1:20, 1:50), planning to scale, and maintaining a photographic record. Several of the areas monitored did not expose any archaeological deposits. Areas A and E were totally negative, and area C was not monitored due to communication difficulties. Area B identified three linears which may be prehistoric, and area D exposed traces of the Roman road. [1]

Asset/Event Number	259
Asset/Event Name	English Heritage survey flight N853
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS4018
Status	Event
Easting	492006
Northing	417484
Parish	
Council	NORTH LINCOLNSHIRE
Description	Centre point recorded 499700, 418700- moved within the 1km study area AERIAL PHOTOGRAPHY

Asset/Event Number	260
Asset/Event Name	Aerial photographic sortie
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS4051
Status	Event
Easting	490269
Northing	414048
Parish	
Council	NORTH LINCOLNSHIRE
Description	Centre point recorded as 490000, 410000- moved within the 1km study area High quality BW vertical photography

Asset/Event Number	261
Asset/Event Name	Aerial photographic survey
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS4113
Status	Event
Easting	490851
Northing	417588
Parish	
Council	NORTH LINCOLNSHIRE
Description	Centre grid reference 490000, 430000 brought within 1km study area AERIAL PHOTOGRAPHY Meridian Airmaps survey, commissioned or purchased by Humberside County Council. High quality black & white vertical photographs.

Asset/Event Number	262
Asset/Event Name	Aerial photographic survey
Type of Site	AERIAL PHOTOGRAPHY
Listing No./NRHE Number	
HER Number	ELS4125
Status	Event
Easting	491075
Northing	413914
Parish	
Council	NORTH LINCOLNSHIRE
Description	Centre point recorded as 490000, 411000- moved within the 1km study area High quality air photo survey, carried out by Hunting Surveys Ltd. The black & white prints indicate a height of 6,000 ft.

Asset/Event Number	263
Asset/Event Name	WINTERTON ROMAN VILLA
Type of Site	VILLA (RO:C2,C3,C4, Roman - 43 AD to 399 AD)
Listing No./NRHE Number	
HER Number	2103 - MLS2103
Status	Non-designated Heritage Asset
Easting	491000

Northing	418000
Parish	
Council	NORTH LINCOLNSHIRE
Description	<p>Winterton Villa site, three mosaic pavements discovered in 1747, fourth in 1797. Excavations in advance of quarrying directed by I M Stead began 1958, continuing under R Goodburn. Surface finds from area prior to excavation; SM, WNT AA.</p> <p>Excavations revealed the foundations of three circular huts with post-holes, followed by a group of 2nd-4th cent. stone-built aisled buildings arranged around three sides of a rectangular yard. The buildings, which contained the pavements discovered in 18th cent. (Orpheus mosaic now in Scunthorpe Civic Centre), combined domestic accommodation with working areas. Evidence from latter indicates mixed farming. Areas excavated to SW of main buildings have revealed part of enclosure systems associated with the farm. Enclosures range from fence-slots to ditches over 2m. wide and 1 m. deep, and date from 1A to 3rd cent. (Dudley 1949, 131-4, 136-7, refs. to early accounts; Stead 1966, 72-89; Whitwell 1970, 83-4, fig. 8B; JRS LVI (1966) 202, LVII (1967) 184, LVIII (1968) 184, LVIX (1969) 213; Britannia I (1970) 284, II (1971) 258, III (1972) 315, IV (1973) 286, V (1974) 424, VI (1975) 245-6; Stead, report forthcoming). Cropmarks show villa site and regular field enclosure systems (T Hayes, 1960; CUAC obl., 1964, 1969; DNR obl. 1971-1976; SM, WNT/01; JRS LV (1965) 88; AN 1971, 13, fig. III. 6). [1]</p> <p>Article on the Orpheus mosaic by David Neal. [2]</p> <p>'South of the Humber, at Winterton (villa), near Scunthorpe, one sample of charred seeds from a Roman hearth has been investigated; no complete list has been published but fig, field bean, and grape (a single individual) and unidentified cereal grains are all listed in a paper devoted to a discussion of the cultivation of grape in Britain in Roman times. Some extremely well-preserved leafy twigs of box are also known from this site, but the only published record appears to be a photograph used by Dimpleby (1978, unnumbered second plate) in a semi-popular account of archaeobotany.'</p> <p>Gazetteer entries in a regional report on macrofossil plant remains :</p> <p>Site No 8524 Winterton Reference : Williams, D, 1977, 'A consideration of the sub-fossil remains of <i>Vitis vinifera</i> L. s evidence for viticulture in Roman Britain. <i>Britannia</i> 8, 327-34</p> <p>Site No 8528 Winterton AML 1744 Reference : Arthur, JRB, 1975, Identification of seeds from Winterton Villa. Ancient Monuments Lab Report OS 1744</p> <p>Site No 8533 Winterton AML 1945 Reference : Keepax, CA and O'Connor, T, 1975, Waterlogged vegetation from drainage ditch. Interim report. Ancient Monuments Lab Report OS 1945 [3]</p> <p>'All this corner of the County, on the West Side of the Street, was full of Romans in the old Time, as we may conjecture from their Coins, and Many Tiles, and Bricks, that are found here, especially at the Cliff, called Winterton Cliff, where there have been some old Roman Buildings' [4]</p>

Asset/Event Number	264
Asset/Event Name	Scawcliffe RB Cropmarks

Type of Site	Cropmarks
Listing No./NRHE Number	
HER Number	ELS4659; 26783 - MLS26783
Status	Non-designated Heritage Asset
Easting	491051
Northing	415352
Parish	
Council	NORTH LINCOLNSHIRE
Description	<p>*Centre point recorded *Cropmarks shapefile provided by the HER * Rectification of aerial images taken in the 1990s and transcription of the cropmarks in 2020 revealed a definite rectilinear field system. The morphology of the cropmarks and the presence of Romano-British pottery collected during fieldwalking and recovered in the excavations of the Anglo-Saxon cemeteries apparently located within the field system, indicate the features are of Roman date. A possible ring gully is located at NGR SE9105 1533. [1,2,3,4]</p>
